



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2007736
INV Date 17/11/2020
Reference CC6/FCI20001278/Kka3s2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SJT 4245K
Insured Veh. SHC 8429J
Claim No. D20000496MFSH
Policy No. D-18088936MFSH
Accident Date 17/01/2020
Inspection Date 20/01/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC6/FCI20001278/Kka3s2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 17-11-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 8429J	Veh. Inspected	SJT 4245K
Policy No.	D-18088936MFSH	Coverage (\$)	0.00
Claim No.	D20000496MFSH	Excess (\$)	0.00
Assign From		Assign Date	20/01/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA VIOS (M)	c.c	1497
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	MR053HY9305097768	Colour	METALLIC BLUE
Odometer	151821	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/60 R15	NEXEN	6 mm
L/H Front Tyre	185/60 R15	NEXEN	6 mm
R/H Rear Tyre	185/60 R15	NEXEN	8 mm
L/H Rear Tyre	185/60 R15	NEXEN	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	17/01/2020	Inspection Date	20/01/2020
Survey held at	GUAN MOTOR WORKS 176 SIN MING DRIVE #02-03 SIN MING AUTOCARE SINGAPORE 575721		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	5 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 4245K

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	BUCKLED	451.60	451.60
2	REAR BUMPER REFLECTOR	N/S CRACKED	285.80	142.90
2	REAR BUMPER INNER SIDE BRACKET	DISTORTED	112.60	112.60
2	REAR BUMPER SIDE RETAINER	DISTORTED	171.20	171.20
2	REAR BUMPER CORNER RETAINER	MISSING	86.00	86.00
1	SET REAR BUMPER CLIPS	NECESSARY	30.00	30.00
1	REAR BOOT LID	BUCKLED	589.10	589.10
1	REAR BOOT OUTER HANDLE GARNISH	SERVICEABLE	175.00	-
1	REAR BOOT CENTRE "TOYOTA" LOGO	NECESSARY	48.10	48.10
1	REAR BOOT LH "VIOS" EMBLEM	NECESSARY	55.60	55.60
1	REAR BOOT RH "E" EMBLEM	NECESSARY	45.30	45.30
2	REAR BOOT HINGE	TO REPAIR SEE LABOUR	128.00	-
1	REAR BOOT TOP LOCK	DENTED	121.35	121.35
1	REAR BOOT LOWER LOCK CATCH	TO REPAIR SEE LABOUR	41.40	-
2	TAILLAMP PANEL	TO REPAIR SEE LABOUR	257.00	-
2	TAILLAMP	MTG CRACKED	665.20	665.20
1	REAR END PANEL	BENT	575.00	575.00
1	REAR END PANEL TOP GARNISH	DENTED	211.40	211.40
1	REAR SPARE TYRE PANEL	TO REPAIR SEE LABOUR	682.50	-
1	REAR SPARE TYRE TOP BOARD	DENTED	139.50	139.50
1	REAR COMPARTMENT CENTRE FOAM TRAY	SERVICEABLE	167.50	-
2	REAR COMPARTMENT TOP SIDE BOARD	SERVICEABLE	96.00	-
1	REAR COMPARTMENT RH FOAM TRAY	SERVICEABLE	192.36	-
1	REAR COMPARTMENT LH FOAM TRAY	SERVICEABLE	154.35	-
2	REAR FENDER INNER SIDE TRIM	SERVICEABLE	451.00	-
1	SET REAR FENDER INNER SIDE TRIM CLIPS	NOT NECESSARY	60.00	-
1	REAR EXHAUST SILENCER	BENT	811.30	652.70

Report Ref No. CC6/FCI20001278/Kka3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-1,701.04	-1,024.39
			5,103.12	3,073.16
1	REAR BOOT WEATHERSTRIP (@ \$176.80 DISC 50%) (SN)	CUT	176.80	88.40
	LESS 25% DISCOUNT		-44.20	-
			132.60	88.40
	<u>SPECIAL NETT ITEMS</u>			
1	SET REVERSE SENSORS (SN)	DENTED	250.00	200.00
1	SET REVERSE CAMERA (SN)	SERVICEABLE	550.00	-
1	REAR NUMBER PLATE (SN)	SERVICEABLE	50.00	-
1	REAR BUMPER LOWER SKIRTING (SN)	CRACKED	800.00	800.00
1	REAR EXHAUST TAIL CHROME PIPE (SN)	DENTED	120.00	120.00
1	SET REAR SPARE TYRE / END PANEL SEALANT (SN)	NECESSARY	100.00	30.00
			1,870.00	1,150.00
	<u>LABOUR</u>			
	LABOUR CHARGES FOR REMOVE / REFIT, CUTTING / WELDING AND REPLACEMENT OF DAMAGES. INCLUSIVE OF THE REPAIR OF REAR BOOT HINGE, REAR BOOT LOWER LOCK CATCH, TAILLAMP PANEL AND REAR SPARE TYRE PANEL.		1,300.00	700.00
	TO PUTTY AND SPRAY SPRAY PAINTINGS CHARGES.		1,200.00	900.00
	TO CHECK WIRINGS AND LIGHTINGS.		40.00	20.00
	TO REMOVE, REFIT REVERSE SENSORS & REVERSE CAMERA.		100.00	50.00
	TO REMOVE, REFIT REAR BOOT LID FITTINGS.		80.00	50.00
	TO REMOVE, REFIT REAR UPHOLSTERY AND ATTACHMENTS.		150.00	60.00
	TO REMOVE, REFIT REAR EXHAUST SILENCER.		80.00	60.00
	TO SUPPLY AND APPLY ANTI RUST TREATMENT.		80.00	60.00
			3,030.00	1,900.00
	GRAND TOTAL		10,135.72	6,211.56
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,900.00

Report Ref No. CC6/FCI20001278/Kka3s2



Report Ref No. CC6/FCI20001278/Kka3s2

A handwritten signature in black ink, consisting of the letters 'KSC' in a stylized, cursive script.

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 4245K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 4245K

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 4245K

RE-INSPECTION

