

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG20001677/KES3Q2

Date: 01/03/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1900058117

Claimant
Vehicle No : SKZ399H **Insured Vehicle No :** SFD62D

Date of Loss: 18/01/2020 Nature of Claim: TP Claim No: 0044818669SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKZ399H		
Make & Model:	MERCEDES-BENZ GLA180, 1.6 (A)	Engine No:	27091030585824
Reg. Date:	04/12/2015 (Man. Year: 2015)	Chassis No:	WDC1569422J096849
Colour:	Metallic Pearl White	Odometer:	65804 km
Engine Capacity:	1595 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	235/50 R18	Rear Tyre Size:	235/50 R18
Front Left Side:	Pirelli 9 mm	Rear Left Side:	Pirelli 9 mm
Front Right Side:	Pirelli 9 mm	Rear Right Side:	Pirelli 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	12,447.67	11,164.92	1,282.75	10.31
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,600.00	1,630.00	970.00	37.31
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	15,047.67	12,794.92	2,252.75	14.97
+ GST 7.00/7.00% (S\$)	1,053.34	895.64	157.70	14.97
Nett Amount (S\$)	16,101.01	13,690.56	2,410.45	14.97
+ Car Rental (20.0 x S\$100.00/day) (S\$)		2,000.00		
+ Doc/Search Fee (S\$)		2.00		
+ Other Costs (S\$)		50.00		
Nett Liability (S\$)		15,742.56		

INSPECTION

Date of Assignment: 31/01/2020

Date Inspected: 31/01/2020 Inspected At: Optima Werkz Pte Ltd (HQ)
6 Kung Chong Road
Singapore 159143

Estimated Period of Repair: 6.0 days

Adjuster: KENNETH KONG

Manager: Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET	Bent	1,326.76 FL	*1,326.76 FL
2	1		*FRONT GRILLE BASE	Missing	262.90 FL	*262.90 FL
3	1		*FRONT GRILLE GARNISH	Missing	184.51 FL	*184.51 FL
4	4		*FRONT GRILLE MOULDING	Missing	248.32 FL	*248.32 FL
5	1		*FRONT GRILLE EMBLEM	Missing	134.92 FL	*134.92 FL
6	8		*FRONT GRILLE CLIPS	Missing	57.60 FL	*57.60 FL
7	1		*FRONT GRILLE INNER RETAINER GUIDE	Missing	103.60 FL	*103.60 FL
8	1		*FRONT BUMPER	Broken	1,412.55 FL	*1,372.80 FL
9	1		*FRONT BUMPER REINFORCEMENT	Bent	308.36 FL	*308.36 FL
10	1		*FRONT BUMPER FOG LAMP LH	Cracked	285.42 FL	*285.42 FL
11	1		*FRONT BUMPER FOG LAMP SUPPORT BRACKET LH	Distorted	45.34 FL	*45.34 FL
12	1		*FRONT BUMPER GARNISH SIDE COVER LH	Missing	45.81 FL	*45.81 FL
13	1		*FRONT BUMPER LOWER GRILLE	Missing	118.34 FL	*118.34 FL
14	1		*FRONT BUMPER LOWER LIP COVER	Missing	581.36 FL	*581.36 FL
15	1		*FRONT BUMPER LOWER LIP SIDE COVER LH	Serviceable	80.14 FL	*- FL
16	1		*FRONT BUMPER SIDE BRACKET LH	Distorted	17.68 FL	*17.68 FL
17	1		*FRONT BUMPER SIDE BRACKET RH	Distorted	17.68 FL	*17.68 FL
18	1		*FRONT BUMPER UPPER BRACKET LH	Cracked	296.40 FL	*99.00 FL
19	1		*FRONT BUMPER UPPER BRACKET RH	Cracked	296.40 FL	*99.00 FL
20	12		*FRONT BUMPER CLIPS	Necessary	78.00 FL	*78.00 FL
21	1		*FRONT BUMPER ABSORBER FOAM	Missing	102.89 FL	*102.89 FL
22	1		*FRONT NUMBER PLATE HOLDER SUPPORT	Missing	272.80 FL	*272.80 FL
23	1		*FRONT REINFORCEMENT SUPPOET LOWER BRACKET LH	Bent	81.88 FL	*81.88 FL
24	1		*FRONT HEADLAMP LH	Mtg Broken	927.00 FL	*927.00 FL
25	1		*FRONT HEADLAMP RH	Cracked	927.00 FL	*927.00 FL
26	1		*FRONT SUPPORT PANEL ASSY	Cracked	595.17 FL	*595.17 FL
27	1		*FRONT LOWER GUIDE COVER	Cracked	264.80 FL	*264.80 FL
28	1		*FRONT AIR CLEANER DUCT	Serviceable	98.94 FL	*- FL
29	1		*FRONT TUBRO INTER COOLER ASSY	Punctured	955.39 FL	*955.39 FL
30	1		*FRONT AIR CON CONDENSOR	Bent / Punctured	1,045.40 FL	*1,045.40 FL
31	1		*FRONT RADIATOR	Bent	856.00 FL	*840.00 FL
32	1		*FRONT RADIATOR FAN GUARD	Serviceable	426.25 FL	*- FL
33	1		*FRONT WIPER TANK	Serviceable	151.49 FL	*- FL
34	1		*FRONT ENGINE UNDER COVER	Missing	181.69 FL	*181.69 FL
35	1		*FRONT FENDER EXTENSION COVER LH	Distorted	194.80 FL	*194.80 FL
36	1		*FRONT FENDER EXTENSION COVER RH	Distorted	194.80 FL	*194.80 FL
37	1		*FRONT FENDER INNER LINER LH	Cracked	191.71 FL	*170.00 FL
38	1		*FRONT FENDER INNER LINER RH	Cracked	191.71 FL	*170.00 FL
39	1		*FRONT BONNET LOCK	Repair	135.60 FL	*- FL
40	1		*FRONT FENDER LH (NPA)	Repair	0.00 FL	*- FL
41	1		*FRONT FENDER RH (NPA)	Repair	0.00 FL	*- FL
42	1		*FRONT NUMBER PLATE }	Missing	40.00 FS	*45.00 FS
43	1		*FRONT NUMBER PLATE HOLDER }		40.00 FS	*- FS
44	1		*FRONT RADIATOR COOLANT	Necessary	40.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 13,817.41 **12,396.02**
- List Item Discount on L Items 10.00/10.00% (\$\$) 1,369.74 1,231.10

Total Parts (\$\$) 12,447.67 **11,164.92**

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	LABOUR CHARGES TO REMOVE,REPLACE ,REPAIR ,READJUST FRONT ACCIDENT AREAS & ETC	New	1,100.00	600.00
2	LABOUR CHARGES TO CHECK WIRING & ELECTRICAL SYSTEM	New	100.00	30.00
3	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT FRONT BONNET ,FRONT BUMPER ,FRONT FENDER LH ,FRONT FENDER RH & ETC	New	1,000.00	800.00
4	LABOUR CHARGES TO REMOVE ,REPLACE TURBO INTER COOLER ,AIR CON CONDENSOR RADIATOR & ETC	New	150.00	100.00
5	LABOUR CHARGES TO REFILL AIR CON GAS & VACUUM	New	100.00	100.00
6	LABOUR CHARGES TO DIAGNOSE FAULTY CODE & RESET MEMORY	New	150.00	0.00
Gross Labour Cost (\$\$)			2,600.00	1,630.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >