Adjuster Report Page 1 of 4

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG20001693/KKS3N2

Date: 20/05/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100371988

Claimant
Vehicle No: SJZ115Y

Insured Vehicle No: SKN2500G

Date of Loss: 22/01/2020 Nature of Claim: TP Claim No: 2462266954SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SJZ115Y

Make & Model: MERCEDES-BENZ CLS450, 3.0 AMG LINE Engine No: 25693030007340

Reg. Date: 15/11/2018 (Man. Year: 2018) Chassis No: WDD2573592A012700

Colour: Metallic Grey Odometer: 24993 km

Engine Capacity: 2999 cc
Market Value/New Car

Market Value/New Car
Price:
N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/35 R20 Rear Tyre Size: 245/35 R20
Front Left Side: Michelin 8 mm Rear Left Side: Michelin 8 mm
Front Right Side: Michelin 8 mm Rear Right Side: Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		10,444.50	8,300.70	2,143.80	20.53
Miscellaneous Items		0.00	0.00	0.00	
Labour		2,895.00	1,130.00	1,765.00	60.97
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Nett Amount (S\$)	13,339.50	9,430.70	3,908.80	29.30

+ Loss of Use (4.0 x S\$150.00/day) (S\$) 600.00 + Doc/Search Fee (S\$) 7.45 Nett Liability (S\$) 10,038.15

INSPECTION

Date of Assignment: 29/01/2020

Date Inspected: 31/01/2020 Inspected At: Lim Yew Boo Spray Paint Co (HQ)

Blk 10 Sin Ming Industrial Estate, #01-

10

Singapore 575645

Estimated Period of Repair: 4.0 days

Adjuster: KENNETH KONG Manager: Khanchna Pothuraj

Adjuster Report Page 2 of 4

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Adjuster Report Page 3 of 4

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Buckled / Cut	2,145.00 FN	*2,145.00 FN
2	1		*FRONT BUMPER RETAINER /RH	Distorted	108.00 FN	*108.00 FN
3	1		*FRONT SENSOR	Cut	265.00 FN	*265.00 FN
4	1		*FRONT HEADLAMP /RH	Cut	6,500.00 FN	*6,500.00 FN
5	1		*FRONT HEADLAMP CLIPS	Not Necessary	10.00 FN	*- FN
6	1		*FRONT HEADLAMP LOWER BRACKET /RH	Not Necessary	820.00 FN	*- FN
7	1		*FRONT FENDER /RH	Repair	1,398.00 FN	*- FN
8	1		*FRONT FENDER INNER SHIELD /RH	Serviceable	114.00 FN	*- FN
9	8		*FRONT FENDER INNER SHIELD CLIP/RH	Not Necessary	40.00 FN	*- FN
10	1		*FRONT EMBLEM	Necessary	75.00 FN	*75.00 FN
11	1	part. N=Nett	*RIVERT (26 PCS)	Necessary	130.00 FN	*130.00 FN
г-гіа	IIICIIISE	pari. N-Neii	itempisc.	Sub Total (S\$)	11,605.00	9,223.00
			- Nett Item Discount on N Items	10.00/10.00% (S\$)	1,160.50	922.30
				Total Parts (S\$)	10,444.50	8,300.70
			Report was unsubmitted during th	is print-out.		

Adjuster Report Page 4 of 4

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

Particulars	Lab.Type	Repairer's	Amount
our Items			
TO APPLY RUST-PROOFING ON REPAIRED /REPLACED PANELS	New	120.00	0.00
TO FOCUS HEADLAMP & CHECK HEADLAMP WIRING FUNCTION }	New	55.00	20.00
TO CHECK & RECTIFT WIRING SYSTEM }	New	120.00	0.00
TO RE-SET ABS SYSTEM & EARSE REGISTERED FAULT	New	150.00	0.00
TO REPAIR AFFECTED RIGHT FRT RIM	New	150.00	100.00
TO CHECK COMPUTERISE WHEEL ALIGNMENT	New	120.00	60.00
LABOUR TO REPLACE THE SENSOR & CHECK SENSOR FUNCTIONS	New	80.00	50.00
TO REPAIR ,ALIGN ,PANEL BEAT IN AFFECTED AREA & LABOUR TO REPLACE ABOVE MENTIONED PARTS	New	800.00	400.00
TO DO NANO COATING ON AFFECTED PORTION	New	500.00	0.00
TO PUTTY ,PRIMER & SPRAY PAINT ON RIGHT FRT FENDER ,FRT BUMPER ,SENSOR USING 2K PAINT	New	800.00	500.00
Gross Labor	2,895.00	1,130.00	
	TO APPLY RUST-PROOFING ON REPAIRED /REPLACED PANELS TO FOCUS HEADLAMP & CHECK HEADLAMP WIRING FUNCTION } TO CHECK & RECTIFT WIRING SYSTEM } TO RE-SET ABS SYSTEM & EARSE REGISTERED FAULT TO REPAIR AFFECTED RIGHT FRT RIM TO CHECK COMPUTERISE WHEEL ALIGNMENT LABOUR TO REPLACE THE SENSOR & CHECK SENSOR FUNCTIONS TO REPAIR ,ALIGN ,PANEL BEAT IN AFFECTED AREA & LABOUR TO REPLACE ABOVE MENTIONED PARTS TO DO NANO COATING ON AFFECTED PORTION TO PUTTY ,PRIMER & SPRAY PAINT ON RIGHT FRT FENDER ,FRT BUMPER ,SENSOR USING 2K PAINT	TO APPLY RUST-PROOFING ON REPAIRED /REPLACED New PANELS TO FOCUS HEADLAMP & CHECK HEADLAMP WIRING NEW FUNCTION } TO CHECK & RECTIFT WIRING SYSTEM } TO RE-SET ABS SYSTEM & EARSE REGISTERED FAULT New TO REPAIR AFFECTED RIGHT FRT RIM New TO CHECK COMPUTERISE WHEEL ALIGNMENT New LABOUR TO REPLACE THE SENSOR & CHECK SENSOR New FUNCTIONS TO REPAIR ,ALIGN ,PANEL BEAT IN AFFECTED AREA & New LABOUR TO REPLACE ABOVE MENTIONED PARTS TO DO NANO COATING ON AFFECTED PORTION New TO PUTTY ,PRIMER & SPRAY PAINT ON RIGHT FRT New	TO APPLY RUST-PROOFING ON REPAIRED /REPLACED New 120.00 PANELS TO FOCUS HEADLAMP & CHECK HEADLAMP WIRING New 55.00 FUNCTION } TO CHECK & RECTIFT WIRING SYSTEM } New 120.00 TO RE-SET ABS SYSTEM & EARSE REGISTERED FAULT New 150.00 TO REPAIR AFFECTED RIGHT FRT RIM New 150.00 TO CHECK COMPUTERISE WHEEL ALIGNMENT New 120.00 LABOUR TO REPLACE THE SENSOR & CHECK SENSOR New 80.00 FUNCTIONS TO REPAIR ,ALIGN ,PANEL BEAT IN AFFECTED AREA & New 800.00 LABOUR TO REPLACE ABOVE MENTIONED PARTS TO DO NANO COATING ON AFFECTED PORTION New 500.00 TO PUTTY ,PRIMER & SPRAY PAINT ON RIGHT FRT New 800.00

< END OF ESTIMATES >

Report was unsubmitted during this print-out.