

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG20001918/ADS3Q2

Date: 06/07/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2000002865
Claimant
Vehicle No : SJE2679J **Insured Vehicle No :** SMR5964L
Date of Loss: 02/02/2020 **Nature of Claim:** TP **Claim No:** 1689472631SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SJE2679J**
 Make & Model: HONDA STREAM, 1.7 (A) Engine No: R18A1768129
 Reg. Date: 18/04/2008 (Man. Year: 2008) Chassis No: RN61061093
 Colour: Brown Odometer: 336160 km
 Engine Capacity: 1799 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/50 R17 Rear Tyre Size: 215/50 R17
 Front Left Side: Yokohama 6 mm Rear Left Side: Yokohama 6 mm
 Front Right Side: Yokohama 6 mm Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	7,953.30	2,262.56	5,690.74	71.55
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,310.00	1,260.00	2,050.00	61.93
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	11,263.30	3,522.56	7,740.74	68.73
Approved Total (Overridden) (S\$)		2,800.00		
Nett Amount (S\$)	11,263.30	2,800.00	8,463.30	75.14
+ Car Rental (3.0 x S\$100.00/day) (S\$)		300.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		3,102.00		

INSPECTION

Date of Assignment: 04/02/2020
 Date Inspected: 04/02/2020 Inspected At: Sm Automotive - Kaki Bukit (HQ)
 BLOCK C - 1, KAKI BUKIT AVE 6,
 #01-43
 Singapore 417883
 Estimated Period of Repair: 5.0 days

Adjuster: ADRIAN LING

Manager: CHAN JIA LE

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Repair	686.10 F	*- FL
2	1		*FRONT BUMPER CLIP	Not Necessary	6.50 F	*- FL
3	2		*FRONT BUMPER SIDE RETAINER	Not Necessary	56.80 F	*- FL
4	1		*FRONT R/H BUMPER FOG LAMP	Not Necessary	295.00 F	*- FL
5	1		*FRONT R/H BUMPER FOG LAMP COVER	Not Necessary	58.00 F	*- FL
6	1		*FRONT R/H HEAD LAMP	Cut	1,369.80 F	*689.00 FL
7	1		*FRONT R/H HEAD LAMP LOWER BRACKET	Cracked	36.80 F	*36.80 FL
8	1		*FRONT R/H FENDER	Dented	486.20 F	*486.20 FL
9	1		*FRONT R/H FENDER COWLING	Not Necessary	182.70 F	*- FL
10	10		*FRONT R/H FENDER COWLING CLIP	Not Necessary	65.00 F	*- FL
11	1		*FRONT R/H RIM	Cut	850.00 FS	*450.00 FS
12	1		*FRONT R/H TYRE	Not Necessary	350.00 F	*- FL
13	1		*FRONT R/H LOWER ARM	Bent	328.20 F	*328.20 FL
14	1		*FRONT R/H KNUCKLE ARM	Damaged	267.40 F	*267.40 FL
15	1		*FRONT R/H KNUCKLE ARM BEARING	Damaged	142.60 F	*142.60 FL
16	1		*FRONT R/H SHOCK ABSORBER	Bent	315.50 F	*315.50 FL
17	1		*FRONT R/H DRIVE SHAFT	Not Necessary	997.40 F	*- FL
18	1		*FRONT STEERING RACK	Not Necessary	1,459.30 F	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	7,953.30	2,715.70
- List Item Discount on L Items 0.00/20.00% (\$\$)	0.00	453.14
Total Parts (\$\$)	7,953.30	2,262.56

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE & REFIT FRONT R/H UNDERCARRIAGE	New	380.00	220.00
2	TO REMOVE & REFIT R/H DRIVE SHAFT & STEERING RACK	New	450.00	0.00
3	TO CHECK WHEEL ALIGNMENT	New	150.00	80.00
4	TO CHECK WIRING	New	80.00	30.00
5	TOWING FEE	New	100.00	0.00
6	TUFF KOTE	New	150.00	30.00
7	PANEL BEATING	New	1,000.00	500.00
8	SPRAY PAINTING	New	1,000.00	400.00
Gross Labour Cost (\$\$)			3,310.00	1,260.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >