



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101931

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 24/03/2021
Reference CC4/FCI20002110/Apa3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKW 2905A
Insured Veh. SHB 2382D
Claim No. D20000835MFSH/1
Policy No. D-20094921MFSH
Accident Date 04/02/2020
Inspection Date 02/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20002110/Apa3q2	
			Date: 24/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHB 2382D	Veh. Inspected	SKW 2905A	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D20000835MFSH/1	Excess (\$)	0.00	
Assign From	MERINA CHIA	Assign Date	06/02/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALTIS	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	MR053REH104538598	Colour	SILVER	
Odometer	332821 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	HABILEAD	6 mm	
L/H Front Tyre	205/55 R16	HABILEAD	6 mm	
R/H Rear Tyre	205/55 R16	HABILEAD	6 mm	
L/H Rear Tyre	205/55 R16	HABILEAD	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/02/2020	Inspection Date	02/03/2020	
Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKW 2905A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT AIRCON CONDENSER	WARPED	1,536.00	1,536.00
1	FRONT BONNET MECHANISM LOCK	NOT NECESSARY	271.85	-
1	FRONT BRACE PANEL	BENT	182.10	182.10
1	FRONT BUMPER	DEFORMED	581.45	581.45
1	FRONT BUMPER INNER SPONGE	CRACKED	186.10	186.10
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	191.40	-
1	FRONT BUMPER REINFORCEMENT	BENT	374.45	374.45
2	FRONT BUMPER SIDE RETAINER L/R @\$132.10	NOT NECESSARY	264.20	-
1	FRONT GRILLE	CRACKED	643.00	643.00
1	FRONT GRILLE 'LOGO' EMBLEM	NECESSARY	65.45	65.45
1	FRONT GRILLE UPPER COVER	DEFORMED	92.00	92.00
1	FRONT GRILLE UPPER SEAL	NOT NECESSARY	81.90	-
2	FRONT HEADLAMP L/R @\$927.60	CRACKED	1,855.20	1,855.20
2	FRONT HEADLAMP LOWER BRACKET L/R @\$132.10	NOT NECESSARY	264.20	-
1	FRONT TOP PANEL	TO REPAIR SEE LABOUR	280.00	-
	LESS 25% DISCOUNT		-1,717.33	-1,378.94
			5,151.97	4,136.81
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET FRONT GRILLE UPPER COVER CLIPS (SN)	NECESSARY	30.00	10.00
1	FRONT NUMBER PLATE (SN)	BENT	25.00	25.00
1	FRONT NUMBER PLATE HOLDER (SN)	DEFORMED	50.00	30.00
			155.00	95.00
	<u>LABOUR</u>			
	TO REMOVE,CHARGE AIR CON PARTS ,VACUUMS ,REFILL AIR CON GAS.		120.00	120.00
	TO REMOVE,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING (TO FR).		50.00	30.00
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT .		700.00	500.00

Report Ref No. CC4/FCI20002110/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE ,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .INCLUSIVE OF THE REPAIR OF FRONT TOP PANEL .		600.00	400.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.	NOT NECESSARY	50.00	-
			1,520.00	1,050.00
GRAND TOTAL			6,826.97	5,281.81
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,200.00

Report Ref No. CC4/FCI20002110/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKW 2905A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKW 2905A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

