

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSE

SINGAPORE 068877

INV No. AC2006820

INV Date 02/10/2020

Reference CC6/FCI20002245/Uea3q2

Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJS 1530L

Insured Veh. SH 8249E

Claim No. D200000943MFSH

Policy No. D-18088936MFSH

Accident Date 08/02/2020

Inspection Date 10/02/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile			
MS F	FIRST CAPITAL INSURANCE LTD Ref: CC6/FCl20002245/Uea3q2			
	OBINSON ROAD 01 CITY HOUSES	INGAPORE 068877	Date: 02-10-2020 Code: FCI2	
1.		Policy Particulars	- THIRD PARTY CLAIM	
	Insured Veh.	SH 8249E	Veh. Inspected	SJS 1530L
	Policy No.	D-18088936MFSH	Coverage (\$)	0.00
	Claim No.	D200000943MFSH	Excess (\$)	0.00
	Assign From		Assign Date	10/02/2020
2.		Vehicle Partic	culars & Condition	
	Make & Model	HONDA FREED (A)	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2009
	Chassis No.	GB31106545	Colour	MAROON
	Odometer	110473	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3.		Condition	ons of Tyres	_
		Size	Make	Balance
	R/H Front Tyre	185/65 R15	MICHELIN	6 mm
	L/H Front Tyre	185/65 R15	MICHELIN	6 mm
	R/H Rear Tyre	185/65 R15	MICHELIN	6 mm
	L/H Rear Tyre	185/65 R15	MICHELIN	6 mm
4.	,	Description	on of Damages	
	THE VEHICLE SUS	STAINED DAMAGES AT THE REA	AR PORTION.	
	DAMAGES SEE DI	ETAILS.		
5.		General	Information	
	Accident Date	08/02/2020	Inspection Date	10/02/2020
	Survey held at	FASTECH AUTO PTE LTD		
		1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a.		Re	emarks	
		ON WAS CONDUCTED ON A"WIT CE TO YOUR INSTRUCTIONS, W		REPAIRS.
5b.	Estimate Days of Repair			
	ESTIMATED NORMAL PERIOD FOR REPAIR: 5 Working Days			



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJS 1530L

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR WINDSCREEN MOULDING	NECESSARY	118.50	118.50
1	TAILGATE	BADLY DENTED	1,455.20	1,288.50
1	TAILGATE REAR LOGO	NECESSARY	68.50	35.20
1	TAILGATE "FREED" EMBLEM	NECESSARY	66.20	66.20
1	TAILGATE OUTER HANDLE	TO REPAIR SEE LABOUR	341.10	-
1	TAILGATE INNER TRIM BOARD	DEFORMED / CRACKED	745.20	433.20
1	TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	50.00	50.00
1	TAILGATE WEATHERSTRIP	TWISTED	299.00	299.00
1	TAILGATE INNER LOCK	DENTED / JAMMED	366.50	265.00
1	TAILGATE INNER PULLPOCKET	CRACKED	66.50	66.50
1	REAR BUMPER	DENTED / DEFORMED	1,050.00	685.20
2	REAR BUMPER SIDE RETAINERS @\$35.00	NOT NECESSARY	70.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
2	REAR BUMPER BRACKETS @\$68.50	NOT NECESSARY	137.00	-
1	REAR END PANEL	BADLY DENTED	655.10	622.30
1	REAR END PANEL TOP GARNISH	TWISTED	288.20	288.20
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,420.00	-
1	REAR FLOOR PANEL TOP CLOTH	SERVICEABLE	288.20	-
2	TAILLAMPS @\$380.20	CRACKED	760.40	760.40
2	REAR FENDER INNER TRIM BOARDS @\$455.10	DEFORMED / CRACKED	910.20	910.20
1	REAR EXHAUST	TO REPAIR SEE LABOUR	662.30	-
	LESS 20% DISCOUNT		-	-1,187.68
			9,868.10	4,750.72
	SPECIAL NETT ITEMS			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR LICENCE PLATE W/HOLDER (SN)	BENT	50.00	40.00

Report Ref No. CC6/FCI20002245/Uea3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	50.00	40.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	280.00	-
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	SET REAR REVERSE CAMERA (SN)	SHORTED	480.00	380.00
			1,190.00	700.00
	LABOUR			
	TO CHECK WIRING.		80.00	30.00
	TO DISMANTLE & REPLACING REAR REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO TRANSFER TAILGTAE COMPONENTS.		100.00	60.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	80.00
	TO DISMANTLE & REFIX REAR EXHAUST.		100.00	60.00
	TO SPRAY RUST PROOFING.		100.00	60.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF TAILGATE OUTER HANDLE,REAR FLOOR PANEL AND REAR EXHAUST.		1,800.00	800.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	1,000.00
			4,030.00	2,260.00
	GRAND TOTAL		15,088.10	7,710.72

RECOMMENDED COST OF LUMP SUM REPAIRS		6,150.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CC6/FCI20002245/Uea3q2

CHUA KANG SENG

Licensed Appraiser




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 1530L



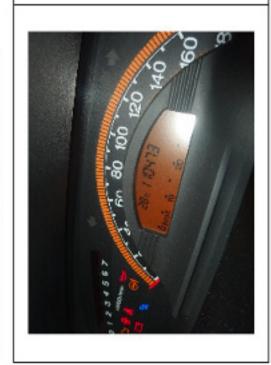













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3591 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No: 19-9607198-R





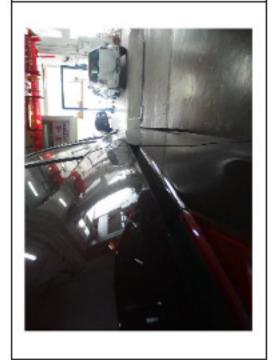









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No: 19-9607198-R












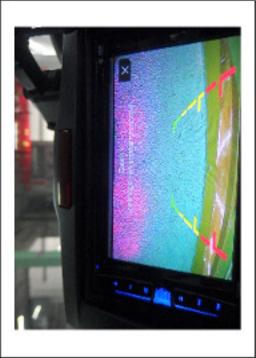



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Sngapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 1530L
















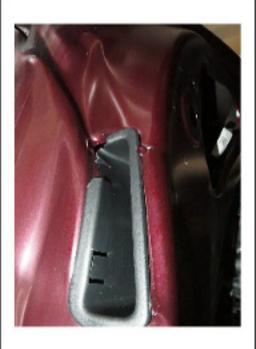



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315

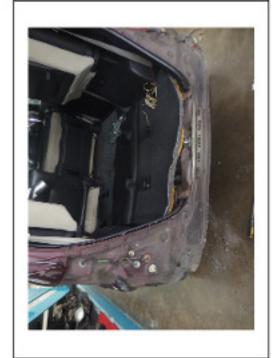

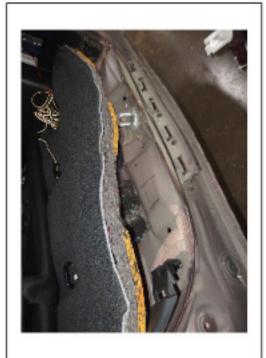











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315












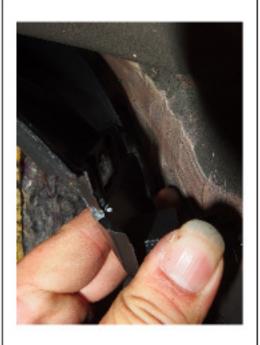




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933





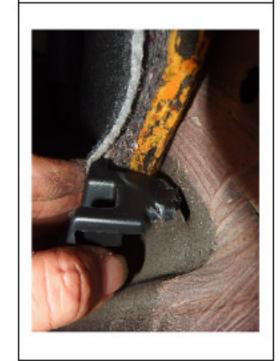










51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315



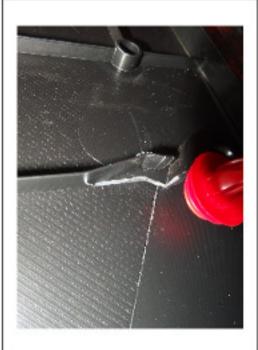











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933



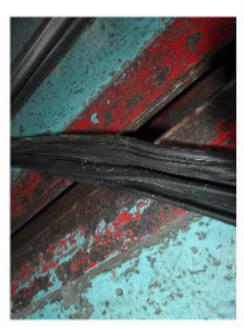











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 1530L

RE-INSPECTION











