...CLAIM SUBFOLDER...(Pending for Survey Report)

LAIM SUB	OLDER TRA	CKING								
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Su	ubmitted	Ins Auth'ed	1	Status	
Main	13 Feb 2020		14 Feb 2020 11:34 Edit Adj Rpt	S\$1,200.00 Edit Estimates	A Distriction	00.00 Rpt			Pending for Report Cancel Case	10
-	Main	R	eference	Claim De	tails		Docume	ents		Show All
CLAIM SU	BFOLDER DE	TAILS	The state of the s	A SPECIAL PROPERTY OF THE PERSON NAMED IN COLUMN 1	1	Created I	by insurer]	No. of Concession,		ALCOHOLD DO
Insured:	-, Co. Re	g. No.: -					-			
Main Claimant:	F. S. FREI	GHT SYSTEMS P	TE LTD, Co. Reg.	No.: G7811407Q						
Vehicle Reg. No.:	YN7828	м		Date of	Luce.		09:00 - :59 and 7 Days F	rom LTA	Reg Date (f	fan Yr)1
Claim Type:	TP / SNN	120D200807/C	02	Policy/C Note No	over c	Carolina viculation	288619011			
Vehicle Reg. No. (Insured):	Policy No. (Claimant): 5088563870-02									
				Excess:						
Repairer:	Ryder Aut	to Pte Ltd (HQ) 2	Kaki Bukit Ave 2, #	02-19 AutoHub @	Kaki Buk	it, 417921	Kaki Bukit - T	el:		
Handling Insurer:	China Tai	ping Insurance (Singapore) Pte. Lt	d. (HQ) - Tel: 638	9 6111	[Handled	by Cecilia Lo	ow - 638	96530]	
Claimant's Insurer:	NTUC Inc	ome Insurance C	o-operative Ltd (F	IQ) - Tel:						
Adjuster:	LKK Auto	Consultants Pte	Ltd (HQ) - Tel: 625	6-3561 [Handle	by OI	SUN PIN	[Final R	ot due	25/02/202	01
Adj Asg. Remarks:			firm TP vehicle mak							
ASSOCIATI	ED MAIL RE	CEIVED						View All	Composi	Case Mail
There are no	mail for this	case.					_		1	
ALL ASSO	CIATED TAS	KS⊟			Vie	w All Se	earch Tasks	Create	New Task	Complete
Due Date	Priority	Type Task	Group Subject	Handler A	ssigned		Completed O			
No results.			p Judject	.idilatei	Jarymeu		completed 0	23	Created On	Done

Claim Documents

	Upload Documents Upload Photos Compose New Letter		View View	-	_
	tos/Images		3 per page		V
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		mbnail	-
1	23/03/20 11:16	Chassis Number		d JPG	V
2	23/03/20 11:16	Odometer Reading		d JPG	V
3	23/03/20 11:16	General View		d JPG	Z
4	23/03/20 11:16	General View		d JPG	₹
5	23/03/20 11:16	General View		d JPG	<u>~</u>
6	23/03/20 11:16	General View		d JPG	V
7	23/03/20 11:16	General View		d JPG	✓
8	23/03/20 11:16	General View	■ Loa	d JPG	V
9	23/03/20 11:16	General View		d JPG	☑
10	23/03/20 11:17	General View	1 Loa	d JPG	✓
11	23/03/20 11:17	General View	1 Loa	d JPG	✓
12	23/03/20 11:17	General View	O Loa	id JPG	✓
13	23/03/20 11:17	General View	■ Loa	d JPG	V
14	23/03/20 11:17	General View	€ Loa	d JPG	V
15	23/03/20 11:17	General View	1 Loa	d JPG	V
16	23/03/20 11:17	General View	1 Loa	d JPG	V
17	23/03/20 11:17	General View	● Loa	d JPG	☑
18	23/03/20 11:17	General View	3 Loa	d JPG	V
19	23/03/20 11:17	General View	1 Loa	d JPG	V
20	23/03/20 11:17	General View	1 Loa	d JPG	V
21	23/03/20 11:17	General View	■ Loa	d JPG	V
22	23/03/20 11:17	General View	1 Loa	d JPG	✓
23	23/03/20 11:17	General View	1 Loa	d JPG	V
24	23/03/20 11:17	General View	1 Loa	d JPG	V
25	23/03/20 11:17	General View	3 Loa	d JPG	V
26	23/03/20 11:17	General View	1 Loa	d JPG	V
27	23/03/20 11:17	General View	1 Loa	d JPG	V
28	23/03/20 11:17	General View	① Loa	d JPG	V
29	23/03/20 11:17	General View		d JPG	V
30	23/03/20 11:19	After Repair Photo		d JPG	V
31	23/03/20 11:19	After Repair Photo		d JPG	V

Linked Accident Report Documents

View View in Browser 🗸

Ass	essment Reports		1 per pa	ige 🗸	✓
No	Finalized On	STA INSPECTION PTE LTD (Boon Lay)		Thumbnail	Print
1	10/02/20 17:38	Accident Statement	0	Load HTM	
Pho	otos/Images		3 per pa	ige 🔻	V
No	Finalized On	STA INSPECTION PTE LTD (Boon Lay)		Thumbnail	-
1	10/02/20 17:25	Accident Photo	0	Load JPG	V
2	10/02/20 17:25	Accident Photo	0	Load JPG	✓
3	10/02/20 17:25	Accident Photo	0	Load JPG	✓
4	10/02/20 17:25	Accident Photo	0	Load JPG	V
5	10/02/20 17:25	Accident Photo	0	Load JPG	V
6	10/02/20 17:25	Accident Photo	0	Load JPG	V
7	10/02/20 17:25	Accident Photo	0	Load JPG	V
8	10/02/20 17:25	Accident Photo	0	Load JPG	V
9	10/02/20 17:25	Accident Photo	0	Load JPG	V
10	10/02/20 17:25	Accident Photo	0	Load JPG	☑
Do	cumentation		1 per pa	age 🔻	☑
No	Finalized On	STA INSPECTION PTE LTD (Boon Lay)		Thumbnail	Print
1	10/02/20 17:31	Sketch Plan	0	Load JPG	✓
2	10/02/20 17:31	Sketch Plan #2	0	Load JPG	V
3	10/02/20 17:32	Common Statement	0	Load JPG	☑
4	10/02/20 17:32	Common Statement	0	Load JPG	V
5	10/02/20 17:32	Common Statement	0	Load JPG	☑
6	10/02/20 17:32	Common Statement	0	Load JPG	V

Documents Checklist

DOCUMENTS CHECKLIST	Reset Save Print
There are no document checklists configured.	
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)	
Show Remarks To: Handling Insurer Note: Remarks are private unless you show it to other parties.	

LKK Auto Consultants Pte Ltd (Co.Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No:

CS/CTI20002593/QVF3E2

Date:

31/03/2020

Claim

No:

REFERENCE

Handling Insurer:

China Taiping Insurance

(Singapore) Pte. Ltd.

Policy No:

Nature of Claim: TP

DMCVSN18288619011

Claimant Vehicle

No:

YN7828M

No:

Insured Vehicle YM7578P

SNM20D200807/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

09/02/2020

Reg No:

YN7828M

Make & Model:

Date of Loss:

UD TRUCKS CONDOR PK, 7.0 D (M)

Engine No: Chassis No: Odometer:

GH7208366 PKC8E30548

229105 km

Reg. Date: Colour:

02/04/2015 (Man. Year: 2015) White

Engine Capacity:

7013 cc

Market Value/New Car Price:

N/A

Sum Insured (S\$):

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:

Steering (Serviceable):

Yes Engine Modification:

Yes Footbrake (Serviceable):

Pre-accident Condition:

Yes

Handbrake (Serviceable): CONDITION OF TYRES

Front Tyre Size:

11 R22.5

Rear Tyre Size:

11 R22.5 (D)

Front Left Side:

Hankook 5 mm

Rear Left Side:

Hankook 5/5 mm

Front Right Side:

Hankook 5 mm

Rear Right Side:

Hankook 5/5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,799.55	1,080.00	1,719.55	61.42
Miscellaneous Items	0.00	0.00	0.00	
Labour	680.00	400.00	280.00	41.18
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,479.55	1,480.00	1,999.55	57.47
Approved Total (Overridden) (S\$)		1,200.00		
Nett Amount (S\$)	3,479.55	1,200.00	2,279.55	65.51

INSPECTION

Date of Assignment:

14/02/2020

Date Inspected:

19/02/2020 Inspected At:

Ryder Auto Pte Ltd (HQ)

2 Kaki Bukit Ave 2, #02-19 AutoHub @

Kaki Bukit

Singapore 417921

Estimated Period of Repair:

2.0 days

Adjuster Report Page 2 of 4

Adjuster: OI SUN PIN Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

https://singapore.merimen.com/claims/index.cfm?fusebox=MTRadjuster&fuseaction=gen_... 31/3/2020

REPAIR DETAILS

Referen Part Source		(Last Synchronised: 31 Mar 2020)
Parts:	N/A	UD TRUCKS CONDOR PK 7.0 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted	no print-code for YN7828M)
Validity:	These estimate numbers with	es are valid only if they contain the print code (above) on all estimate pages, running page the END OF ESTIMATES marker on the last estimate page
Further Info	: Items/values	not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT N/S SIDE MIRROR BRACKET	Bent	1,228.00 FL	*700.00 FL
2	1		*FRONT N/S SIDE MIRROR RECTANGULAR	Cracked	780.60 FL	*300.00 FL
3	1		*FRONT N/S SIDE MIRROR SQUARE	Serviceable	468.30 FL	*- FL
4	1		*FRONT N/S SIDE MIRROR BRACKET UPPER	Scratched	470.00 FL	*200.00 FL
F=Fra	inchise	part. L=ListIt	emDisc List Item Discount on L Items	Sub Total (S\$) s 5.00/10.00% (S\$)	2,946.90 147.35	1,200.00 120.00
				Total Parts (S\$)	2,799.55	1,080.00
0			Report was unsubmitted during this	print-out.		

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	TO REMOVE FRONT N/S MIRROR ASSEMBLY	New	280.00	200.00
2	SPRAY PAINTING	New	400.00	200.00
		Gross Labour Cost (S\$)	680.00	400.00
	Report was uns	ubmitted during this print-out.		

< END OF ESTIMATES >