

## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLN 6657A

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR DOOR N/S (CONSISTENT)	TO REPAIR SEE LABOUR	1,125.30	-
1	REAR FENDER N/S (CONSISTENT)	TO REPAIR SEE LABOUR	1,099.50	-
1	REAR BUMPER (CONSISTENT)	CUT / TORN	1,180.00	936.50
1	REAR BUMPER SIDE RETAINER N/S (CONSISTENT)	NECESSARY	65.00	65.00
1	SET REAR BUMPER CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
1	ROCKER PANEL GARNISH N/S (CONSISTENT)	DISTORTED / TORN	885.00	588.20
1	SET ROCKER PANEL GARNISH CLIPS N/S (CONSISTENT)	NECESSARY	50.00	50.00
1	REAR SHOCK ABSORBER N/S (CONSISTENT)	BENT	399.00	311.20
1	REAR WHEEL HUB BEARING N/S (CONSISTENT)	DAMAGED	650.00	450.50
1	REAR AXLE BEAM (CONSISTENT)	SERVICEABLE	2,199.00	-
	LESS 50% DISCOUNT		-	-1,225.70
			7,702.80	1,225.70
	SPECIAL NETT ITEMS			
1	REAR SPORT RIM N/S (CONSISTENT)(SN)	DENTED / BENT	680.00	400.00
1	REAR TYRE N/S (60%) (CONSISTENT)(SN)	GRAZED	200.00	120.00
			880.00	520.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		50.00	20.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	80.00
	TO CONDUCT WHEEL ALIGNMENT.		120.00	80.00
	TO DISMANTLE & REPLACING REAR UNDERCARRIAGE.		380.00	150.00
	TO SPRAY RUST PROOFING.	NOT NECESSARY	80.00	-
	TO DISMANTLE & REFIX PETROL TANK.	NOT NECESSARY	100.00	-
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR DOOR N/S AND REAR FENDER N/S.		800.00	400.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	800.00
			3,150.00	1,530.00
	GRAND TOTAL		11,732.80	3,275.70

Report Ref No. CC4/ASM20002703/Upa3q2



Page No.:2 of 2

RECOMMENDED COST OF LUMP SUM REPAIRS	3,250.00
(TO ITS PRE-ACCIDENT CONDITION)	

Report Ref No. CC4/ASM20002703/Upa3q2

CHUA KANG SENG

Licensed Appraiser