

23/06/2019

ASS. REC. BY:

REF:

ES3/MS919021289/HSD302-1 Special Instruction:

Surveyor:

Hock Ann

ASSIGNMENT (Office)

From (Person):

Katherine Wong
Crystal Lee

of

MS16

Date/Time:

14/2/2020

3/12/19 @ 12:04pm

Estimated Cost:

Bill to:

OD ☒ TP WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SKR 5663D

Insured:

YP 3060B

at Workshop m/s

AKA Auto

Tel:

81880754/98000933 (Ryan)

of

25 kaki Bukit Road 4 # 05-36 Synergy

Policy No:

Claim No:

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

30/11/2019

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

12:10pm @ 3/12/19

Person Contacted:

Ryan

Vehicle IN/OUT

Date/Time	Action/Instruction
	SKR 5663D - X
	YP 3060B - 11A/LTE19021183/114
	Dismantle: 4/12/2019
	After repair: 9/12/2019

Submit LS \$ 3,550/- @ 4 days
(\$ 1,250/- Red - 26%)

26/2/2020


RECEIVED 29 FEB 2020

ASS. REC. BY: H. ANN REF: MS16
PRS

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD/TP/WS/TP RES/OD RES/EVA/INV/MV
To Inspect Vehicle No: SKR 5663 D
at Workshop m/s AKA Auto
of 25 Kaki Bulut Road 4 #05-08
Insured: _____
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)
Remark: The veh had commenced its
repair at the time of inspection.

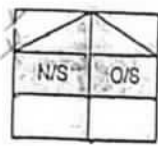

Bal. or Market Value: _____
IDAC Accident Rpt: _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: 4 days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SKR 5663 D Yr Regn: 7/10/2019
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: Audi A4 c.c. 1798
Colour: white A/C: Insured / Std / NI / NA
Sp. Reading: 144632 km T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: WAAZZZ8K 6AA037277
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or
Brake: In order / Jammed / Leaked / Burnt or
Mod: Nil / S/R/m / STD A/R/m or
Tyre Size: F: 235/45/2018
R: 255/45/2018
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or
Front: continued Rear: mic
R/Bal: 5 mm R/Bal: 5 mm
L/Bal: 5 mm L/Bal: 5 mm
D.O.A. 30/11/19 D.O.I. 3/12/19
Survey held at AKA Auto
Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>2.5 - 3.5 hr</u>
	<u>Range - 3.5 hr</u>
	<u>Repair Days - 4 days</u>
	<u>SKR 5663 D</u>
	<u>PRS car</u>
	<u>NV - 43000</u>
	<u>PV - 17961</u>
	<u>NV - 25200</u>

RECEIVED 03 JAN 2020

Date/Time, File Pass to? ☐ : Prel. Report
1) ☐ : Final Report
Date/Time, File Return to?

Days Of Repair: 3
Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Insp (\$)
☐ : Wash and (\$)

Survey Fee:	<u>220</u>
Transportation:	
S + RS, SI	
Provice	
Others	
TOTAL	<u>220</u>

Rep. Form: PRS
Lump Sum / U.C.I. / :

Our reference 19-12-8704

Date 9/12/2019

Page 2

Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As Inspected	Repairer's Estimate	Our Adjustment
--------------------	-----	------------------------	---------------------	----------------

List Items:

Front bumper ✓ CRA	1	deformed	1324.00	1324.00 / 250.40 ✓
Front bumper side retainer lh ✓ CR	1	damaged	65.80	65.80 ✓
Front bumper fog lamp cover lh X (SVC)	1	deformed	95.50	95.50
Front fender lh ✓ BT	1	bent	698.70	698.70 559.80 ✓
Front fender inner shield lh ✓ CR	1	deformed	145.00	145.00 ✓
Front lower arm lh X (SVC)	1	rebuild	430.00	0.00
Front shock absorber lh X (SVC)	1	rebuild	344.50	0.00
Front side mirror assy lh ✓ CRA	1	sheared off/broken	965.40	965.40 ✓
Front fender inner bracket lh ✓ BT	1	damaged	102.30	102.30 68.20 ✓
Front door lh X (R)	1	repair.respray	1024.50	0.00

Sub- Total costs

Percentage discount : 10%

Sub-Total costs for parts

5195.70	3396.70
0.00	0.00
5195.70	3396.70

Special Nett Items:

Front bumper clips ✓ CR	set	bent	50.00	50.00 25 ✓
Front tyre rim lh ✓ SVC	1	grazed	512.00	512.00 450 ✓
Sub-Total costs for parts			562.00	562.00

Parts Repair

*	*	*	0.00	0.00
Sub- Total costs			0.00	0.00
Total costs for parts			5757.70	3958.70

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsulting.sg.com

Our reference 19-12-8704

Date 9/12/2019

Page 3

Section B: Labour Cost Calculation

	Hourly rate	Manhr. Req.	Total
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$ 45.00	15	\$ 675.00 500 ✓
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.	Sub-contract work.		\$ 700.00 600 ✓
Apply rust proofing on the adjacent panels.	Sub-contract work.		\$ 50.00 30 ✓
Wiring and bulb checking	\$ 45.00	0.5	\$ 22.50 ✓
Specialist charges - Wheel alignment	-	-	\$ 60.00 ✓
Remove and refix front undercarriage works lh X	\$ 45.00	3	\$ 135.00
Total labour cost			\$ 1,642.50

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

L/S report
without proper
paper survey
H. ANN
25/12/19 6.35pm

parts 3054.60
parts less 10%
2749.14
spec net 475
labour 1212.50
4436.64
L/s less 20%
3549.31
Total
L/s less → \$3550.00

7400 20

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
 - IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
- www.iaconsulting.sg

Our reference 19-12-8704

Date 9/12/2019

Section C: Summary Table of Total Repair Cost

Description		Cost	
Damaged Parts Assessment (See section A)		\$3,958.70	
Further discount	20%	\$791.74	
Recommended cost of parts replacement		\$3,166.96	(1)
Labour Cost Calculation (See section B)		\$1,642.50	(2)
Total Repair Cost (Round off to hundred)		\$4,800.00	(1) + (2)

We would recommend a sum of \$4,800.00 and 7 working days for repair.
No further items will be approved without our expressed written agreement. Any significant additional items will be subject to a supplementary report.

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)
B.Eng. (Hons, NUS)
Diploma.Mechanical Engineering
NTC-2 Automovite Technology
Sr.MIES, Institution of Engineers, Singapore (#20100091)
MATAI, Maryland Association of Traffic Accident Investigators
IAARS, International Association of Accident Reconstruction Specialists
PMC of Singapore Business Advisors & Consultants Council
ACTA certified Trainer, Singapore
SPRING- Recognised Certification for Management Consultants

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsultingse.com

Our reference 19-12-8704
Date 9/12/2019
Page 2

Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As Inspected	Repairer's Estimate	Our Adjustment
List Items:				
Front bumper	1	deformed	1324.00	1324.00
Front bumper side retainer lh	1	damaged	65.80	65.80
Front bumper fog lamp cover lh	1	deformed	95.50	95.50
Front fender lh	1	bent	698.70	698.70
Front fender inner shield lh	1	deformed	145.00	145.00
Front lower arm lh	1	rebuild	430.00	0.00
Front shock absorber lh	1	rebuild	344.50	0.00
Front side mirror assy lh	1	sheared off/broken	965.40	965.40
Front fender inner bracket lh	1	damaged	102.30	102.30
Front door lh	1	repair.respray	1024.50	0.00
Sub- Total costs			5195.70	3396.70
Percentage discount :			0%	0.00
Sub-Total costs for parts			5195.70	3396.70
Special Nett Items:				
Front bumper clips	set	bent	50.00	50.00
Front tyre rim lh	1	grazed	512.00	512.00
Sub-Total costs for parts			562.00	562.00
Parts Repair				
*	*	*	0.00	0.00
Sub- Total costs			0.00	0.00
Total costs for parts			5757.70	3958.70

Our reference 19-12-8704

Date 9/12/2019

Page 3

Section B: Labour Cost Calculation

	Hourly rate	Manhr. Req.	Total
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$ 45.00	15	\$ 675.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.	Sub-contract work.		\$ 700.00
Apply rust proofing on the adjacent panels.	Sub-contract work.		\$ 50.00
Wiring and bulb checking	\$ 45.00	0.5	\$ 22.50
Specialist charges - Wheel alignment	-	-	\$ 60.00
Remove and refix front undercarriage works lh	\$ 45.00	3	\$ 135.00
Total labour cost			\$ 1,642.50

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

Our reference 19-12-8704

Date 9/12/2019

Section C: Summary Table of Total Repair Cost

Description		Cost	
Damaged Parts Assessment (See section A)		\$3,958.70	
Further discount	20%	\$791.74	
Recommended cost of parts replacement		\$3,166.96	(1)
Labour Cost Calculation (See section B)		\$1,642.50	(2)
Total Repair Cost (Round off to hundred)		\$4,800.00	(1) + (2)

We would recommend a sum of \$4,800.00 and 7 working days for repair.
No further items will be approved without our expressed written agreement. Any significant additional items will be subject to a supplementary report.

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)
B.Eng. (Hons, NUS)
Diploma.Mechanical Engineering
NTC-2 Automovite Technology
Sr.MIES, Institution of Engineers, Singapore (#20100091)
MATAI, Maryland Association of Traffic Accident Investigators
IAARS, International Association of Accident Reconstruction Specialists
PMC of Singapore Business Advisors & Consultants Council
ACTA certified Trainer, Singapore
SPRING- Recognised Certification for Management Consultants

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsulting.sg

Celine Fong (LKKAuto)

From: Accounts (LKKAuto)
Sent: Monday, 17 February 2020 2:05 PM
To: Admin-D (LKKAuto)
Cc: Accounts (LKKAuto)
Subject: RE: Report Send Back Alerts - SKR5663D (TP)

Dear Nivitha/Summer,

FYNA Please....

Pending for Survey Report-CS3/MSG19021289/HSD3E2

14 Feb 2020 18:32	Ins Send Back Adj Rpt	For paper survey	[I] Katherine Wong
14 Feb 2020 18:32	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2020/02/18	[I] Merimen Administrator
14 Feb 2020 18:32	Adj Mandate Set	Maintained.	[I] Merimen Administrator

Thank You

Best Regards,

SuthaShelia (Shelia) | Accounts Dept.
LKK Auto Consultants Pte Ltd
Phone: **6841 1891** | email: account@lkkauto.com | fax: 6844-8805
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Do-Not-Reply <do-not-reply@merimen.com>
Sent: Friday, 14 February 2020 6:40 PM
To: account@lkkauto.com
Subject: Report Send Back Alerts - SKR5663D (TP)

Dear Sir / Madam,

Please login to Merimen Online at www.merimen.com.sg for more information.

Thanks,
The Merimen Team



This email has been checked for viruses by AVG antivirus software.
www.avg.com

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	06 Dec 2019 15:24		06 Dec 2019 16:50 Edit Adj Rpt	S\$3,550.00 Edit Estimates	S\$3,550.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	BEN FOODS (S) PTE LTD , Co. Reg. No.: 196900017H, Tel: +6584202458								
Main Claimant:	MR SAIRUL HAFIZ BIN MOHD ALI , ID: S8405465H								
Vehicle Reg. No.:	SKR5663D	Date of Loss:	30/11/2019 20:00 - :59 [121 Months and 23 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 613740	Policy/Cover Note No.:	B29067573MKF (Comprehensive) Coverage: 01/01/2019 - 31/12/2019						
Vehicle Reg. No. (Insured):	YP3060B	Policy No. (Claimant):	DMPCSN3047611900						
		Excess:							
Repairer:	Aka Auto (HQ) 25 Kaki Bukit Road 4, #05-58, Synergy@KB, 417800 Kaki Bukit - Tel: 81880754								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Katherine Wong - 6594 2544]								
Claimant's Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by LEE HOCK ANN] ... [Final Rpt due 18/02/2020]								
Driver/Custodian (Insured):	MUHAMMAD NUR SYAZWAN BIN ISMAIL (21 / Male), NRIC: S9807800B, Tel: +6584202458 Email:								
Adj Asg. Remarks:	on WP. Manual assigned to LKK via email on 03/12/19. (Manual Assign). Liab: NR. Disagree on SJE. Contact: Rachel @ 8188 0754.								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
• MSIG_SG (14/02/2020): Report Send Back Alerts - SKR5663D (TP)									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SKR5663D (613740)
[YP3060B]
TP
MR SAIRUL HAFIZ BIN MOHD ALI
Nov 30 2019 8:00PM
[BEN FOODS (S) PTE LTD]
Aka Auto

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)



















































View [View in Browser](#)































Assessment Reports

No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	1 per page	Thumbnail	Print
1	06/12/19 15:28	Addendum Sheet From: SC - Reg. No: YP3060B, Claimant: BEN FOODS (S) PTE LTD		Load TIF	<input type="checkbox"/>
2	06/12/19 15:28	Addendum Sheet From: SC - Reg. No: YP3060B, Claimant: BEN FOODS (S) PTE LTD		Load TIF	<input type="checkbox"/>

Photos/Images

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	3 per page	Thumbnail	Print
1	10/12/19 09:59	Chassis Number		Load JPG	<input checked="" type="checkbox"/>
2	10/12/19 09:59	Odometer Reading		Load JPG	<input checked="" type="checkbox"/>
3	10/12/19 09:59	General View		Load JPG	<input checked="" type="checkbox"/>
4	10/12/19 09:59	General View		Load JPG	<input checked="" type="checkbox"/>
5	10/12/19 09:59	General View		Load JPG	<input checked="" type="checkbox"/>
6	10/12/19 09:59	General View		Load JPG	<input checked="" type="checkbox"/>
7	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
8	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
9	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
10	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
11	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
12	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
13	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
14	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
15	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
16	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
17	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
18	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
19	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
20	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
21	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
22	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
23	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
24	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
25	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
26	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
27	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
28	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
29	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
30	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
31	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>
32	10/12/19 10:00	General View		Load JPG	<input checked="" type="checkbox"/>





Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
33	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
34	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
35	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
36	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
37	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
38	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
39	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
40	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
41	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
42	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
43	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
44	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
45	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
46	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
47	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
48	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
49	10/12/19 10:00	General View	 Load JPG	<input checked="" type="checkbox"/>
50	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
51	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
52	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
53	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
54	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
55	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
56	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
57	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
58	10/12/19 10:01	General View	 Load JPG	<input checked="" type="checkbox"/>
59	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
60	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
61	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
62	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
63	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
64	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
65	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
66	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
67	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
68	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
69	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
70	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
71	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
72	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
73	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
74	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
75	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
76	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
77	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
78	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
79	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
80	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
81	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
82	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>






Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
83	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
84	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
85	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
88	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	10/12/19 10:01	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
96	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
97	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
98	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
99	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
100	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
101	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
102	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
103	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
104	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
105	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
106	10/12/19 10:02	After Repair Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	06/12/19 15:29	Notification of Accident from TP WS	 Load PDF	
2	06/12/19 15:41	Disagree on SJE	 Load PDF	
3	14/02/20 18:37	Survey Report	 Load PDF	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (Internal Surveyor)	Thumbnail	Print
1	06/12/19 16:48	Survey Request - Manual Assigned	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	26/02/20 16:26	PRS Invoice	 Load PDF	
2	26/02/20 16:26	Colour Photo	 Load PDF	










Linked Accident Report Documents

View

View in Browser

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	National Assessment Centre Services (Ubi)	Thumbnail	Print
1	06/12/19 19:43	Accident Statement	 Load HTM	
2	06/12/19 19:43	Accident Statement	 Load HTM	
3	06/12/19 19:47	Accident Statement	 Load HTM	
4	06/12/19 19:48	Accident Statement	 Load HTM	

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	National Assessment Centre Services (Ubi)	Thumbnail	Print
1	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
2	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
3	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
4	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
5	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	National Assessment Centre Services (Ubi)	Thumbnail	Print
6	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
7	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
8	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
9	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
10	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
11	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
12	02/12/19 10:35	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	National Assessment Centre Services (Ubi)	Thumbnail	Print
1	02/12/19 10:32	Accident Sketch Plan	 Load JPG	<input checked="" type="checkbox"/>
2	02/12/19 10:32	Accident Sketch Plan	 Load JPG	<input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG19021289/HSD3E2-1

Date: 26/02/2020

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: B29067573MKF

Claimant Vehicle No : SKR5663D

Insured Vehicle No : YP3060B

Date of Loss: 30/11/2019

Nature of Claim: TP

Claim No: 613740

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKR5663D

Make & Model: AUDI A4, 1.8 T FSI MU S-Line CVT ABS (A)

Engine No: CDH064426

Reg. Date: 07/10/2009 (Man. Year: 2009)

Chassis No: WAUZZZ8K6AA037277

Colour: White

Odometer: 144632 km

Engine Capacity: 1798 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/45Z R18

Rear Tyre Size: 255/45Z R18

Front Left Side: Continental 5 mm

Rear Left Side: Michelin 5 mm

Front Right Side: Continental 5 mm

Rear Right Side: Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,757.70	3,224.14	2,533.56	44.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,642.50	1,212.50	430.00	26.18
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	7,400.20	4,436.64	2,963.56	40.05
Approved Total (Overridden) (S\$)		3,550.00		
Nett Amount (S\$)	7,400.20	3,550.00	3,850.20	52.03

INSPECTION

Date of Assignment: 06/12/2019

Date Inspected: 03/12/2019 Inspected At:

25 KAKI BUKIT RD 4# 05-36 SYNERGY

Repairer : Aka Auto (HQ)

Estimated Period of Repair: 4.0 days

Adjuster: LEE HOCK ANN

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 26 Feb 2020)
Parts:	143	AUDI A4 1.8 T FSI MU S-Line CVT ABS (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKR5663D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cracked	1,324.00 F	*1,250.40 FL
2	1		*FRONT BUMPER SIDE RETAINER LH	Necessary	65.80 F	*65.80 FL
3	1		*FRONT BUMPER FOG LAMP COVER LH	Serviceable	95.50 F	*- FL
4	1		*FRONT FENDER LH	Bent	698.70 F	*559.80 FL
5	1		*FRONT FENDER INNER SHIELD LH	Crumpled	145.00 F	*145.00 FL
6	1		*FRONT LOWER ARM LH	Serviceable	430.00 F	*- FL
7	1		*FRONT SHOCK ABSORBER LH	Serviceable	344.50 F	*- FL
8	1		*FRONT SIDE MIRROR ASSY LH	Cracked	965.40 F	*965.40 FL
9	1		*FRONT FENDER INNER BRACKET LH	Bent	102.30 F	*68.20 FL
10	1		*FRONT DOOR LH	Repair	1,024.50 F	*- FL
11	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 FS	*25.00 FS
12	1		*FRONT TYRE RIM LH	Scratched	512.00 FS	*450.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	5,757.70	3,529.60
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	305.46
Total Parts (\$\$)	5,757.70	3,224.14

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE, REPLACE, CUT, WELD, KNOCK OUT DENTS TO STRAIGHTEN ACCIDENT PARTS AS-MENTIONED ON THE PARTS REPAIR COLUMN INCLUSIVE OF REPLACEMENT PARTS	New	675.00	500.00
2	APPLY RUST PROOFING ON THE ADJACENT PANELS	New	50.00	30.00
3	WIRING AND BULB CHECKING	New	22.50	22.50
4	SPECIALIST CHARGES - WHEEL ALIGNMENT	New	60.00	60.00
5	REMOVE AND REFIX FRONT UNDERCARRIAGE WORKS LH	New	135.00	0.00
6	PUTTY & SPRAY PAINTING TO ADJACENT PANELS. JOB ALLOWANCE. PAINT / MATERIAL	New	700.00	600.00
Gross Labour Cost (\$\$)			1,642.50	1,212.50

Report was unsubmitted during this print-out.

< END OF ESTIMATES >