

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	21 Feb 2020		25 Feb 2020 15:10	S\$3,860.00 Edit Estimates	S\$3,860.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS			[Created by insurer]						
Insured:	-, Co. Reg. No.: -								
Main Claimant:	Manjula D/O Ramasamy								
Vehicle Reg. No.:	SMK9542G	Date of Loss:	20/02/2020 00:00 - :59 [9 Months and 22 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / SNM20D200937/C02	Policy/Cover Note No.:	DMCVSN30670819000						
Vehicle Reg. No. (Insured):	GBB5186E	Policy No. (Claimant):							
		Excess:	S\$0.00						
Repairer:	Volkswagen Centre Singapore (MacPherson) 1 KAMPONG AMPAT, 368314 Macpherson - Tel:								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Cecilia Low - 63896530]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by XING GUO QIANG] ... [Final Rpt due 05/03/2020]								
ASSOCIATED MAIL RECEIVED			View All Compose Case Mail						
There are no mail for this case.									
ALL ASSOCIATED TASKS <input type="checkbox"/>			View All Search Tasks Create New Task Complete						
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SMK9542G (SNM20D200937/C02)**
[GBB5186E]
TP
Manjula D/O Ramasamy
Feb 20 2020 12:00AM
[-]
Volkswagen Centre Singapore

Upload Documents
Upload Photos
Compose New Letter

View View in Browser ▼

Photos/Images				3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
2	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
3	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
4	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
5	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
6	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
7	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
8	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
9	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
10	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
11	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
12	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
13	31/03/20 11:22	General View		Load JPG	<input checked="" type="checkbox"/>
14	31/03/20 11:22	Odometer Reading		Load JPG	<input checked="" type="checkbox"/>
15	31/03/20 11:22	Chassis Number		Load JPG	<input checked="" type="checkbox"/>
16	11/06/20 11:21	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
17	11/06/20 11:21	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>
18	11/06/20 11:21	Reinspection Photo		Load JPG	<input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST

Reset
Save
Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI20003125/GQF3S2**Date:** 16/06/2020**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSN30670819000

Claimant Vehicle No : SMK9542G **Insured Vehicle No :** GBB5186E

Date of Loss: 20/02/2020 Nature of Claim: TP Claim No: SNM20D200937/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMK9542G**

Make & Model: SKODA SUPERB, 2.0 (A) Engine No: HIDDEN

Reg. Date: 29/04/2019 (Man. Year: 2019) Chassis No: TMBBD8NP5J7610065

Colour: Blue Odometer: 23324 km

Engine Capacity: 1984 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/55 R17 Rear Tyre Size: 215/55 R17

Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm

Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,113.36	1,740.00	1,373.36	44.11
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,680.00	2,120.00	3,560.00	62.68
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	8,793.36	3,860.00	4,933.36	56.10
+ GST 7.00/7.00% (S\$)	615.54	270.20	345.34	56.10
Nett Amount (S\$)	9,408.90	4,130.20	5,278.70	56.10

INSPECTION

Date of Assignment: 25/02/2020

Date Inspected: 27/02/2020 Inspected At: Volkswagen Centre Singapore (MacPherson)
1 KAMPONG AMPAT
Singapore 368314

Estimated Period of Repair: 3.0 days

Adjuster: XING GUO QIANG**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

6/16/2020

Adjuster Report

(REPAIR COST NOT CONCLUDE)

THE VEHICLE HAS NOT SEND IN FOR REPAIR DUE TO WORKSHOP STILL AWAITING LIABILITY FROM INSURANCE.

REPAIR DETAILS**Reference**

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 16 Jun 2020)
Parts: 144	SKODA SUPERB 2.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMK9542G)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER FOR REAR BUMPER	Deformed	1,740.00 FS	*1,740.00 FS
2	1		*REINFORCEM	Not Necessary	609.00 FS	*- FS
3	1		*RETAINING BUMPER CENTRE BRACKET	Not Necessary	72.30 FS	*- FS
4	1		*GUIDE PIEC TAILLIGHT LOWER BRACKET LH	Not Necessary	43.30 FS	*- FS
5	1		*GUIDE PIEC TAILLIGHT LOWER BRACKET RH	Not Necessary	43.30 FS	*- FS
6	1		*SPOILER	Not Necessary	281.00 FS	*- FS
7	1		*SENSOR BRA	Not Necessary	45.00 FS	*- FS
8	1		*SENSOR BRA	Not Necessary	45.00 FS	*- FS
9	1		*SENSOR BAR	Not Necessary	45.00 FS	*- FS
10	1		*SENSOR BAR	Not Necessary	45.00 FS	*- FS
11	1		*2K PLASTIC ADHESIVE	Not Necessary	75.94 FS	*- FS
12	1		*BONDING AGENT FOR PLASTIC	Not Necessary	59.40 FS	*- FS
13	8		*POP-RIVET	Not Necessary	9.12 FS	*- FS

F=Franchise part. S=SpcNett.

Total Parts (S\$)	3,113.36	1,740.00
--------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CHECK SHORT CIRCUIT / HARNESS REPAIR.	New	280.00	0.00
2	DIAGNOSTIC AND PROGRAMMING.	New	480.00	480.00
3	LABOUR.	New	2,520.00	840.00
4	SPRAY PAINTING.	New	2,400.00	800.00
			Gross Labour Cost (\$\$)	2,120.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >