

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	27 Feb 2020		28 Feb 2020 10:29 Edit Adj Rpt	S\$3,118.38 Edit Estimates	S\$3,118.38 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS			[Created by insurer]						
Insured:	-, Co. Reg. No.: -								
Main Claimant:	GUO JINSHUN, ID: S8411214C								
Vehicle Reg. No.:	SJC5581Y	Date of Loss:	23/02/2020 18:00 - :59 [26 Months and 26 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / SNM20D201009C02	Policy/Cover Note No.:	DMPCSNA00001412003						
Vehicle Reg. No. (Insured):	SJB3729H	Policy No. (Claimant):	GA405473						
		Excess:	S\$500.00						
Repairer:	Ah Lim Motor Company (AMK) 10 Ang Mo Kio Industrial Park 2A, #01-09 AMK Autopoint, 568047 Ang Mo Kio - Tel: 6483 1244								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Tan Kah Leong - 63896193]								
Claimant's Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6880 4888								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by OI SUN PIN] ... [Final Rpt due 10/03/2020]								
ASSOCIATED MAIL RECEIVED			View All Compose Case Mail						
There are no mail for this case.									
ALL ASSOCIATED TASKS			View All Search Tasks Create New Task Complete						
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SJC5581Y (SNM20D201009C02)
[SJB3729H]
TP
GUO JINSHUN
Feb 23 2020 6:00PM
[-]
Ah Lim Motor Company

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View [View in Browser](#) ▼

Assessment Reports			1 per page ▼	✓
No	Finalized On	Ah Lim Motor Company (AMK)	Thumbnail	Print
1	24/02/20 17:39	Accident Statement	Load HTM	
Photos/Images			3 per page ▼	✓
No	Finalized On	Ah Lim Motor Company (AMK)	Thumbnail	Print
1	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
2	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
3	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
4	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
5	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
6	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
7	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
8	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
9	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
10	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
11	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
12	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
13	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
14	24/02/20 17:29	Accident Photo [Linked Accident Report Documents]	Load JPG	✓
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	30/04/20 10:19	Chassis Number	Load JPG	✓
2	30/04/20 10:19	Odometer Reading	Load JPG	✓
3	30/04/20 10:19	General View	Load JPG	✓
4	30/04/20 10:19	General View	Load JPG	✓
5	30/04/20 10:19	General View	Load JPG	✓
6	30/04/20 10:19	General View	Load JPG	✓
7	30/04/20 10:19	General View	Load JPG	✓
8	30/04/20 10:19	General View	Load JPG	✓
9	30/04/20 10:19	General View	Load JPG	✓
10	30/04/20 10:19	General View	Load JPG	✓
11	30/04/20 10:19	General View	Load JPG	✓
12	30/04/20 10:19	General View	Load JPG	✓
13	30/04/20 10:19	General View	Load JPG	✓
14	30/04/20 10:19	General View	Load JPG	✓
15	30/04/20 10:19	General View	Load JPG	✓
16	30/04/20 10:19	General View	Load JPG	✓
17	30/04/20 10:19	General View	Load JPG	✓
18	30/04/20 10:19	General View	Load JPG	✓

Assessment Reports				1 per page ▼	☒
No	Finalized On	Ah Lim Motor Company (AMK)		Thumbnail	Print
19	30/04/20 10:19	General View		Load JPG	☒
20	30/04/20 10:19	General View		Load JPG	☒
21	30/04/20 10:19	General View		Load JPG	☒
22	30/04/20 10:19	General View		Load JPG	☒
23	30/04/20 10:19	General View		Load JPG	☒
24	30/04/20 10:19	General View		Load JPG	☒
25	30/04/20 10:19	General View		Load JPG	☒
26	30/04/20 10:19	General View		Load JPG	☒
27	30/04/20 10:19	General View		Load JPG	☒
28	30/04/20 10:19	General View		Load JPG	☒
29	30/04/20 10:19	General View		Load JPG	☒
30	30/04/20 10:19	General View		Load JPG	☒
31	30/04/20 10:19	General View		Load JPG	☒
32	30/04/20 10:19	General View		Load JPG	☒
33	30/04/20 10:19	General View		Load JPG	☒
34	30/04/20 10:19	General View		Load JPG	☒
35	30/04/20 10:19	General View		Load JPG	☒
36	30/04/20 10:19	General View		Load JPG	☒
37	30/04/20 10:19	General View		Load JPG	☒
38	30/04/20 10:19	General View		Load JPG	☒
39	30/04/20 10:20	General View		Load JPG	☒
40	30/04/20 10:20	General View		Load JPG	☒
41	30/04/20 10:20	General View		Load JPG	☒
42	30/04/20 10:20	General View		Load JPG	☒
43	30/04/20 10:20	General View		Load JPG	☒
44	30/04/20 10:20	General View		Load JPG	☒
45	30/04/20 10:20	General View		Load JPG	☒
46	30/04/20 10:20	General View		Load JPG	☒
47	30/04/20 10:20	Dismantled Parts		Load JPG	☒
48	30/04/20 10:20	Dismantled Parts		Load JPG	☒
49	30/04/20 10:20	Dismantled Parts		Load JPG	☒
50	30/04/20 10:20	Dismantled Parts		Load JPG	☒
51	30/04/20 10:20	Dismantled Parts		Load JPG	☒
52	30/04/20 10:20	Dismantled Parts		Load JPG	☒
53	30/04/20 10:20	Dismantled Parts		Load JPG	☒
54	30/04/20 10:20	Dismantled Parts		Load JPG	☒
55	30/04/20 10:20	After Repair Photo		Load JPG	☒
56	30/04/20 10:20	After Repair Photo		Load JPG	☒
57	30/04/20 10:20	After Repair Photo		Load JPG	☒
58	30/04/20 10:20	After Repair Photo		Load JPG	☒
59	30/04/20 10:20	After Repair Photo		Load JPG	☒
60	30/04/20 10:20	After Repair Photo		Load JPG	☒
Documentation				1 per page ▼	☒
No	Finalized On	Ah Lim Motor Company (AMK)		Thumbnail	Print
1	24/02/20 17:39	Sketch Plan [Linked Accident Report Documents]		Load TIF	
2	24/02/20 17:39	CERT [Linked Accident Report Documents]		Load TIF	
3	24/02/20 17:39	Identification Card [Linked Accident Report Documents]		Load TIF	

Linked Accident Report Documents

View

Assessment Reports				1 per page ▼	✓
No	Finalized On	Ah Lim Motor Company (AMK)		Thumbnail	Print
1	24/02/20 17:39	Accident Statement	i	Load HTM	
Photos/Images				3 per page ▼	✓
No	Finalized On	Ah Lim Motor Company (AMK)		Thumbnail	Print
1	24/02/20 17:29	Accident Photo	i	Load JPG	✓
2	24/02/20 17:29	Accident Photo	i	Load JPG	✓
3	24/02/20 17:29	Accident Photo	i	Load JPG	✓
4	24/02/20 17:29	Accident Photo	i	Load JPG	✓
5	24/02/20 17:29	Accident Photo	i	Load JPG	✓
6	24/02/20 17:29	Accident Photo	i	Load JPG	✓
7	24/02/20 17:29	Accident Photo	i	Load JPG	✓
8	24/02/20 17:29	Accident Photo	i	Load JPG	✓
9	24/02/20 17:29	Accident Photo	i	Load JPG	✓
10	24/02/20 17:29	Accident Photo	i	Load JPG	✓
11	24/02/20 17:29	Accident Photo	i	Load JPG	✓
12	24/02/20 17:29	Accident Photo	i	Load JPG	✓
13	24/02/20 17:29	Accident Photo	i	Load JPG	✓
14	24/02/20 17:29	Accident Photo	i	Load JPG	✓
Documentation				1 per page ▼	✓
No	Finalized On	Ah Lim Motor Company (AMK)		Thumbnail	Print
1	24/02/20 17:39	Sketch Plan	i	Load TIF	
2	24/02/20 17:39	CERT	i	Load TIF	
3	24/02/20 17:39	Identification Card	i	Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI20003313/QTF3S2**Date:** 05/05/2020**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNA00001412003	
Claimant Vehicle No :	SJC5581Y	Insured Vehicle No :	SJB3729H	
Date of Loss:	23/02/2020	Nature of Claim:	TP	Claim No: SNM20D201009C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJC5581Y		Engine No:	1ZR1989898
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 ECO (A)		Chassis No:	MR053REH604571756
Reg. Date:	28/11/2017 (Man. Year: 2017)		Odometer:	76676 km
Colour:	Silver			
Engine Capacity:	1598 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Fair	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Michelin 5 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	Michelin 5 mm	Rear Right Side:	Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,410.66	2,278.38	132.28	5.49
Miscellaneous Items	0.00	0.00	0.00	
Labour	840.00	840.00	0.00	0.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	3,250.66	3,118.38	132.28	4.07
+ GST 7.00/7.00% (\$\$)	227.55	218.29	9.26	4.07
Nett Amount (\$\$)	3,478.21	3,336.67	141.54	4.07

INSPECTION

Date of Assignment:	28/02/2020	
Date Inspected:	05/03/2020 Inspected At:	Ah Lim Motor Company (AMK) 10 Ang Mo Kio Industrial Park 2A, #01-09 AMK Autopoint Singapore 568047
Estimated Period of Repair:	4.0 days	

Adjuster: OI SUN PIN**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 05 May 2020)

Parts: 143 TOYOTA COROLLA ALTIS 1.6 ECO (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SJC5581Y)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*HEADLAMP RH	Cracked	1,014.10 FL	*1,014.10 FL
2	1		*FRONT BUMPER	Crushed	576.40 FL	*576.40 FL
3	1		*FRONT BUMPER SIDE RETAINER RH	Missing	67.20 FL	*67.20 FL
4	12		*FRONT BUMPER CLIPS	Necessary	46.68 FL	*30.00 FL
5	1		*FRONT BUMPER GRILLE COVER RH	Scratched	133.87 FL	*133.87 FL
6	1		*FRONT BUMPER SPONGE	Crushed	139.70 FL	*139.70 FL
7	1		*FRONT FENDER RH	Dented	809.70 FL	*650.00 FL
8	1		*FRONT FENDER COWLING RH	Crushed	175.22 FL	*175.22 FL
9	8		*FRONT FENDER COWLING CLIPS	Necessary	25.68 FL	*25.68 FL
10	1		*FRONT FENDER LOGO RH	Necessary	49.27 FL	*49.27 FL
11	1		*WIPER WASHER TANK	Crushed	176.40 FL	*176.40 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	3,214.22	3,037.84
- List Item Discount on L Items 25.00/25.00% (\$\$)	803.56	759.46
Total Parts (\$\$)	2,410.66	2,278.38

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS AND ETC. TO REMOVE AND REINSTALL DAMAGED ELECTRICAL UNITS, TEST AND RECTIFY FOR PROPER FUNCTIONING.	New	40.00	40.00
2	TO DISMANTLE ALL DAMAGED PARTS. TO CUT & WELD RADIATOR SUPPORT PANEL, TO KNOCK & REPAIR FRONT FENDER LH, BONNET, FRONT INNER PANELS AND AFFECTED AREAS. TO REFIT LISTED PARTS BACK SAME.	New	400.00	400.00
3	TO SPRAY BONNET, FRONT BUMPER, FRONT FENDER LH & RH, RADIATOR SUPPORT PANEL.	New	400.00	400.00
Gross Labour Cost (\$\$)			840.00	840.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >