



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

NTUC INCOME INSURANCE CO-OPERATIVE LTD INV No. AC2003665
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSE
SINGAPORE 189556
ATTN: DAVID PHUA

INV Date 05/05/2020
Reference CS/INC20003519/Avf3n2
Code INC



PROFESSIONAL SERVICE FEE

Vehicle No. SLF 7188Y
Insured Veh. SJQ 3774Y
Claim No. MT/1086339-002
Policy No.
Accident Date 28/02/2020
Inspection Date 05/03/2020

Description	Total
Damage Assessment	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC20003519/Avf3n2

73 BRAS BASAH ROAD

Date: 05-05-2020

#05-01 NTUC TRADE UNION HOUSESINGAPORE

189556



ATTN: DAVID PHUA

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJQ 3774Y	Veh. Inspected	SLF 7188Y
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1086339-002	Excess (\$)	0.00
Assign From	ANNIE KOH	Assign Date	03/03/2020

2. Vehicle Particulars & Condition

Make & Model	NISSAN QASHQAI	c.c	1197
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	SJNFEAJ11U1717580	Colour	RED
Odometer	50279 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	255/50 R18	FALKEN	6 mm
L/H Front Tyre	255/50 R18	FALKEN	6 mm
R/H Rear Tyre	255/50 R18	FALKEN	6 mm
L/H Rear Tyre	255/50 R18	FALKEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	28/02/2020	Inspect Date / Time	05/03/2020 (03:44 PM)
Survey held at	8 KAKI BUKIT AVENUE 4 # 08-45		
Repairer	SK AUTOMOBILE PTE LTD		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLF 7188Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	TO REPAIR SEE LABOUR	1,463.20	-
1	BONNET SEAL	NOT NECESSARY	114.60	-
1	FRONT BUMPER	DEFORMED	689.00	689.00
2	FRONT BUMPER SIDE RETAINER @\$35.20	O/S DAMAGED	70.40	35.20
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	687.00	-
1	FRONT BUMPER REINFORCEMENT SPONGE	NOT NECESSARY	278.50	-
1	FRONT BUMPER FOG LAMP	NOT NECESSARY	459.20	-
1	FRONT BUMPER FOG LAMP CHROME RIM	NOT NECESSARY	158.00	-
1	FRONT BUMPER LOWER COVER	NOT NECESSARY	498.60	-
1	FRONT GRILLE	NOT NECESSARY	542.00	-
1	FRONT GRILLE MOULDING	NOT NECESSARY	275.40	-
1	FRONT GRILLE EMBLEM	NOT NECESSARY	94.60	-
1	FRONT FENDER LH	DISTORTED	689.00	689.00
2	FRONT FENDER INNER SHIELD @\$261.30	NOT NECESSARY	522.60	-
1	FRONT FENDER WHEEL ARCH PROTECTOR	DEFORMED	489.00	489.00
1	HEADLAMP	CUT	845.00	845.00
1	HEADLAMP LOWER BRACKET	NOT NECESSARY	74.90	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	1,298.00	-
1	FRONT SUPPORT PANEL TOP GARNISH	NOT NECESSARY	321.00	-
1	TURBO INTERCOOLER UNIT	NOT NECESSARY	889.00	-
1	FRONT KNUCKLE ARM LH	DAMAGED	1,365.20	534.00
1	FRONT WHEEL HUB BEARING	NECESSARY	854.90	242.00
1	FRONT LOWER CONTROL ARM	BENT	568.00	349.00
1	FRONT LOWER CONTROL ARM BALL JOINT	BENT	184.00	184.00
1	FRONT SHOCK ABSORBER	BENT	598.00	598.00
1	FRONT STABILIZER LINK	NOT NECESSARY	172.90	-
2	FRONT STABILIZER LINK BUSHING @\$25.00	NOT NECESSARY	50.00	-
1	STEERING RACK & PINION	DAMAGED	2,144.00	1,649.00
	LESS 10% DISCOUNT		-1,639.60	-630.32
			14,756.40	5,672.88

Report Ref No. CS/INC20003519/Avf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	65.00	30.00
1	SET FRONT BUMPER LOWER CLIP (SN)	NOT NECESSARY	70.00	-
1	SET FRONT GRILLE CLIP (SN)	NECESSARY	30.00	30.00
1	SET FRONT BUMPER CLIP (SN)	NOT NECESSARY	65.00	-
1	SET FRONT FENDER INNER SHIELD CLIP (SN)	NECESSARY	75.00	30.00
1	SET FRONT WHEEL ARCH PROTECTOR CLIP (SN)	NECESSARY	80.00	20.00
1	SPORT RIM (LOCAL REPAIR)(SN)	SCRATCHED	1,200.00	100.00
1	WHEEL CAP (SN)	NOT NECESSARY	90.00	-
3	RADIATOR COOLANT @\$35.00 (SN)	NOT NECESSARY	105.00	-
			1,780.00	210.00
	<u>LABOUR</u>			
	CUT OFF AND REPLACE FRONT SUPPORT PANEL RESTRUCTURE FRONT CRASH MANAGEMENT AND RENEW OTHER DAMAGE PARTS.INCLUSIVE OF THE REPAIR OF BONNET.		1,200.00	500.00
	SPRAY PAINTING TO AFFECTED AREA.		1,000.00	400.00
	TO APPLY TUFF COAT.		200.00	30.00
	DISMENTLE AND REPLACE FRONT LHS UNDER- CARRIAGE.		400.00	300.00
	APPLY TUFF COATING TREATMENT.	NOT NECESSARY	100.00	-
	WHEEL ALIGNMENT.		150.00	80.00
	ADJUST AND FOCUS FRONT LIGHTING SYSTEM.PERFORM HEADLAMP ADJUSTMENT TO POSITION.		80.00	30.00
	DISMENTLE AND REPLACE A/C CONDENSER ASSY.REFILL RECHARGE A/C REFRIGERANT GAS AND PERFORM PRESSURE TEST.	NOT NECESSARY	200.00	-
	MODULATOR WIRING HARNESS AND ABS CONTROL UNIT.PERFORM BRAKE BLEEDING AND RESET ABS SYSTEM WITH ON-BOARD-DIAGNOSTIC.	NOT NECESSARY	200.00	-
	REMOVE AND INSTALL RADIATOR ASSY.PERFORMED RADIATOR PRESSURE TEST.	NOT NECESSARY	150.00	-
			3,680.00	1,340.00
GRAND TOTAL			20,216.40	7,222.88

Report Ref No. CS/INC20003519/Avf3n2



RECOMMENDED COST OF REPAIRS (CONFIRMED)			7,222.88
---	--	--	----------

Report Ref No. CS/INC20003519/Avf3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 7188Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 7188Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

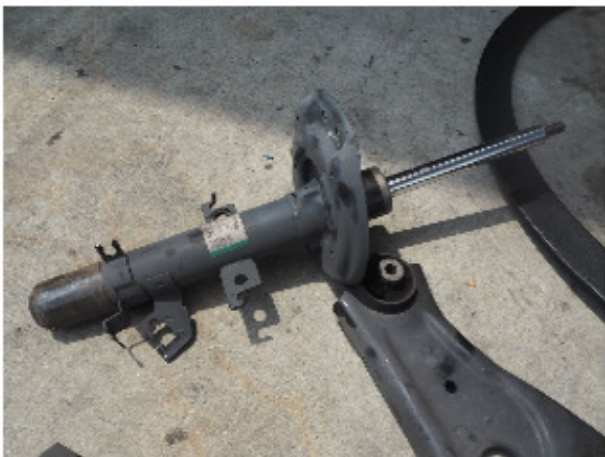




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

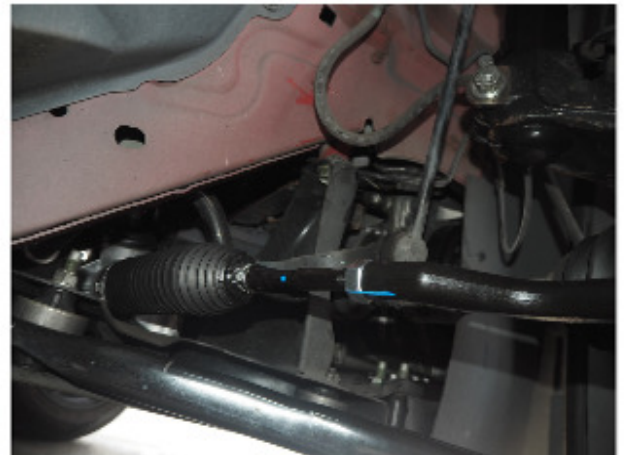



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

