

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG20003629/AKS3N2

Date: 20/07/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 0999994187

Claimant
Vehicle No : GBC2425E **Insured Vehicle No :** GBK1791L

Date of Loss: 02/03/2020 Nature of Claim: TP Claim No: 9499231808SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **GBC2425E**

Make & Model: NISSAN NV200, 1.5 L ABS AIRBAG 2WD 6DR EURO 5 (M) Engine No: K9KF276D123475

Reg. Date: 29/09/2011 (Man. Year: 2011) Chassis No: VSKYBAM20U0021557

Colour: White Odometer: 206130 km

Engine Capacity: 1461 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 185/70 R14 Rear Tyre Size: 185/70 R14

Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm

Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	24,031.36	8,944.78	15,086.58	62.78
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,450.00	3,100.00	4,350.00	58.39
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	31,481.36	12,044.78	19,436.58	61.74
Approved Total (Overridden) (S\$)		9,000.00		
(S\$)	31,481.36	9,000.00	22,481.36	71.41
+ GST 7.00/7.00% (S\$)	2,203.70	630.00	1,573.70	71.41
Nett Amount (S\$)	33,685.06	9,630.00	24,055.06	71.41
+ Car Rental (7.0 x S\$150.00/day) (S\$)		1,050.00		
+ Doc/Search Fee (S\$)		21.45		
Nett Liability (S\$)		10,701.45		
Global Sum Settlement (S\$)		10,400.00		

INSPECTION

Date of Assignment: 04/03/2020

Date Inspected: 10/03/2020 Inspected At:

Vision Autowork Pte Ltd (HQ)
8 KAKI BUKIT AVE 4., #08-09
PREMIER @ KAKI BUKIT
Singapore 415875

Estimated Period of Repair: 10.0 days

Adjuster: ADRIAN LING

Manager: Khanchna Pothuraj

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Deformed	563.50 FL	*563.50 FL
2	1	*FRONT BUMPER FOGLAMP	Not Necessary	514.60 FL	*- FL
3	1	*FRONT BUMPER GRILLE LOGO	Not Necessary	52.50 FL	*- FL
4	2	*FRONT BUMPER UPPER GARNISH	Deformed	697.20 FL	*697.20 FL
5	2	*FRONT BUMPER SIDE RETAINER	Necessary	44.20 FL	*44.20 FL
6	1	*FRONT BUMPER REINFORCEMENT	Bent	591.90 FL	*591.90 FL
7	1	*FRONT BUMPER SPONGE	Cracked	280.70 FL	*280.70 FL
8	1	*FRONT BUMPER BOTTOM COVER	Not Necessary	354.20 FL	*- FL
9	1	*FRONT GRILLE	Cracked	344.10 FL	*344.10 FL
10	1	*FRONT GRILLE MOULDING	Cut	201.70 FL	*201.70 FL
11	2	*HEADLAMP	Cracked	826.40 FL	*826.40 FL
12	1	*BONNET	Dented	858.50 FL	*858.50 FL
13	1	*BONNET INSULATOR	Not Necessary	93.60 FL	*- FL
14	2	*BONNET STOPPER	Not Necessary	37.80 FL	*- FL
15	1	*BONNET LOCK	Damaged	54.60 FL	*54.60 FL
16	2	*BONNET HINGE	Not Necessary	82.40 FL	*- FL
17	1	*FRONT SUPPORT TOP PANEL	Bent	325.30 FL	*325.30 FL
18	2	*FRONT SUPPORT STAND PANEL	Not Necessary	135.80 FL	*- FL
19	1	*RADIATOR	Not Necessary	765.70 FL	*- FL
20	4	*RADIATOR MOUNTING	Not Necessary	32.00 FL	*- FL
21	1	*AIR CONDENSER	Not Necessary	667.80 FL	*- FL
22	2	*AIR CONDENSER MOUNTING	Not Necessary	38.20 FL	*- FL
23	4	*AIR CONDENSER SIDE GARNISH	Cracked	135.20 FL	*135.20 FL
24	1	*AIR CLEANER DUCT	Cracked	87.60 FL	*87.60 FL
25	1	*HORN	Cracked	106.00 FL	*106.00 FL
26	2	*FRONT FENDER INNER COWLING	Not Necessary	178.20 FL	*- FL
27	1	*REAR BUMPER	Deformed	560.90 FL	*560.90 FL
28	2	*REAR BUMPER REFLECTOR	Not Necessary	99.40 FL	*- FL
29	1	*REAR BUMPER TOW HOOK COVER	Not Necessary	13.30 FL	*- FL
30	2	*REAR BUMPER SIDE RETAINER	Necessary	75.00 FL	*75.00 FL
31	1	*REAR BUMPER SPONGE	Cracked	98.80 FL	*98.80 FL
32	2	*REAR NUMBER PLATE LAMP	Not Necessary	108.40 FL	*- FL
33	1	*TAIL LAMP	N/S Cracked	551.60 FL	*275.80 FL
34	1	*REAR DOOR LH	Dented	1,685.30 FL	*1,685.30 FL
35	1	*REAR DOOR GLASS LH	Not Necessary	785.10 FL	*- FL
36	1	*REAR DOOR LOGO LH	Necessary	55.20 FL	*55.20 FL
37	1	*REAR DOOR EMBLEM NV 200 LH	Cracked	96.40 FL	*96.40 FL
38	1	*REAR DOOR NUMBER PLATE LAMP GARNISH	Cracked	581.50 FL	*289.50 FL
39	1	*REAR DOOR OUTER HANDLE LH	Not Necessary	70.50 FL	*- FL
40	1	*REAR DOOR INNER LOCK HANDLE LH	Not Necessary	47.60 FL	*- FL
41	1	*REAR DOOR INNER CENTER LOCK MOTOR LH	Damaged	150.80 FL	*150.80 FL
42	1	*REAR DOOR INNER TRIM LH	Not Necessary	210.30 FL	*- FL
43	1	*REAR DOOR WIPER MOTOR LH	Not Necessary	250.20 FL	*- FL
44	1	*REAR DOOR WIPER BLADE LH	Not Necessary	98.60 FL	*- FL
45	1	*REAR DOOR WIPER ARM LH	Not Necessary	123.50 FL	*- FL
46	1	*REAR DOOR WIPER COVER LH	Not Necessary	29.30 FL	*- FL
47	1	*REAR DOOR RH	Repair	1,545.90 FL	*- FL
48	1	*REAR DOOR GLASS RH	Not Necessary	592.30 FL	*- FL
49	1	*REAR DOOR CENTER STOPPER RH	Not Necessary	39.80 FL	*- FL
50	2	*REAR DOOR LOCK CATCHER	Not Necessary	65.20 FL	*- FL
51	1	*REAR DOOR INNER TRIM RH	Not Necessary	198.60 FL	*- FL
52	1	*REAR DOOR FRAME WEATHERSTRIP	Cut	217.90 FL	*217.90 FL
53	1	*REAR DOOR UPPER LOCK	N/S Damaged	256.40 FL	*128.20 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
54	1		*REAR DOOR LOWER LOCK	N/S Damaged	318.60 FL	*159.30 FL
55	2		*REAR DOOR HINGE LH	Not Necessary	239.20 FL	*- FL
56	2		*REAR DOOR CHECKER	Not Necessary	197.00 FL	*- FL
57	1		*REAR DOOR WEATHERSTRIP CENTER	Not Necessary	132.80 FL	*- FL
58	1		*REAR END PANEL	Dented	235.60 FL	*235.60 FL
59	1		*REAR END PANEL (INNER)	Repair	584.70 FL	*- FL
60	1		*REAR END PANEL TOP GARNISH	Cracked	248.60 FL	*248.60 FL
61	1		*REAR FLOOR PANEL	Repair	2,612.30 FL	*- FL
62	1		*REAR FLOOR PANEL TOP MAT	Not Necessary	1,793.00 FL	*- FL
63	1		*REAR SPARE TYRE LOCK WITH BOLT	Not Necessary	185.30 FL	*- FL
64	1		*REAR SPARE TYRE LOCK BRACKET	Not Necessary	365.80 FL	*- FL
65	1		*FRONT NUMBER PLATE	Bent	50.00 FS	*50.00 FS
66	1		*SET FRONT BUMPER CLIP	Necessary	80.00 FS	*30.00 FS
67	1		*SET FRONT GRILLE CLIP	Necessary	50.00 FS	*20.00 FS
68	1		*SET BONNET INSULATOR CLIP	Not Necessary	50.00 FS	*- FS
69	1		*FRONT SUPPORT TOP PANEL SEALANT	Not Necessary	80.00 FS	*- FS
70	1		*SET FRONT FENDER INNER COWLING CLIP	Not Necessary	60.00 FS	*- FS
71	1		*RADIATOR COOLANT	Not Necessary	80.00 FS	*- FS
72	1		*REAR NUMBER PLATE	Not Necessary	50.00 FS	*- FS
73	1		*SET REAR BUMPER CLIP	Necessary	80.00 FS	*30.00 FS
74	1		*SET TAIL LAMP CLIP	Necessary	50.00 FS	*10.00 FS
75	1		*SET REAR DOOR INNER BOARD CLIP	Not Necessary	80.00 FS	*- FS
76	2		*REAR DOOR GLASS SEALANT	Necessary	160.00 FS	*30.00 FS
77	2		*REAR DOOR GLASS INNER SEAL	Necessary	120.00 FS	*20.00 FS
78	1		*REAR DOOR GLASS SOLAR FILM LH	Not Necessary	150.00 FS	*- FS
79	1		*REAR DOOR STICKER 70KM/H	Necessary	30.00 FS	*15.00 FS
80	1		*REAR DOOR STICKER 6PAX	Necessary	30.00 FS	*15.00 FS
81	1		*SET REAR END PANEL TOP GARNISH CLIP	Necessary	50.00 FS	*10.00 FS
82	1		*REAR END PANEL INSULATION SEAL	Necessary	150.00 FS	*60.00 FS
83	1		*REAR FLOOR PANEL INSULATION SEAL	Not Necessary	350.00 FS	*- FS
84	1		*REAR FLOOR PANEL TOP BOARD (SPECIAL TYPE)	Not Necessary	800.00 FS	*- FS
85	1		*REVERSE SENSOR	Damaged	250.00 FS	*200.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	26,390.40	9,884.20
- List Item Discount on L Items 10.00/10.00% (\$\$)	2,359.04	939.42
Total Parts (\$\$)	24,031.36	8,944.78

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING ,REMOVING AND REPLACING PARTS	New	1,200.00	600.00
2	SPRAY PAINTING TO AFFECTED AREA	New	1,200.00	600.00
3	REMOVE AND REFIX AIRCON CONDENSOR AND REFILL AIRCON GAS	New	120.00	60.00
4	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST	New	80.00	60.00
5	REFOCUS HEADLAMP BEAM	New	80.00	0.00
6	REMOVE AND REFIX TURBO COLLER	New	250.00	0.00
7	TO PANEL BEAT ,REMOVE AND REPLACE PARTS	New	1,600.00	800.00
8	TO SPRAY PAINT AFFECTED AREA	New	1,600.00	700.00
9	TUFF COAT	New	250.00	60.00
10	REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR	New	150.00	60.00
11	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING	New	80.00	50.00
12	CONDUCT WATER LEAKAGE TEST	New	80.00	0.00
13	TRANSFER REAR DOOR MECHANISM X2	New	160.00	40.00
14	REMOVE & REINSTALL REAR DOOR GLASS X2	New	160.00	40.00
15	REMOVE AND REFIX REAR EXHAUST PIPE	New	180.00	0.00
16	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC	New	180.00	0.00
17	WIRING AND BULB CHECK	New	80.00	30.00
Gross Labour Cost (\$\$)			7,450.00	3,100.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >