# **LKK Auto Consultants** #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

KK LAU

**Insurer Reference:** 

**Full Report** Registration: SGM357U

Repairer Reference: SGM357U-TP CHINA Date calculated: 28/09/2020 10:46 AM

Printed: 28/09/2020 10:47 AM

# **Summary Information**

Claim

Location: Singapore (SG) Work Provider:

China Taiping Insurance

(Singapore) Pte Ltd

Printed by:

Claim Reference:

Date of Incident: Hire Car Start:

SGD 09/03/20

Estimated Repair Time: Actual Repair Days:

Hire Car End:

Currency:

### **Vehicle Details**

Vehicle

Manufacturer: HONDA Model: CIVIC (FD) Sub Model: VTI-S Model Sheet Number: 35 48 38 Registration: SGM357U

VIN number: Odometer:

**Model Specs** 

FROM MODEL 2006 AIR CONDITIONING TWO COAT METALLIC

PREPARE OFF VEHICLE

RR PARK DIST CONTROL 1.6 LTR 92KW VTEC


#### **Vehicle Condition**

#### **Vehicle Status**

Pre-Accident Damage: Date of Inspection:

#### **Damage Areas**

All **Underbody** 

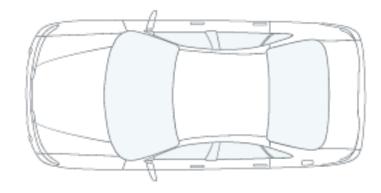

# Labour

	Time Base 10 WU/h		2.00 SGD/h
Code	Description	WU	J Price SGD
71501-SNB	RENEW REAR BUMPER	3.0	12.60
NO NUMBER	R + R REAR PARKING AID SENSORS ADD/WORK	3.0	12.60
68500-SNB)	RENEW BOOTLID (REMOVED) INCLUDES: R + R INNER TAILLAMPS, NUMBER PLATE, BADGE, NUMBER PLATE LAMPS AND LOCK	9.0	37.80
68660-SNA)	R + R L/BOOTLID HINGE	8.0	33.60
62100-SMG	RENEW REAR END PANEL CPL	41.0	172.20
NO NUMBER	R + R ATTACHED PARTS OF THE L/SIDE PANEL INCLUDES: R + R BUMPER, TAIL LAMP, BOOT LID, BOOT LID SEAL, REAR SEAT, SEAT BELT, FUEL FILLER LID, FUEL FILLER NECK, REAR WINDOW AND ALL TRIMS IN THE REPAIR SECTION	55.0	231.00
04646-SMG	RENEW L/SIDE PANEL	94.0	394.80
NO NUMBER	R + R ATTACHED PARTS OF THE REAR PANEL (REAR BUMPER AND BOTH TAIL LAMPS REMOVED) INCLUDES: R + R BOOT LID LOCK AND NECESSARY ATTACHED PARTS	35.0	147.00
1781	L/R DOOR REPAIR	10.0*	
3900	BOOTFLOOR REPAIR	20.0*	84.00
4101	L/INN SIDE PANEL CPL REPAIR	20.0*	84.00
	Labour Cost	Hrs WU	
	Panel / Mechanical Labour	29.80 298.0	1,251.60
	Total of Labour		1,251.60

### **Paint**

Paint Work	SYSTEM AZT	Time Basis	10 WU/h
Code	Description - TWO COAT METALLIC	WU	Price SGD
	REAR PANEL CPL NEW PART PAINTING	19.0	
	BOOTLID NEW PART PAINTING	16.0	
	L/R SIDE PANEL NEW PART PAINTING	29.0	
	BOOTFLOOR SURFACE PAINT	9.0	
	L/INN SIDE PANEL CPL SURFACE PAINT	5.0	
	REAR BUMPER NEW PART PAINT K1N	16.0	
	LOWER BUMPER COVER NEW PART PAINT K1N	4.0	
	L/R PARK SYS SENSOR NEW PART PAINT K1N	3.0	
	L/R CTR PARK SENSOR NEW PART PAINT K1N	3.0	
	L/R DOOR REPAIR PAINTING >50%	21.0	
	R/R PARK SYS SENSOR SURFACE PAINT PLAST.	3.0	
	R/R CTR PARK SENSOR SURFACE PAINT PLAST.	3.0	

# **Paint Material Per Part**

Code	Description	Price SGD
2711	REAR PANEL CPL NEW PART PAINTING	22.00

## **Paint Material Per Part**

Code	Description	Price SGD
2931	BOOTLID NEW PART PAINTING	45.41
3481	L/R SIDE PANEL NEW PART PAINTING	39.60
3900	BOOTFLOOR SURFACE PAINT	28.14
4101	L/INN SIDE PANEL CPL SURFACE PAINT	7.97
2583	REAR BUMPER NEW PART PAINT K1N	74.18
2587	LOWER BUMPER COVER NEW PART PAINT K1N	3.93
2673	L/R PARK SYS SENSOR NEW PART PAINT K1N	0.56
2675	L/R CTR PARK SENSOR NEW PART PAINT K1N	0.56
1781	L/R DOOR REPAIR PAINTING >50%	26.07
2674	R/R PARK SYS SENSOR SURFACE PAINT PLAST.	0.37
2676	R/R CTR PARK SENSOR SURFACE PAINT PLAST.	0.37

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			131.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	16.40	164.0	688.80

Material Cost - Paint	Price SGD
New Part Painting	107.01
New Part Painting - Plastic K1N	79.23
Repair Painting	26.07
Surface-/Blend Paint	36.11
Surface Painting Plastic	0.74
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	290.46

# **Spare Parts**

•				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	•
3017 3013 2931 2977 2944 4985 4971 2619 2675 1006 2953 3283	BADGE CIVIC BADGE HONDA BOOTLID BOOTLID LOCK BOOTLID SEAL END PANEL TRIM L/C-PILLAR TRIM L/R BUMPER BRACKET L/R CTR PARK SENSOR L/R FENDER INNER L/R HINGE L/R INNER LAMP CPL	75722SNBJ01 75711SNAK01 68500SNLT01ZZ 74851SNA003 74865SNA013 84640SNAA01ZA 84180SNAA11ZA 71598SNAA01 08V67SNB61003 SHIELD 68660SNAA00ZZ 34156SNB023	Original	20.00 18.00 340.00 55.00 45.00 30.00 180.00 12.00 95.00 50.00 38.00 180.00
3283 3571 3281 2673 3481 1004	L/R INNER LAMP CPL L/R LAMP PANEL L/R OUTER LAMP CPL L/R PARK SYS SENSOR L/R SIDE PANEL REAR BOOT 1.6 IVTEC	63720SNBE00ZZ 33551SNB003 08V67SNB61005 04646SNBG00ZZ LOGO	Original Original Original Original Original Original	180.00 0.00 110.00 95.00 580.00 15.00

Code 1003 2583 1007 2711 3160 3166 3163 3161 3164 3165	Description REAR BOOT LOCK REAR BUMPER REAR FENDER AIR VENT REAR PANEL CPL REAR SCREEN BOND KIT REAR SCREEN CLAMPS REAR SCREEN FIX SET REAR SCREEN SEAL REAR SCREEN SPACER REAR SCREEN SPACER	66100SNAA01ZZ	Part Source Original Original OEM Original Original	Price SGD 10.00 230.00 30.00 240.00 0.00 0.00 0.00 80.00 0.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Fixed Sundry Parts I			0.00 2,453.00 100.00
	Total			2,553.00

#### **Extras**

EXU as		
Code	Description	Price SGD
1000	TO RESET & DIAGNOSE FAULT CODE	150.00*
1001	REAR WINDSCREEN SEALANT	40.00*
1002	TO DO WHEEL ALIGNMENT	*80.00
1005	CHECK WIRING .	30.00*
1009	RR BUMPER SENSOR RETAINER (4PCS)	100.00*
1010	RR BUMPER SENSOR ECU	240.00*
	Total Extras	640.00

# **Final Calculation**

i mar carcaration		
	SGD	SGD
Parts	2,453.00	
Fixed Sundry Parts Price	100.00	
Total Parts		2,553.00
Labour Time Base 10 WU/h		
Total 298.0 WU X 42.00 SGD/h	1,251.60	
Total of Labour		1,251.60
Total Of Extras		640.00
Paint Work Time Base 10 WU/h		
Labour Cost 164.0 WU X 42.00 SGD/h	688.80	
Material Cost	290.46	
Total Paint Including Material		979.26
Repair Cost Excludes GST		5,423.86
GST (+7.0%)		379.67
Repair Cost Included GST		5,803.53
Deductions (Excludes GST)		
Repair Cost Discount (+20.00%)	-1,084.77	
Total Of Deductions (Excludes GST)		-1,084.77
Grand Total Excludes GST		4,339.09
GST (+7.0%)	_	303.74
Grand Total Included GST		4,642.83

#### Comments

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

# **Assessment Note**

No assessment notes entered.