



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2101740

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 18/03/2021
Reference CC6/CTI20003871/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMR 5509T
Insured Veh. SJP 6574T
Claim No. SNM20D201176
Policy No. DMPCSN1913101900
Accident Date 03/03/2020
Inspection Date 10/03/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20003871/Apa3q2 Date: 18/03/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJP 6574T	Veh. Inspected	SMR 5509T	
Policy No.	DMPCSN1913101900	Coverage (\$)	0.00	
Claim No.	SNM20D201176	Excess (\$)	0.00	
Assign From		Assign Date	10/03/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA SHUTTLE	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	GK82103029	Colour	BLACK	
Odometer	10343 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/45 R17	YOKOHAMA	6 mm	
L/H Front Tyre	205/45 R17	YOKOHAMA	6 mm	
R/H Rear Tyre	205/45 R17	YOKOHAMA	6 mm	
L/H Rear Tyre	205/45 R17	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/03/2020	Inspection Date	10/03/2020	
Survey held at	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMR 5509T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
2	REAR WINDSCREEN MOULDING @ \$198.90	NECESSARY	397.80	138.00
1	REAR GATE	DENTED	1,695.00	1,195.00
1	REAR GATE LOGO	NOT NECESSARY	108.00	-
1	REAR GATE EMBLEM "SHUTTLE"	NECESSARY	97.00	65.00
2	REAR GATE LAMP @ \$770.00	O/S CUT	1,540.00	395.00
1	REAR GATE SMART LOCK	NOT NECESSARY	185.60	-
1	REAR GATE WEATHERSTRIP	CUT	198.00	198.00
1	REAR GATE LOCK	DAMAGED	255.50	255.50
1	REAR GATE CATCH	NOT NECESSARY	70.00	-
1	REAR GATE OUTER MOULDING CHROME	NOT NECESSARY	580.00	-
2	REAR GATE STOPPER @ \$40.00	NOT NECESSARY	80.00	-
1	REAR GATE INNER TRIM	CRACKED	458.00	358.00
1	REAR BUMPER	DEFORMED	1,352.00	1,150.00
2	REAR BUMPER RETAINER @ \$50.00	NECESSARY	100.00	100.00
1	REAR BUMPER OUTER MOULDING CHROME	NECESSARY	490.00	383.00
2	REAR BUMPER REFLECTOR @ \$85.00	NOT NECESSARY	170.00	-
1	REAR END PANEL	DENTED	859.00	601.00
1	REAR END PANEL TOP GARNISH	DEFORMED	275.00	275.00
2	REAR FENDER @ \$895.60	NOT NECESSARY	1,791.20	-
2	REAR FENDER INNER COWLING @ \$148.00	NOT NECESSARY	296.00	-
2	REAR FENDER INNER TRIM @ \$610.00	NOT NECESSARY	1,220.00	-
2	TAIL LAMP @ \$876.00	NOT NECESSARY	1,752.00	-
	LESS 20% DISCOUNT		-2,794.02	-1,022.70
			11,176.08	4,090.80
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	40.00
1	SET REAR BUMPER REFLECTOR GARNISH CLIP (SN)	NOT NECESSARY	50.00	-
2	SET REAR FENDER INNER COWLING CLIPS @ \$100.00 (SN)	NOT NECESSARY	100.00	-
1	SET REAR FENDER INNER TRIM (SN)	NOT NECESSARY	50.00	-

Report Ref No. CC6/CTI20003871/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN GUM (SN)	NECESSARY	80.00	60.00
1	SET TAILGATE SEALANT (SN)	NOT NECESSARY	200.00	-
1	SET TAIL GATE INNER TRIM CLIP (SN)	NECESSARY	50.00	40.00
1	TAIL GATE WINDSCREEN INNER SEAL (SN)	NECESSARY	70.00	60.00
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	200.00	60.00
1	REVERSE CAMERA (SN)	NOT NECESSARY	450.00	-
1	REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
			1,650.00	460.00
	LABOUR			
	TO RENEW DAMAGED PARTS, REPLACE, BENT, WELD, REALIGN AND ALIGNE ALL PARTS.		1,600.00	900.00
	TO RESPRAY AFFECTED AREAS.		1,400.00	900.00
	TO TUFFCOAT AFFECTED AREA.		200.00	80.00
	TO REMOVE / REFIT INTERIOR UPHOLSTERY.		150.00	80.00
	TO APPLY SEALANT AND UNDERCOATING TO THE END PANEL.		200.00	60.00
	TO REMOVE / REFIT WIRING CHECKS ON REAR TAILAMPS.		120.00	30.00
	TO REMOVE / REFIT REAR WINDSCREEN.		150.00	120.00
	TO CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	80.00	-
	TO REMOVE / REPLACE REAR FENDER MIRROR.	NOT NECESSARY	120.00	-
	TO REMOVE / REPLACE REVERSE SENSORS AND DISTANCE SETTLING.		150.00	60.00
	TO REMOVE AND REPLACE TAILGATE MECHANISM.		150.00	80.00
1			-	-
			4,320.00	2,310.00
GRAND TOTAL			17,146.08	6,860.80

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,500.00
---	--	--	-----------------

Report Ref No. CC6/CTI20003871/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 5509T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 5509T

RE-INSPECTION

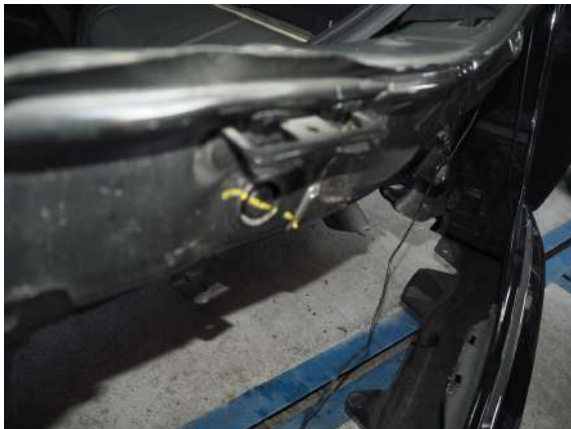



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 5509T

RE-INSPECTION

