

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI20004112/EYF3E2

Date: 14/04/2020

REFERENCE

Handling Insurer: China Taiping
Insurance (Singapore) Policy No: DMPCSNW00018962000
Pte. Ltd.

Claimant Vehicle No : GBH5527Z **Insured Vehicle No :** SJN5644S

Date of Loss: 13/03/2020 Nature of Claim: TP Claim No: SNM20D201302/SJN5644S/CECILIA

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBH5527Z	Engine No:	4P10D23858
Make & Model:	mitsubishi canter, 3.0 D (M)	Chassis No:	FEA01BA25044
Reg. Date:	09/07/2018 (Man. Year: 2018)	Odometer:	76042 km
Colour:	White		
Engine Capacity:	2998 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/85 R15C	Rear Tyre Size:	195/85 R15C
Front Left Side:	Kenda 5 mm	Rear Left Side:	Kenda 5 mm
Front Right Side:	Kenda 5 mm	Rear Right Side:	Kenda 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	32,043.61	27,896.39	4,147.22	12.94
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,710.00	7,035.00	675.00	8.75
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	39,753.61	34,931.39	4,822.22	12.13
Approved Total (Overridden) (S\$)		28,000.00		
(S\$)	39,753.61	28,000.00	11,753.61	29.57
+ GST 7.00/7.00% (S\$)	2,782.75	1,960.00	822.75	29.57
Nett Amount (S\$)	42,536.36	29,960.00	12,576.36	29.57

INSPECTION

Date of Assignment:	17/03/2020		
Date Inspected:	17/03/2020	Inspected At:	NO 8 TUAS AVE 18 Repairer : Goldbell Engineering Pte Ltd
Estimated Period of Repair:	14.0 days		

Adjuster: CHEN TSUE YEE

Manager: YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 11 Apr 2020)	
Parts:	N/A	mitsubishi canter 3.0 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBH5527Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*GLASS, WINDSHIELD	Broken	978.30 FS	*978.30 FS
2	1		*W/STRIP, WINDSHIELD	Cut	356.54 FS	*356.54 FS
3	1		*REAR DECK TAILGATE	Dented	835.00 FS	*835.00 FS
4	1		*GARNISH, FR PANEL	Broken	567.45 FS	*567.45 FS
5	3		*GARNISH, FR PANEL CLIP	Not Necessary	14.85 FS	*- FS
6	2		*WIPER ARM	Bent	224.70 FS	*224.70 FS
7	2		*WIPER BLADE	Cut	98.04 FS	*98.04 FS
8	1		*PANEL ASSY, FRONT	Dented	2,337.31 FS	*2,337.31 FS
9	1		*RAIL ASSY, WINDSHIELD	Dented	1,279.28 FS	*1,279.28 FS
10	1		*MARK, FUSO	Necessary	153.63 FS	*153.63 FS
11	1		*PANEL ASSY, FR DOOR, RH	Not Necessary	884.23 FS	*- FS
12	1		*PANEL, CAB FR CORNER - RH	Broken	502.28 FS	*502.28 FS
13	1		*CAB FR CORNER DOOR SEAL, DR OPENING RH	Not Necessary	36.52 FS	*- FS
14	4		*CAB FR CORNER CLIP	Not Necessary	25.48 FS	*- FS
15	1		*CAP, MIRROR COVER FLAT RH	Broken	29.42 FS	*29.42 FS
16	1		*PANEL, CAB FR CORNER - LH	Broken	502.28 FS	*502.28 FS
17	1		*CAB FR CORNER DOOR SEAL, DR OPENING LH	Not Necessary	36.52 FS	*- FS
18	1		*CAP, FR CORNER PANEL, LH	Broken	29.42 FS	*29.42 FS
19	1		*LATCH & ACTUATOR, FR DOOR, LH	Broken	665.30 FS	*665.30 FS
20	1		*LATCH & ACTUATOR, FR DOOR - RH	Not Necessary	665.30 FS	*- FS
21	2		*MIRROR, OUTSIDE RR VIEW	Missing	193.86 FS	*193.86 FS
22	1		*STAY, RR VIEW MIRROR - RH	Cracked	435.13 FS	*435.13 FS
23	2		*COVER, RR VIEW MIRROR STAY	Missing	27.42 FS	*27.42 FS
24	1		*STAY, RR VIEW MIRROR - LH	Not Necessary	454.90 FS	*- FS
25	1		*MIRROR, UNDER VIEW	Missing	56.07 FS	*56.07 FS
26	1		*LAMP ASSY, TURN SIGNAL, FR - LH	Broken	201.29 FS	*201.29 FS
27	1		*LAMP ASSY, TURN SIGNAL, FR - RH	Cracked	196.70 FS	*196.70 FS
28	1		*BOX, AIR INTAKE	Broken	581.70 FS	*581.70 FS
29	1		*HEATER ASSY	Broken	2,689.24 FS	*2,689.24 FS
30	1		*PANEL ASSY, INSTRUMENT (DASHBOARD)	Not Necessary	1,714.42 FS	*- FS
31	1		*TANK, W/SHLD WASHER	Crushed	158.87 FS	*158.87 FS
32	1		*TANK ASSY, UREA	Cut	5,674.54 FS	*5,674.54 FS
33	1		*BRKT ASSY, UREA TANK	Bent	664.72 FS	*664.72 FS
34	1		*TUBE, UREA LINE	Crushed	989.08 FS	*989.08 FS
35	1		*ADBLUE	Necessary	34.00 FS	*34.00 FS
36	1		*SCR MUFFLER ASSY	Dented	2,144.00 FS	*2,144.00 FS
37	1		*SENSOR, EXHAUST MUFFLER PM	Torn	1,868.74 FS	*1,868.74 FS
38	1		*CONTROLLER, NH3 SENSOR	Bent	1,161.95 FS	*1,161.95 FS
39	1		*SENSOR, EXHAUST MUFFLER NOX	Torn	1,753.13 FS	*1,753.13 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
40	1		*LAMP ASSY, COMBINATION, RR LH	Broken	186.00 FS	*186.00 FS	
41	1		*LAMP ASSY, COMBINATION, RR RH	Broken	186.00 FS	*186.00 FS	
42	1		*IU BRACKET	Necessary	20.00 FS	*20.00 FS	
43	1		*ALUMINIUM CHECKER PLATE	Not Necessary	285.00 FS	*- FS	
44	1		*70 KM/H STICKER	Necessary	20.00 FS	*20.00 FS	
45	1		*6 PAX STICKER	Necessary	20.00 FS	*20.00 FS	
46	1		*NUMBER PLATE	Bent	25.00 FS	*25.00 FS	
47	1		*SUNDRIES	Necessary	80.00 FS	*50.00 FS	
					Total Parts (S\$)	32,043.61	27,896.39

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REFIX DAMAGED PARTS, CUT, WELD, PANEL BEAT, STRAIGHTEN & REALIGN ETC	New	4,200.00	3,900.00
2	TO CHECK FOR AND RECTIFY WIRING FAULTS, TO CONDUCT DIAGNOSTICS CHECK	New	180.00	180.00
3	TO REMOVE AND REFIX FRONT WINDSCREEN	New	180.00	180.00
4	TO REMOVE AND REFIX FRONT DASHBOARD	New	700.00	600.00
5	TO REMOVE AND REFIX AIRCON SYSTEM AND TOP UP GAS. TO CHECK FUNCTION	New	700.00	600.00
6	TO PUTTY, CLEAN, SPRAY PAINT AND POLISH, ETC	New	1,750.00	1,575.00
Gross Labour Cost (\$)			7,710.00	7,035.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >