

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG20004445/UEA3Q2**Date:** 30/10/2020REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100454356
Claimant
Vehicle No : SLL6554Z **Insured Vehicle No :** GBE6684L
Date of Loss: 20/03/2020 Nature of Claim: TP Claim No: 8487201251SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLL6554Z**
Make & Model: HONDA SHUTTLE, 1.5 G CVT (A) Engine No: L15B5000541
Reg. Date: 03/03/2017 (Man. Year: 2016) Chassis No: GK81100476
Colour: Silver Odometer: 46226 km
Engine Capacity: 1496 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 185/60 R15 Rear Tyre Size: 185/60 R15
Front Left Side: Yokohama 6 mm Rear Left Side: Yokohama 6 mm
Front Right Side: Yokohama 6 mm Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	26,210.24	20,107.12	6,103.12	23.29
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,830.00	4,970.00	3,860.00	43.71
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	35,040.24	25,077.12	9,963.12	28.43
Approved Total (Overridden) (S\$)		18,500.00		
(S\$)	35,040.24	18,500.00	16,540.24	47.20
+ GST 7.00/7.00% (S\$)	2,452.82	1,295.00	1,157.82	47.20
Nett Amount (S\$)	37,493.06	19,795.00	17,698.06	47.20
+ Car Rental (20.0 x S\$100.00/day + 7.00% GST) (S\$)		2,140.00		
+ Doc/Search Fee (S\$)		8.00		
Nett Liability (S\$)		21,943.00		
Global Sum Settlement (S\$)		21,940.00		

INSPECTION

Date of Assignment: 24/03/2020
Date Inspected: 24/03/2020 Inspected At: Precise Auto Service (HQ)
No 1 Kaki Bukit Ave 6, #02-34/36
Singapore 417883
Estimated Period of Repair: 18.0 days

Adjuster: MARCUS CHUA**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER FASCIA	Dented / Deformed	1,050.20 FL	*862.90 FL
2	2		*FRONT BUMPER SIDE RETAINER	Not Necessary	50.80 FL	*- FL
3	1		*FRONT BUMPER CENTER AIR GRILLE	Twisted	145.20 FL	*145.20 FL
4	2		*FRONT BUMPER FOG LAMP COVER	Serviceable	90.40 FL	*- FL
5	1		*FRONT BUMPER REINFORCEMENT	Bent	420.80 FL	*420.80 FL
6	10		*FRONT BUMPER CLIPS	Necessary	35.00 FL	*35.00 FL
7	1		*FRONT BUMPER TOW COVER	Not Necessary	25.40 FL	*- FL
8	1		*FRONT GRILLE	Cracked	395.40 FL	*395.40 FL
9	1		*FRONT GRILLE INNER GARNISH BRACKET	Cracked	65.20 FL	*65.20 FL
10	1		*FRONT GRILLE CHROME	Cracked	302.40 FL	*302.40 FL
11	1		*FRONT GRILLE BADGE	Necessary	28.40 FL	*28.40 FL
12	6		*FRONT GRILLE CLIPS	Not Necessary	21.00 FL	*- FL
13	1		*FRONT GRILLE TOP GARNISH COVER	Torn	58.20 FL	*58.20 FL
14	2		*HEAD LAMP	Cracked	4,500.80 FL	*4,455.40 FL
15	2		*HEAD LAMP LOWER BRACKET	Not Necessary	76.40 FL	*- FL
16	1		*BONNET	Buckled	920.80 FL	*920.80 FL
17	2		*BONNET HINGES	Serviceable	91.60 FL	*- FL
18	1		*BONNET LOCK	Twisted	135.40 FL	*135.40 FL
19	1		*BONNET LOCK CABLE	Not Necessary	75.20 FL	*- FL
20	1		*BONNET INNER RUBBER BEADING	Not Necessary	27.40 FL	*- FL
21	13		*BONNET INNER RUBBER BEADING CLIPS	Not Necessary	45.50 FL	*- FL
22	4		*BONNET INSULATOR CLIPS	Not Necessary	14.00 FL	*- FL
23	1		*FRONT SUPPORT PANEL	Bent	785.40 FL	*785.40 FL
24	1		*AIR COND CONDENSOR	Bent / Punctured	985.40 FL	*985.40 FL
25	2		*AIR COND CONDENSOR SIDE AIR GRILLE GARNISH	Deformed / Torn	100.20 FL	*100.20 FL
26	1		*RADIATOR ASSY	Bent / Punctured	1,350.40 FL	*1,350.40 FL
27	1		*FRONT FENDER -LH	Repair	368.40 FL	*- FL
28	1		*TAIL GATE	Badly Dented	1,193.20 FL	*1,193.20 FL
29	2		*TAIL GATE HINDGE	Not Necessary	81.00 FL	*- FL
30	2		*TAIL GATE STOPPER	Not Necessary	17.00 FL	*- FL
31	1		*TAIL GATE LOCK	Dented / Jammed	256.40 FL	*256.40 FL
32	1		*TAIL GATE LOCK STRIKER	Not Necessary	34.70 FL	*- FL
33	1		*TAIL GATE WEATHER STRIPE	Twisted	168.20 FL	*168.20 FL
34	2		*TAIL GATE ABSORBER	Not Necessary	240.80 FL	*- FL
35	8		*TAIL GATE CHROME CLIPS	Not Necessary	28.00 FL	*- FL
36	1		*TAIL GATE OUTER GARNISH WITH CHROME	Bent / Cracked	363.80 FL	*363.80 FL
37	1		*TAIL GATE BADGE	Necessary	46.50 FL	*46.50 FL
38	1		*TAIL GATE EMBLEM SHUTTLE	Necessary	55.40 FL	*55.40 FL
39	2		*TAIL GATE REFLECTOR	Broken	790.80 FL	*790.80 FL
40	2		*TAIL GATE REFLECTOR SEALANT	Not Necessary	25.80 FL	*- FL
41	4		*TAIL GATE REFLECTOR CLIPS	Not Necessary	14.00 FL	*- FL
42	1		*TAIL GATE INNER TRIM BOARD	Deformed / Torn	320.40 FL	*320.40 FL
43	8		*TAIL GATE INNER TRIM BOARD CLIPS	Necessary	28.00 FL	*28.00 FL
44	1		*TAIL GATE OUTER KEYLESS SENSOR	Not Necessary	85.40 FL	*- FL
45	1		*TAIL GATE LOCK BUZZER	Not Necessary	80.10 FL	*- FL
46	2		*TAIL GATE REFLECTOR BULB SOCKET	Not Necessary	30.40 FL	*- FL
47	1		*REAR WIPER MOTOR	Jammed	390.40 FL	*390.40 FL
48	1		*REAR WIPER ARM	Bent	95.50 FL	*95.50 FL
49	1		*REAR WIPER ARM COVER	Missing	8.10 FL	*8.10 FL
50	1		*REAR WIPER BLADE	Not Necessary	66.50 FL	*- FL
51	1		*REAR WINDSCREEN GLASS	Shattered	1,210.40 FL	*1,210.40 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
52	1		*REAR WINDSCREEN GLASS MOULDING	Necessary	149.20 FL	*149.20 FL
53	14		*REAR WINDSCREEN CLIPS	Not Necessary	77.00 FL	*- FL
54	1		*REAR WINDSCREEN GLASS RECORDER V9	Shorted	39.10 FL	*39.10 FL
55	2		*TAIL LAMP ASSY	Broken	1,040.80 FL	*1,040.80 FL
56	2		*TAIL LAMP SEALANT	Not Necessary	42.80 FL	*- FL
57	4		*TAIL LAMP CLIPS	Not Necessary	14.00 FL	*- FL
58	2		*TAIL LAMP BASE PANEL	Repair	420.80 FL	*- FL
59	2		*TAIL LAMP BULB SOCKET	Not Necessary	30.80 FL	*- FL
60	1		*REAR BUMPER FASCIA	Distorted	1,150.40 FL	*936.50 FL
61	2		*REAR BUMPER SIDE ATTACHMENT	Not Necessary	82.80 FL	*- FL
62	2		*REAR BUMPER SIDE RETAINER	Bent / Necessary	53.00 FL	*53.00 FL
63	2		*REAR BUMPER BRACKET	No such part	77.40 FL	*- FL
64	2		*REAR BUMPER REFLECTOR	Not Necessary	90.40 FL	*- FL
65	2		*REAR BUMPER REFLECTOR GARNISH	Twisted	92.20 FL	*92.20 FL
66	1		*REAR BUMPER TOW COVER	Deformed	26.50 FL	*26.50 FL
67	2		*REAR BUMPER SPONGE -RH& LH	Torn	112.00 FL	*112.00 FL
68	10		*REAR BUMPER CLIPS	Necessary	35.00 FL	*35.00 FL
69	1		*REAR END PANEL	Badly Dented	560.20 FL	*560.20 FL
70	1		*REAR END PANEL TOP TRIM	Cracked	155.40 FL	*155.40 FL
71	4		*REAR END PANEL TOP TRIM CLIPS	Not Necessary	14.00 FL	*- FL
72	1		*REAR FENDER -LH	Badly Dented / Buckled	1,010.90 FL	*1,010.90 FL
73	1		*REAR FENDER GLASS MOULDING	Necessary	56.20 FL	*56.20 FL
74	1		*REAR FENDER INNER SEAL	Necessary	31.80 FL	*31.80 FL
75	6		*REAR FENDER CLIPS	Not Necessary	21.00 FL	*- FL
76	1		*REAR FLOOR PANEL	Crumpled / Buckled	956.20 FL	*956.20 FL
77	1		*REAR FLOOR PANEL UNDER MEMBER	Repair	255.40 FL	*- FL
78	1		*REAR FLOOR PANEL BOARD	Warped	655.20 FL	*655.20 FL
79	1		*REAR FLOOR SIDE EXTENTIONAL PANEL -LH &RH	N/S Crumpled	510.80 FL	*255.40 FL
80	1		*REAR FLOOR PANEL INSULATOR CLOTH	Not fitted	291.60 FL	*- FL
81	1		*REAR FLOOR PANEL TOOL TRAY	Distorted	245.20 FL	*245.20 FL
82	2		*REAR FENDER INNER TRIM BOARD -RH & LH	Deformed / Torn	966.40 FL	*966.40 FL
83	1		*REAR FENDER INNER TRIM BOARD -TOP LH	Not Necessary	195.20 FL	*- FL
84	20		*REAR FENDER INNER TRIM BOARD CLIPS	Not Necessary	110.00 FL	*- FL
85	1		*REAR FLOOR PANEL TOOL TRAY COVER	Distorted	650.40 FL	*650.40 FL
86	2		*REAR SUB CHASSIS FRAME MEMBER	Repair	1,710.80 FL	*- FL
87	2		*REAR SUB CHASSIS FRAME MEMBER TOP PANEL	Repair	438.40 FL	*- FL
88	1		*EXHAUST SILENCER	Repair	588.20 FL	*- FL
89	2		*EXHAUST SILENCER HOOK	Not Necessary	58.80 FL	*- FL
90	1		*REAR FENDER AIR VENT -RH & LH	N/S Cracked	90.40 FL	*45.20 FL
91	1		*FRONT NUMBER PLATE }	Bent	45.00 FS	*40.00 FS
92	1		*FRONT NUMBER PLATE CASING }	Bent	29.00 FS	*- FS
93	1		*REAR WINDSCREEN GLASS SEALANT	Necessary	60.00 FS	*40.00 FS
94	1		*REAR WINDSCREEN GLASS SOLAR FILM	Necessary	160.00 FS	*160.00 FS
95	1		*REAR NUMBER PLATE }	Bent	45.00 FS	*40.00 FS
96	1		*REAR NUMBER PLATE CASING }	Bent	29.00 FS	*- FS
97	1		*SET REVERSE SENSOR	Shorted	380.00 FS	*200.00 FS
98	1		*REVERSE CAMERA (I-ROAD)	Shorted	680.00 FS	*350.00 FS
99	1		*REAR FENDER GLASS SEALANT	Necessary	60.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	32,390.80	24,916.40
- List Item Discount on L Items 20.00/20.00% (\$\$)	6,180.56	4,809.28
Total Parts (\$\$)	26,210.24	20,107.12

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING	New	120.00	50.00
2	TO CHECK & RECONNECT SNAP WIRING	New	180.00	30.00
3	TO RESET ELECTRICAL MODULE SYSTEM	New	380.00	50.00
4	TO TUFF COAT AFFECTED AREAS	New	280.00	150.00
5	TO CHECK & ADJUST CHASSIS ALIGNMENT ON CAR O LINER	New	380.00	0.00
6	TO REMOVE & REFIX REAR FENDER GLASS LH & REAR WINDSCREEN GLASS	New	380.00	220.00
7	TO REMOVE & REFIX RADIATOR & TOP UP COOLANT }	New	180.00	100.00
8	TO REMOVE & REFIX AIR COND CONDENSOR & TOP UP GAS }	New	180.00	0.00
9	TO REMOVE & REFIX REVERSE SENSOR	New	120.00	50.00
10	TO REMOVE & REFIX TAIL GATE MECHANISM	New	250.00	60.00
11	TO RESPRAY AFFECTED AREAS	New	3,000.00	1,800.00
12	TO CLEANING INTERIOR UPHOLSTERY	New	250.00	0.00
13	TO RENEW DAMAGES PARTS ,STRAIGHTEN & REPAIR & ALIGNED ALL PARTS	New	2,850.00	2,400.00
14	TO REMOVE & REFIX EXHAUST SILENCER & STRAIGHTEN EXHAUST CENTER PIPE	New	280.00	60.00
Gross Labour Cost (\$)			8,830.00	4,970.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >