

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

# VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way, #09-16  
Singapore 079120

**Our File No:** CC3/AIG20004502/AYF3E2

**Date:** 09/10/2020

### REFERENCE

Insured/Claimant:	LEE BEE LING	Policy No:	2100491866-03	
Date of Loss:	19/03/2020	Nature of Claim:	OD	Claim No: 9919648788SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLJ927G			
Make & Model:	AUDI Q5, 2.0 TFSI Quattro (180BHP) (A)		Engine No:	CNC174517
Reg. Date:	28/11/2016 (Man. Year: 2016)		Chassis No:	WAUZZZ8R7HA028904
Colour:	Grey		Odometer:	87777 km
Engine Capacity:	1984 cc			
Market Value/New Car Price:	S\$110,000.00			
Sum Insured (S\$):	<b>Market Value/New Car Price</b>			

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	235/60 R18	Rear Tyre Size:	235/60 R18
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	26,251.00	12,190.88	14,060.12	53.56
Miscellaneous Items	0.00	0.00	0.00	
Labour	15,912.00	9,082.00	6,830.00	42.92
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>42,163.00</b>	<b>21,272.88</b>	<b>20,890.12</b>	<b>49.55</b>
<b>+ GST 7.00/7.00% (S\$)</b>	2,951.41	1,489.10	1,462.31	49.55
<b>Nett Amount (S\$)</b>	<b>45,114.41</b>	<b>22,761.98</b>	<b>22,352.43</b>	<b>49.55</b>

### INSPECTION

Date of Assignment:	25/03/2020		
Date Inspected:	25/03/2020	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	11.0 days		

**Adjuster:** ADRIAN LING

**Manager:** YVONNE WONG YIN CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*



## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Distorted	1,560.00 FS	*1,248.00 FS
2	1		*REAR BUMPER FIXING PARTS	Not Necessary	156.00 FS	*- FS
3	1		*REAR BUMPER GUIDE SECTION - LH	Damaged	51.00 FS	*40.48 FS
4	1		*REAR BUMPER SPOILER	Deformed	815.00 FS	*651.60 FS
5	1		*REAR BUMPER TAIL LIGHT - LH	Cracked	282.00 FS	*225.20 FS
6	1		*TAIL LIGHT - LH	Not Necessary	1,371.00 FS	*- FS
7	1		*TAIL LIGHT COVER - LH	Not Necessary	46.00 FS	*- FS
8	1		*REAR BUMPER CARRIER	Bent	617.00 FS	*493.20 FS
9	2		*REAR BUMPER BRACKET HOLDER - LH / RH	Not Necessary	404.00 FS	*- FS
10	2		*REAR PARKING AID SENSOR - INNER / OUTER (NPA)	Not Necessary	0.00 FS	*- FS
11	1		*SET REAR BUMPER WIRING	Not Necessary	544.00 FS	*- FS
12	1		*REAR LID	Dented	4,046.00 FS	*3,236.80 FS
13	1		*REAR LID ATTACHMENT PARTS	Not Necessary	117.00 FS	*- FS
14	2		*REAR LID HINGE - LH / RH	Dented	432.00 FS	*172.40 FS
15	2		*REAR LID GAS FILLED STRUT	Not Necessary	224.00 FS	*- FS
16	1		*REAR LID FLAP GASKET	Not Necessary	193.00 FS	*- FS
17	1		*REAR LID LOCK	Not Necessary	167.00 FS	*- FS
18	1		*LID LOCK PUSH BUTTON	Not Necessary	170.00 FS	*- FS
19	1		*REAR LID STRIKER PLATE	Not Necessary	834.00 FS	*- FS
20	1		*REAR LID DRIVE UNIT - LH	Not Necessary	1,885.00 FS	*- FS
21	1		*REAR LID DECORATIVE TRIM	Necessary	410.00 FS	*328.00 FS
22	1		*SPOILER FIXING PARTS	Not Necessary	156.00 FS	*- FS
23	1		*PACKING ADHESIVE	Necessary	18.00 FS	*14.24 FS
24	1		*AUDI EMBLEM	Necessary	117.00 FS	*93.20 FS
25	1		*Q5 INSCRIPTION	Necessary	90.00 FS	*71.76 FS
26	1		*TFSI INSCRIPTION	Necessary	90.00 FS	*71.76 FS
27	1		*QUATTRO INSCRIPTION	Necessary	90.00 FS	*71.76 FS
28	1		*REAR WINDSCREEN	Necessary	1,066.00 FS	*852.80 FS
29	1		*PRIMER	Necessary	19.00 FS	*14.80 FS
30	1		*REAR CROSS PANEL	Not Necessary	480.00 FS	*- FS
31	1		*LOCK CARRIER REINFORCEMENT	Not Necessary	1,048.00 FS	*- FS
32	1		*CORNER REINFORCEMENT - LH	Not Necessary	68.00 FS	*- FS
33	1		*REAR CROSS PANEL TRIM	Not Necessary	323.00 FS	*- FS
34	1		*REAR SILENCER - LH	Bent	928.00 FS	*742.40 FS
35	1		*REAR SILENCER DUAL CLIP	Necessary	53.00 FS	*41.92 FS
36	1		*REAR SILENCER BRACKET - LH / RH (2PCS)	Bent (1Pc Only)	108.00 FS	*42.80 FS
37	1		*REAR SILENCER - RH	Not Necessary	928.00 FS	*- FS
38	1		*REAR SILENCER DUAL CLIP	Not Necessary	53.00 FS	*- FS
39	2		*REAR SILENCER BRACKET - LH / RH	Not Necessary	108.00 FS	*- FS
40	1		*CENTRE SILENCER	Bent	920.00 FS	*736.00 FS
41	1		*CENTRE SILENCER DUAL CLIP	Necessary	57.00 FS	*44.96 FS
42	1		*CENTRE SILENCER BRACKET - LH / RH FRONT (2PCS)	Bent (1Pc Only)	84.00 FS	*33.28 FS
43	2		*REAR SILENCER HEAT SHIELD - LH / RH	Not Necessary	292.00 FS	*- FS
44	1		*CENTRE SILENCER HEAT SHIELD	Not Necessary	222.00 FS	*- FS
45	1		*WHEEL HOUSING LINER - LH REAR	Necessary	248.00 FS	*198.40 FS
46	1		*REAR NO PLATE	Not Necessary	60.00 FS	*- FS
47	1		*REAR WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
48	1		*ACRYLIC SEALANT	Not Necessary	180.00 FS	*- FS
49	1		*CAVITY WAX	Not Necessary	140.00 FS	*- FS
50	1		*STONE CHIP	Not Necessary	180.00 FS	*- FS
51	1		*SUNDRIES	Necessary	400.00 FS	*88.32 FS
52	1		*REAR SUBFRAME	Bent	3,096.00 FS	*2,476.80 FS
53	2		*CENTRE SILENCER DUAL CLIP	Not Necessary	105.00 FS	*- FS
F=Franchise part. S=SpcNett.						
				<b>Total Parts (S\$)</b>	<b>26,251.00</b>	<b>12,190.88</b>

Report was unsubmitted during this print-out.
---

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION	New	280.00	280.00
2	TO REMOVE AND TRANSFER REAR LIDS CONVENIENCE LOCK SYSTEM WIRE HARNESS FOR TAIL LIGHTS AND REAR WIPER ASSY	New	480.00	480.00
3	TO RENEW REAR WINDSCREEN	New	480.00	480.00
4	TO INSTALL SOLAR FILM FOR REAR WINDSCREEN	New	400.00	400.00
5	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGES AND RENEW WHERE NECESSARY	New	480.00	0.00
6	TO DISMANTLE AND RENEW REAR BUMPER AND REAR LID. TO CUT OUT AND WELD END PANELLING. RE-ORGANISE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	4,800.00	1,500.00
7	TO RESPRAY REAR BUMPER, REAR LOWER SPOILER, REAR LID, HINGES, REAR END PANELLING AND SPARE WHEEL HOUSING	New	5,000.00	1,950.00
8	TO RENEW BOTH REAR EXHAUST SILENCER AND CENTRE SILENCER. TO ALIGN TO POSITION	New	480.00	480.00
9	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
10	TO REMOVE AND REINSTALL EXHAUST SYSTEM AND REAR SUSPENSION ASSEMBLY, INCLUDING REAR AXLE AND PROPELLOR SHAFT. RENEW ACCORDINGLY	New	2,800.00	2,800.00
11	TO DISLODGE REAR ROOF PANEL TRIM TO FACILITATE REAR LID RENEWAL	New	280.00	280.00
12	TO CARRY OUT WHEEL ALIGNMENT	New	240.00	240.00
<b>Gross Labour Cost (\$)</b>			<b>15,912.00</b>	<b>9,082.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >