

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG20004521/EQF3E2

Date: 11/09/2020

REFERENCE

Insured/Claimant:	ANG SOH YONG (HONG SURONG)	Policy No:	2000001479
Date of Loss:	04/02/2020	Nature of Claim:	OD Claim No: 1652396234SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKU9282C	Engine No:	CZD886148
Make & Model:	AUDI Q3, 1.4 TFSI (A)	Chassis No:	WAUZZZF31L1010356
Reg. Date:	10/01/2020 (Man. Year: 2019)	Odometer:	5509 km
Colour:	Silver		
Engine Capacity:	1395 cc		
Market Value/New Car Price:	S\$140,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	235/55 R18	Rear Tyre Size:	235/55 R18
Front Left Side:	Michelin 5 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	Michelin 5 mm	Rear Right Side:	Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	17,470.00	5,551.00	11,919.00	68.23
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,472.00	2,772.00	3,700.00	57.17
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	23,942.00	8,323.00	15,619.00	65.24
- Excess (S\$)	400.00	400.00	0.00	0.00
(S\$)	23,542.00	7,923.00	15,619.00	66.35
+ GST 7.00/7.00% (S\$)	1,647.94	554.61	1,093.33	66.35
Nett Amount (S\$)	25,189.94	8,477.61	16,712.33	66.35

INSPECTION

Date of Assignment:	26/03/2020	
Date Inspected:	25/03/2020	Inspected At: 281 ALEXANDRA ROAD
		Repairer : Premium Automobiles Pte Ltd
Estimated Period of Repair:	5.0 days	

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

(REPAIR COST NOT CONCLUDE)

(EXCLUDE CHECK ITEMS S\$8,149.00 NETT)

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Repair	1,946.00 FS	*- FS
2	2		*FRONT BUMPER CLOSING ELEMENT - LH / RH	Not Necessary	110.00 FS	*- FS
3	1		*FRONT BUMPER GRILLE - CENTRE	Not Necessary	204.00 FS	*- FS
4	1		*FRONT BUMPER FRONT SPOILER	Not Necessary	361.00 FS	*- FS
5	2		*FRONT BUMPER GRILLE - LH / RH	Not Necessary	208.00 FS	*- FS
6	2		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	Not Necessary	288.00 FS	*- FS
7	1		*RADIATOR GRILLE	Broken	1,349.00 FS	*1,349.00 FS
8	1		*RADIATOR GRILLE STRIKER PLATE	* Check	230.00 FS	*- FS
9	1		*RADIATOR GRILLE COVER CAP	Not Necessary	42.00 FS	*- FS
10	1		*RADIATOR GRILLE BRACKET	* Check	39.00 FS	*- FS
11	1		*FRONT CAMERA	* Check	1,098.00 FS	*- FS
12	1		*RADIATOR GRILLE SECURING PLATE	* Check	31.00 FS	*- FS
13	1		*FRONT BUMPER FOAM FILLER PIECE	* Check	96.00 FS	*- FS
14	1		*FRONT BUMPER CARRIER	* Check	793.00 FS	*- FS
15	1		*FRONT BUMPER COVER	Crushed	116.00 FS	*116.00 FS
16	1		*CAUTION SIGN STICKER	* Check	13.00 FS	*- FS
17	1		*AIRCON STICKER	* Check	7.00 FS	*- FS
18	2		*FRONT PARKING AID SENSOR (NPA)	Not Necessary	0.00 FS	*- FS
19	2		*FRONT WHEEL COVER - LH / RH	Necessary	506.00 FS	*506.00 FS
20	1		*LED HEADLIGHT - LH	* Check	5,263.00 FS	*- FS
21	1		*BONNET	Dented	3,305.00 FS	*3,305.00 FS
22	1		*BONNET ATTACHMENT PARTS	* Check	279.00 FS	*- FS
23	1		*BONNET IMPACT PROTECTION - CENTRE	Crushed	26.00 FS	*26.00 FS
24	2		*BONNET STRIKER - LH / RH	Not Necessary	208.00 FS	*- FS
25	2		*BONNET LID LOCK	Not Necessary	403.00 FS	*- FS
26	1		*FRONT NO PLATE	Bent	40.00 FS	*40.00 FS
27	1		*SUNDRIES	* Check	300.00 FS	*- FS
28	1		*HEADLIGHT MOUNTING LHS	Cracked	112.00 FS	*112.00 FS
29	1		*RADIATOR AIR GUIDE LHS	Cracked	36.00 FS	*36.00 FS
30	1		*HEADLIGHT SEALING FRAME LHS	Cut	61.00 FS	*61.00 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) **17,470.00** **5,551.00**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO DISMANTLE AND RENEW FRONT BUMPER ASSY, BONNET AND LHS HEADLIGHT. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	2,800.00	1,000.00
3	TO RESPRAY FRONT BUMPER AND BONNET	New	2,700.00	1,100.00
4	TO CARRY OUT DIAGNOSTIC CHECKS	New	192.00	192.00
5	TO REAPPLY PAINT COATING ON AFFECTED AREA (BY OWNER)	New	300.00	0.00
Gross Labour Cost (\$\$)			6,472.00	2,772.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >