

(08/11/13) wef
ASS. REC. BY: Marcus

REF:

CS/CT120004634/4yf3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: GBH 6367L

at Workshop m/s SME

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 852k.

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 2 days Res.: Yes or No

Lum Sum: 1.7k % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

off N

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: GBH 6367L Yr Regn: 8 118

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (M)

Make: Toyota Dyna c.c. 2982

Colour: Silver A/C: Insured / Std / NI / NA

Sp. Reading: 42570 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTFAT35420K211109

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195 R15

R: 155 R12 85

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 7 mm

R/Bal. 7/7 mm

L/Bal. 7 mm

L/Bal. 7/7 mm

D.O.A. 26/3/20

D.O.I. 30/6/20

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

by O/S.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

27/7/20 27A13061 handy 1034.10
confirmed final fig #1225.38 with AH ying.

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS SI

Photos

Others

TOTAL

Report Format : _____

Lump Sum / I.B.I.: (\$ _____)

SME Motor Pte Ltd

1 Kaki Bukit Ave 6, #02-15 Autobay@KakiBukit Singapore 417883
TEL: 67476106 (6 lines) FAX: 67442368 Email: service@smemotor.com.sg
GST:201119451E RCB NO:201119451E

M/S: CHINA TAIPING INSURANCE (SINGAPORE) PTE
3 ANSON ROAD #16-00
SPRINGLEAFT TOWER
Singapore 079909
TEL: 63896111 FAX: 62247478
ATTN: Motor Claim Department
Your Ref No: 20/CN/TP-052(03)
Claim Type: Third Party
Accident Date: 26/03/2020
TP Veh Reg No: GBJ4936Y

Estimate No: EST0005400
Date: 27 Mar 2020
Policy No: DMCPHQ19-003828
Veh Reg No: GBH6367L
Make/Model: TOYOTA DYNA
Chasis No: 0
Engine No:
Reg. Date:

Estimate Repair Cost to Vehicle No :GBH6367L

Description	Quantity	List Price	Amount
		SS	SS
List Price			
1 RH HEADLAMP	1 PC	1,000.50	✓
		1,000.50	
	Less 25%	250.13	750.38
Special Net			
2 FRT RH DOOR COMPANY STICKER	1 PC	25.00	✓
		25.00	25.00
Labour			
3 WIRE CHECKING	1 UNIT	30.00	20
4 LABOUR CHARGE	1 UNIT	300.00	150
5 SPRAY PAINTING	1 UNIT	350.00	280
		680.00	680.00
		Total	SS 1,455.38
		Add GST @ 7%	101.88
		Total Amount Payable	SS 1,557.26

TOTAL: SINGAPORE DOLLAR ONE THOUSAND FIVE HUNDRED FIFTY SEVEN AND CENTS TWENTY SIX ONLY

For SME Motor Pte Ltd

not Authorised
2 hrs

Whole ph. After repair
2 days.
30/6/20
P/L \$ 1225.38

AUTHORISED SIGNATURE
LKR Auto Consultants hence notify
the Repairer of the following:
• To resurvey before/after spray painting
• To display damaged part(s) during resurvey
• Parts prices are subject to confirmation
• Third party survey is on a "Without Prejudice" basis
• No illegal modification(s) is allowed
• Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: