



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD  
36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2005330  
INV Date 30/07/2020  
Reference CC4/FCI20004770/Gps3q2  
Code FCI2



#### PROFESSIONAL SERVICE FEE

Vehicle No. GY 9999U  
Insured Veh. SHD 3287D  
Claim No. D20001713MFSH/1  
Policy No. D-20094922MFSH  
Accident Date 27/03/2020  
Inspection Date 01/04/2020

Description	Total
Third Party Express Settlement	600.00
<b>Subtotal</b>	<b>600.00</b>
<b>GST (7%)</b>	<b>42.00</b>
<b>Grand Total</b>	<b>642.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20004770/Gps3q2

36 ROBINSON ROAD  
#16-01 CITY HOUSESINGAPORE 068877

Date : 30-07-2020



Code : FCI2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SHD 3287D	<b>Veh. Inspected</b>	GY 9999U
<b>Policy No.</b>	D-20094922MFSH	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	D20001713MFSH/1	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	Heng Ding Chao	<b>Assign Date</b>	01/04/2020

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	OPEL COMBO	<b>c.c</b>	1686
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2006
<b>Chassis No.</b>	W0L0XCF2563069184	<b>Colour</b>	RED
<b>Odometer</b>	231576	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	NIL
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	185/65 R15	ROADSTONE	5 mm
<b>L/H Front Tyre</b>	185/65 R15	ROADSTONE	5 mm
<b>R/H Rear Tyre</b>	185/65 R15	ROADSTONE	5 mm
<b>L/H Rear Tyre</b>	185/65 R15	ROADSTONE	5 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION. DAMAGES SEE DETAILS.
--

### 5. General Information

<b>Accident Date</b>	27/03/2020	<b>Inspection Date</b>	01/04/2020
<b>Survey held at</b>	VFIX AUTO SERVICE PTE LTD 26 CHIA PING ROAD SINGAPORE 619977		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	<b>7 Working Days</b>
-------------------------------------	-----------------------



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GY 9999U

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	BONNET	BUCKLED	1,280.00	1,280.00
1	BONNET LOCK	BENT	255.00	255.00
1	BONNET INSULATOR	DEFORMED	520.00	520.00
2	BONNET HINGE @\$180.00	BENT	360.00	360.00
1	FRONT BUMPER	DEFORMED	970.00	970.00
2	FRONT BUMPER PAD	CUT	270.00	270.00
1	FRONT BUMPER CENTER LOWER GRILLE	DEFORMED	265.00	265.00
1	FRONT BUMPER UPPER GRILLE (CHROME)	CRACKED	485.00	485.00
2	FRONT BUMPER FOG LAMP GARNISH @\$220.00	DEFORMED	440.00	440.00
2	FRONT BUMPER LOWER GARNISH @\$220.00	NOT NECESSARY	440.00	-
2	FRONT BUMPER SIDE RETAINER @\$88.00	DEFORMED	176.00	176.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	650.00	-
2	FRONT FENDER @\$680.00	TO REPAIR SEE LABOUR	1,360.00	-
2	FRONT FENDER PROTECTOR @\$158.00	DEFORMED	316.00	316.00
2	FRONT FENDER INNER COWLING @\$450.00	TORN (1 PCS ONLY)	900.00	450.00
2	FRONT HEADLAMP @\$395.00	CRACKED	790.00	790.00
1	FRONT BUMPER TOWING COVER	NOT NECESSARY	56.00	-
2	HEADLAMP LOWER BRACKET @\$85.00	NOT NECESSARY	170.00	-
1	RADIATOR SUPPORT PANEL (COMPLETE)	BENT	750.00	750.00
1	AIR CLEANER	NOT NECESSARY	480.00	-
1	CONDENSER	BENT	560.00	560.00
1	AIRCOND PIPE	NOT NECESSARY	196.00	-
1	AIRCOND SUCTION HOSE	NOT NECESSARY	224.00	-
1	AIRCOND DISCHARGE HOSE	NOT NECESSARY	210.00	-
1	RADIATOR	BENT	986.00	986.00
1	RADIATOR FAN COWLING	CUT	265.00	265.00
1	RADIATOR FAN BLADE	JAMMED	67.00	67.00
2	TAILGATE @\$1850.00	BUCKLED	3,700.00	3,700.00
4	TAILGATE HINGE @\$216.00	NOT NECESSARY	864.00	-

Report Ref No. CC4/FCI20004770/Gps3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
4	TAILGATE CHECKER @\$85.00	NOT NECESSARY	340.00	-
1	TAILGATE INNER LOCK UPPER	NOT NECESSARY	379.00	-
1	TAILGATE INNER LOCK BOTTOM	NOT NECESSARY	379.00	-
1	TAILGATE OUTER GARNISH	NOT NECESSARY	159.00	-
2	TAILGATE WEATHERSTRIP @\$220.00	TORN	440.00	440.00
2	TAILGATE WINDSCREEN MOULDING @\$250.00	NECESSARY	500.00	500.00
1	REAR BUMPER	DEFORMED	1,420.00	1,420.00
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	550.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	780.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	255.00	-
2	REAR EXHAUST PIPE @\$655.00	NOT NECESSARY	1,310.00	-
2	TAILLAMP @\$320.00	NOT NECESSARY	640.00	-
	LESS 10% DISCOUNT		-2,515.70	-1,526.50
			22,641.30	13,738.50
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT NUMBER PLATE (SN)	BENT	60.00	40.00
1	REAR NUMBER PLATE (SN)	BENT	60.00	40.00
2	TAILGATE WINDSCREEN SEALANT @\$50.00(SN)	NECESSARY	100.00	40.00
1	REAR END PANEL INSULATOR SEALANT (SN)	NOT NECESSARY	150.00	-
1	RADIATOR COOLANT (SN)	NECESSARY	40.00	40.00
1	TAILGATE STICKER 70KM/H (SN)	NECESSARY	40.00	10.00
1	TAILGATE 4 PAX (SN)	NECESSARY	40.00	10.00
			490.00	180.00
	<b><u>LABOUR</u></b>			
	TO REMOVE DAMAGED BODY PANEL WITH ALL NECESSARY COMPONENTS /ATTACHMENTS APPLY HOT-WORKS WHERE NECESSARY STRAIGHTEN FRONT DOOR ,PILLAR ,REPAIR /RESHAPE BODY DENTED PANELS IN ACCORDANCE WITH FACTORY SPECIFICATIONS REPLACE NEW PARTS REFIT AND ALIGN INTO POSITION REFIT ALL NECESSARY COMPONENTS /ATTACHMENTS.INCLUSIVE OF THE REPAIR OF FRONT FENDER AND REAR END PANEL .		2,500.00	1,000.00

Report Ref No. CC4/FCI20004770/Gps3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINT REPLACED /REPAIRED BODY PANELS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS.	NOT NECESSARY	2,300.00	1,600.00
	REMOVE & REFIT BOTH TAILGATE REAR WINDSCREEN.		160.00	80.00
	REMOVE & REFIT TAILGATE .		90.00	60.00
	REMOVE & REFIT CARPET ,SEAT AND INTERIOR.		160.00	60.00
	REMOVE & REFIT EXHAUST .		150.00	-
	REMOVE & REFIT AIRCOND SYSTEM.		120.00	100.00
	REMOVE & REFIT WIRING CHECK .		120.00	30.00
			5,600.00	2,930.00
<b>GRAND TOTAL</b>			<b>28,731.30</b>	<b>16,848.50</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>2,000.00</b>

Report Ref No. CC4/FCI20004770/Gps3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GY 9999U

INSPECTION








## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

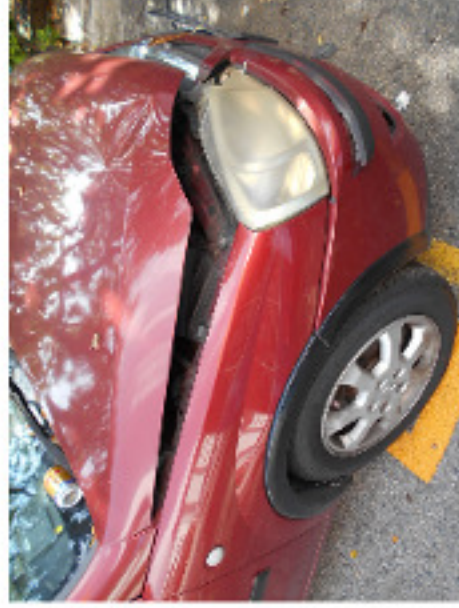





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GY 9999U

RE-INSPECTION

