



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2005196
INV Date 27/07/2020
Reference CC3/FCI20004773/Kga3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SHF 518Y
Insured Veh. SH 8037X
Claim No. D20001729MFSH
Policy No. D-18088936MFSH
Accident Date 29/03/2020
Inspection Date 31/03/2020

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC3/FCI20004773/Kga3q2

36 ROBINSON ROAD
#16-01 CITY HOUSES SINGAPORE 068877

Date : 27-07-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SH 8037X	Veh. Inspected	SHF 518Y
Policy No.	D-18088936MFSH	Coverage (\$)	0.00
Claim No.	D20001729MFSH	Excess (\$)	0.00
Assign From		Assign Date	31/03/2020

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	VF1ABL15AUC278263	Colour	METALLIC WHITE / RED
Odometer	509433	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	SAILUN	9 mm
L/H Front Tyre	215/60 R16	SAILUN	9 mm
R/H Rear Tyre	215/60 R16	SAILUN	7 mm
L/H Rear Tyre	215/60 R16	SAILUN	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	29/03/2020	Inspection Date	31/03/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 518Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	MTG CRACKED	747.20	747.20
1	BUMPER SPOILER FRT	SERVICEABLE	344.70	-
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER RETAINER FRT LH	DISTORTED	101.40	101.40
1	BUMPER SUPPORT FRT	SERVICEABLE	10.70	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	292.50	-
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	147.00	-
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT	TO REPAIR SEE LABOUR	663.70	-
1	HEADLAMP LH	MTG CRACKED	743.60	743.60
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	127.70	-
1	FENDER PANEL FRT LH	BENT	414.40	414.40
1	WHEELARCH FRT LH	SERVICEABLE	112.30	-
1	FENDER BRACKET FRT LH	SERVICEABLE	38.90	-
1	FENDER BRACKET LOWER LH	SERVICEABLE	11.80	-
1	FENDER INSULATOR LH	SERVICEABLE	65.50	-
1	FRONT BRACE PANEL	TO REPAIR SEE LABOUR	177.22	-
1	BONNET	TO REPAIR SEE LABOUR	1,312.70	-
1	BONNET INSULATOR	SERVICEABLE	294.30	-
1	BONNET STRUT LH	SERVICEABLE	53.30	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	236.50	-
1	BONNET LOCK	TO REPAIR SEE LABOUR	152.80	-
1	RADIATOR GRILLE	MTG CRACKED	969.90	969.90
1	RADIATOR GRILLE BADGE 'RENAULT'	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME	CRACKED	686.00	686.00
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	592.70	-

Report Ref No. CC3/FCI20004773/Kga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	41.60	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	AIR CLEANER HOSE	SERVICEABLE	175.85	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-
1	ROCKER PANEL INNER GARNISH LH	SERVICEABLE	466.51	-
1	ROCKER PANEL INNER LH	TO REPAIR SEE LABOUR	1,024.79	-
1	ROCKER PANEL OUTER LH	TO REPAIR SEE LABOUR	1,184.99	-
1	AUTO COMPUTER	SERVICEABLE	1,287.30	-
1	INJECTION COMPUTER	SERVICEABLE	2,706.30	-
1	RHD HYDRAULIC POWER (RACK & PINION)	SERVICEABLE	3,765.30	-
1	STEERING PUMP ELECTRIC L70Y	SERVICEABLE	2,026.70	-
1	A/C CONDENSER	SERVICEABLE	1,537.80	-
1	SUBFRAME OUTER FRT	SERVICEABLE	1,094.20	-
1	SUBFRAME BRACKET OUTER LH	TO REPAIR SEE LABOUR	49.00	-
1	SUBFRAME BRACKET OUTER RH	TO REPAIR SEE LABOUR	49.00	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	274.50	-
1	DOOR HINGE LOWER LH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK FRONT LH	SERVICEABLE	90.90	-
1	DOOR MIRROR ASSY LH	SERVICEABLE	727.90	-
1	DOOR HARNESS WIRE LH	SERVICEABLE	2,670.00	-
1	DOOR REGULATOR FRT LH	SERVICEABLE	758.10	-
1	DOOR REGULATOR MOTOR FRT LH	SERVICEABLE	501.40	-
1	DOOR REGULATOR GUIDE FRT LH	SERVICEABLE	69.00	-
	LESS 10% DISCOUNT		-3,350.59	-388.79
			30,155.29	3,499.07

Report Ref No. CC3/FCI20004773/Kga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	BUMPER CLIP FRT (SN)	NECESSARY	66.00	66.00
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	WHEELARCH CLIP FRT LH (SN)	NOT NECESSARY	30.50	-
1	FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
1	SET FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	16.00	-
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	52.00	-
1	FRONT LEFT TYRE (SN)	SERVICEABLE	330.00	-
1	FRONT LEFT TYRE RIM (SN)	SERVICEABLE	380.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	80.00	-
1	FRONT DOOR STICKER 'TRANS-CAB' (SN)	NOT NECESSARY	80.00	-
1	FRONT DOOR STICKER 'CLASSIC' (SN)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	160.00	-
2	FRONT WINDSCREEN SEALANT (SN)	NOT NECESSARY	120.00	-
1	FRONT WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
			1,706.00	66.00
	<u>LABOUR</u>			
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BUMPER BEAM FRT,HEADLAMP PANEL FRT LH,FRONT BRACE PANEL,BONNET,BONNET HINGE LH,BONNET LOCK,FRAME FULL SUPPORT BRACKET,ROCKER PANEL INNER LH, }		6,500.00	500.00
	ROCKER PANEL OUTER LH,SUBFRAME BRACKET OUTER LH,SUBFRAME BRACKET OUTER RH,DOOR PANEL FRT LH,DOOR HINGE UPPER LH AND DOOR HINGE LOWER LH. }		-	-
	TO TRANSFER OF FRONT BUMPER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-

Report Ref No. CC3/FCI20004773/Kga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO TRANSFER OF FRONT FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH ,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO TRANSFER OF BONNET FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		6,500.00	440.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO TRANSFER OF DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO DISMANTLE AND REFIT AIRCON ASSY AND ATTACHMENT ,VACUUM AND CHARGE-IN -GAS.	NOT NECESSARY	380.00	-
	TO REMOVE AND REFIT FRONT W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	TOWING FEES.		150.00	50.00
			15,870.00	1,040.00
GRAND TOTAL			47,731.29	4,605.07

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			3,700.00
---	--	--	-----------------

Report Ref No. CC3/FCI20004773/Kga3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHF 518Y

INSPECTION





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

