



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 7462G

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	TAIL GATE	TO REPAIR SEE LABOUR	1,740.60	-
1	TAIL GATE WEATHERSTRIP	NOT NECESSARY	238.10	-
1	TAILGATE BADGE - LOGO	DAMAGED	62.40	62.40
1	TAIL GATE "TIVOLI" EMBLEM	DAMAGED	68.40	68.40
1	TAIL GATE "SSANGYONG" EMBLEM	DAMAGED	60.10	60.10
1	TAIL GATE GLASS INNER SEAL	NOT NECESSARY	55.80	-
1	TAIL GATE GLASS CLIPS	NOT NECESSARY	84.00	-
1	N/S TAIL LAMP	CHAFED / CRACKED	430.00	430.00
1	N/S TAIL LAMP SEALANT	NECESSARY	36.00	36.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	635.10	-
1	REAR BUMPER FASCIA	BADLY DENTED	770.92	770.92
1	REAR BUMPER LOWER DIFFUSER	CHAFED / DISTORTED	310.60	310.60
1	REAR BUMPER TOW COVER	DAMAGED	52.10	52.10
1	REAR BUMPER N/S LOWER SIDE GARNISH	DAMAGED	175.00	175.00
1	REAR BUMPER N/S REFLECTOR	FRACTURED	27.80	27.80
8	REAR BUMPER CLIPS	NECESSARY	48.00	48.00
1	REAR BUMPER REINFORCEMENT	DENTED / BENT	285.40	285.40
2	REAR BUMPER REINFORCEMENT BRACKET	N/S BENT	190.00	95.00
1	REAR BUMPER N/S TOP BRACKET	DAMAGED	85.00	85.00
1	REAR BUMPER N/S SIDE RETAINER	DAMAGED	38.10	38.10
1	THIRD BRAKE LIGHT	NOT NECESSARY	140.00	-
1	THIRD BRAKE LIGHT WIRE HARNESS	NOT NECESSARY	190.00	-
	LESS 10% DISCOUNT		-572.34	-254.48
			5,151.08	2,290.34
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	60.00	-
			60.00	-



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	TO REMOVE / REFIT TAIL GATE GLASS TO ASSIST REPAIRS.	NOT NECESSARY	180.00	-
	TO REMOVE / REFIT LUGGAGE TRIMS & GARNISH TO ASSIST REPAIRS.		150.00	80.00
	LABOUR CHARGES TO REPAIR, PANEL BEAT AND STRAIGHTEN DAMAGED PARTS AND REPLACE THE ABOVE-MENTIONED PARTS. INCLUSIVE OF THE REPAIR OF TAIL GATE AND REAR END PANEL.		1,100.00	600.00
	TO CHECK WIRING FUNCTIONS.		50.00	30.00
	TO PUTTY, APPLY PRIMER & SPRAY-PAINT THE AFFECTED AREAS.		1,100.00	700.00
	TO APPLY RUST-PROOFING ON REPAIRED / REPLACED PANELS.		180.00	60.00
			2,760.00	1,470.00
	<b>GRAND TOTAL</b>		<b>7,971.08</b>	<b>3,760.34</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>3,000.00</b>

Report Ref No. CS1/LAW20004941/Aqf3s2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.