


ASS. FILE BY: bnl. REF: CS3/II 20005078/619f3

ASSIGNMENT

From _____ Date _____
 Estimated Cost: _____
 OD TB / WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No: _____
 at Workshop m/s T & S Motor.
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: **The veh had commenced its repair at the time of inspection.**

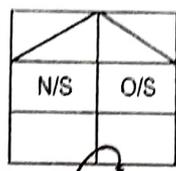

Bal. or Market Value: \$48K.
 IDAC Accident Rport: _____ Consistent? : **Yes** or No
 GIA / PR Seen: _____ Consistent? : **Yes** or No
 Est. Repairs: 4 days Res.: **Yes** or No
 Lum Sum: 20 % 3 Val.: **Yes** or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLC57926 (r Regn: 15 Sep 2009)
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Toyota wsh 1.8Xc 1797
 Colour: silver A/C: **Insured / Std / NI / NA**
 Sp. Reading: 249866 T/Radio: **Insured / Std / NI / NA**
 Eng/No: _____
 C/No: 26E 200001461
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or _____
 Brake: In order / Jammed / Leaked / Burnt or _____
 Modl: **Nil / S/Rim / STD / R/Rim** or _____
 Tyre Size: F: 205/55R16
 R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or CST

Front		Rear
R/Bal. <u>5</u> mm		R/Bal. <u>5</u> mm
L/Bal. <u>5</u> mm		L/Bal. <u>5</u> mm
D.O.A. _____		D.O.I. <u>08-04-20</u>

*Survey held at W/S 3:30pm

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or _____

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>cot: 35780</u>
<u>08/4</u>	<u>Finalized \$1400 with Mei Hua.</u>

Date/Time, File Pass to? : **Prel. Report**

1) : **Final Report**

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: : Site Insp (\$ _____)

Survey Fee: _____

Transportation: _____

3 + RS. \$ _____

Date :08/04/2020

97629883 mes lma.

India International Insurance Pte Ltd
 64 Cecil Street
 #04/06-00 IOB Building
 Singapore 049711

573.2

20% (11400)

Re: Estimated repair cost of Toyota Wish SLC5792G accident on 07/04/2020
 involved with SHD3135J.

1 pc	Tailgate	X repair		\$	1,272.40	
1 pc	Tailgate glass moulding	X NN		\$	180.00	
1 pc	Tailgate logo emblem	X		\$	72.90	
1 pc	Tailgate inner trim	X		\$	345.20	
1 pc	Tailgate lock	X		\$	470.40	
1 pc	Tailgate weatherstrip	X		\$	322.30	
1 pc	Rear bumper	X		\$	500.30	
2 pcs	Rear bumper reflector @ \$57.60	X		\$	115.20	
2 pcs	Rear bumper side retainer LH & RH @ \$60.80	X		\$	121.60	
2 pcs	Rear bumper impact bracket LH & RH @ \$89.80	X		\$	179.60	
1 pc	Rear end panel	X repair		\$	468.50	
1 pc	Tailgate glass sealant	X		\$	80.00	
1 pc	Tailgate glass inner seal	X		\$	40.00	
1 pc	Panel joint sealant	X		\$	60.00	
1 set	Tailgate inner trim clip	X		\$	60.00	
1 set	Rear bumper clips	X		\$	60.00	
1 set	Reverse sensor	X		\$	250.00	30 (SN)
				\$	4,578.40	200 (SN)
	Labour charge for remove, replace and refit accident dented parts and panel beat accident dented parts.			\$	900.00	4000
	Labour to remove & refit rear trimmings, etc			\$	150.00	60
	Labour to replace & refit reverse sensor			\$	100.00	400
	Labour to replace & refit tailgate glass			\$	200.00	X NN
	Spray painting on accident affected areas.			\$	900.00	600
	To apply rustproof treatment to the replaced/repared parts.			\$	150.00	X NN
	To conduct wiring check			\$	100.00	X NN
	TOTAL:			\$	7,078.40	1100

4 Days.
 Imp Sum repair.
 After repair photos.
 Guo Qiang - 82880282
 08/4/2020.

1759.9
 20% (1400)

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date: