

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20005083/ETF3E2
Date: 24/04/2020

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	0999993850
Claimant Vehicle No :	PA8930T	Insured Vehicle No :	GP558R
Date of Loss:	03/04/2020	Nature of Claim:	TP
		Claim No:	8724365484SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	PA8930T	Engine No:	1KD1836510
Make & Model:	TOYOTA HIACE, 3.0 D DX (A)	Chassis No:	KDH2010027250
Reg. Date:	09/09/2009 (Man. Year: 2008)	Odometer:	215000 km
Colour:	Silver		
Engine Capacity:	2982 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195 R15C	Rear Tyre Size:	195 R15C
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	07/04/2020	
Date Inspected:	08/04/2020	Inspected At: Sincerelead Garage Pte Ltd - Buroh (HQ) 2 Buroh Crescent, #02-09 Ace@Buroh Singapore 627546
Estimated Period of Repair:	12.0 days	

Adjuster: CHEN TSUE YEE

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT NUMBER PLATE	Broken	0.00 F	*- F
2	1		*FRT NUMBER PLATE BASE	Broken	0.00 F	*- F
3	1		*FRT BUMPER	Broken	0.00 F	*- F
4	1		*FRT BUMPER LOWER (GRILLE)	Broken	0.00 F	*- F
5	1		*FRT BUMPER BRACKET	Broken	0.00 F	*- F
6	2		*FRT BUMPER REINFORCEMENT	Dented	0.00 F	*- F
7	1		*FRT LH BUMPER FOG LAMP COVER	Cut	0.00 F	*- F
8	2		*FRT GRILLE	Broken	0.00 F	*- F
9	1		*FRT GRILLE EMBLEM	Necessary	0.00 F	*- F
10	1		*FRT PANEL	Dented	0.00 F	*- F
11	1		*FRT CORNER PANEL (LH)	Dented	0.00 F	*- F
12	1		*FRT SIGNAL LAMP LH	Dented	0.00 F	*- F
13	1		*FRT LH HEADLAMP ASSY	Broken	0.00 F	*- F
14	1		*FRT WINDSCREEN	Broken	0.00 F	*- F
15	1		*FRT WINDSCREEN SEALANT	Necessary	0.00 F	*- F
16	1		*ERP BRACKET	Necessary	0.00 F	*- F
17	1		*FRT SIDE MIRROR (BIG)	Broken	0.00 F	*- F
18	1		*FRT SUPPORT PANEL	Dented	0.00 F	*- F
19	1		*FRONT PANEL HINGE	Dented	0.00 F	*- F
20	1		*AIR CON CONDENSER	Dented	0.00 F	*- F
21	2		*RADIATOR (CENTRE & LH)	Dented	0.00 F	*- F
22	1		*RADIATOR COWLING	Broken	0.00 F	*- F
23	1		*INTERCOOLER	Dented	0.00 F	*- F
24	1		*ENGINE HARNESS WIRE	Torn	0.00 F	*- F
25	1		*LH DOOR REAR PILLAR	Repair	0.00 F	*- F
26	1		*FRT LH DOOR	Dented	0.00 F	*- F
27	1		*FRT LH DOOR HINGE	Bent	0.00 F	*- F
28	1		*FRT LH DOOR GLASS REGULATOR	Bent	0.00 F	*- F
29	1		*FRT LH DOOR RUBBER	Torn	0.00 F	*- F
30	1		*FRONT LH DOOR INNER TRIM BOARD	Crushed	0.00 F	*- F
31	1		*FRT DOOR FRT PILLAR (LH)	Dented	0.00 F	*- F
32	1		*FRT STEP PANEL (LH)	Cut	0.00 F	*- F

F=Franchise part.

Total Parts (\$\$)	0.00	0.00
---------------------------	-------------	-------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >