

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD INV No. AC2100340

36 ROBINSON ROAD INV Date 15/01/2021

#16-01 CITY HOUSE Reference CC4/FCI20005095/Aea3q2

SINGAPORE 068877 Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLZ 3654P

Insured Veh. SHC 8330J

Claim No. D20001795MFSH

Policy No. D-20094922MFSH

Accident Date 03/04/2020

Inspection Date 09/04/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

		Affiliated to Federation Internation	nale Des Experts En Autor	nobile
	MS FIRST CAPITA	L INSURANCE LTD	Ref:	CC4/FCI20005095/Aea3q2
	36 ROBINSON RO #16-01 CITY HOUS	AD SESINGAPORE 068877	Date	: 15/01/2021
			Code	e: FCI2
1.		Policy Particulars :	- THIRD PARTY CLA	IM
	Insured Veh.	SHC 8330J	Veh. Inspected	SLZ 3654P
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00
	Claim No.	D20001795MFSH	Excess (\$)	0.00
	Assign From	CHRIS	Assign Date	07/04/2020
2.		Vehicle Partic	ulars & Condition	
	Make & Model	TOYOTA PRIUS PLUS	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	JTDZS3EUX0J026971	Colour	BLUE
	Odometer	276222 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3.		Condition	ons of Tyres	
		Size	Make	Balance
	R/H Front Tyre	205/60 R16	HABILEAD	6 mm
	L/H Front Tyre	205/60 R16	HABILEAD	6 mm
	R/H Rear Tyre	205/60 R16	HABILEAD	6 mm
	L/H Rear Tyre	205/60 R16	HABILEAD	6 mm
4.		Description	on of Damages	
	THE VEHICLE SUS	STAINED DAMAGES AT THE REA	AR PORTION.	
	DAMAGES SEE DI	ETAILS.		
5.		General	Information	
	Accident Date	03/04/2020	Inspection Date	09/04/2020
	Survey held at	N-51 AUTOMOTIVE PL		
		2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921		
5a.		Re	emarks	
		N WAS CONDUCTED ON A"WIT E TO YOUR INSTRUCTIONS, W		
5b.		Estimate I	Days of Repair	
	ESTIMATED NORM	MAL PERIOD FOR REPAIR:	6 Wo	rking Days
		<u> </u>		



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLZ 3654P

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER	DEFORMED	781.10	781.10
1	FRONT BUMPER AIR DUCT RH	CRACKED	65.00	65.00
1	FRONT BUMPER DAYLIGHT RH	CRACKED	972.85	972.85
1	FRONT BUMPER SIDE BRACKET RH	CRACKED	171.10	171.10
6	FRONT BUMPER SIDE LOCK CLIPS @\$9.50	NECESSARY	57.00	30.00
6	FRONT BUMPER SIDE LOCK CLIPS HOLDER @\$12.90	CRACKED	77.40	77.40
2	FRONT BUMPER SIDE RETAINER L/R @\$132.25	O/S DAMAGED	264.50	132.25
1	FRONT BUMPER TOP SEAL RUBBER	NOT NECESSARY	174.45	-
1	FRONT RH FENDER	DENTED	721.30	721.30
1	FRONT RH FENDER 'HYBRID' EMBLEM	NECESSARY	123.05	123.05
1	FRONT RH FENDER INNER SHIELD	TORN	259.45	259.45
1	FRONT RH HEADLAMP	CUT	2,721.10	2,721.10
1	FRONT RH KNUCKLE ARM	DAMAGED	485.00	485.00
1	FRONT RH KNUCKLE ARM BEARING	NECESSARY	517.00	517.00
1	FRONT RH LOWER ARM	BENT	435.00	435.00
1	FRONT RH SHOCK ABSORBER	BENT	375.00	375.00
1	FRONT RH SHOCK ABSORBER TOP MOUNTING	NOT NECESSARY	151.00	-
1	FRONT RH STABILIZER LINK	NOT NECESSARY	117.00	-
1	FRONT RH TIE ROD END	NOT NECESSARY	93.00	-
1	FRONT RH WHEEL HUB KIT	NECESSARY	187.90	187.90
1	ROCKER GARNISH RH	CRACKED	947.00	947.00
1	WASHER TANK	DEFORMED	199.50	199.50
1	WASHER TANK MOTOR	NOT NECESSARY	235.00	-
	LESS 25% DISCOUNT		-2,532.68	-2,300.25
			7,598.02	6,900.75
1	FRONT RH SPORT RIM (SN)	CUT	1,555.00	400.00
	LESS 25% DISCOUNT		-388.75	-
			1,166.25	400.00
		1	, ====	

Report Ref No. CC4/FCI20005095/Aea3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	SPECIAL NETT ITEMS			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SET FRONT RH FENDER INNER SHIELD CLIPS (SN)	NECESSARY	50.00	30.00
1	FRONT RH TYRE 205/60R16 (SN)	NOT NECESSARY	380.00	-
1	SET ROCKER GARNISH CLIPS (SN)	NECESSARY	50.00	30.00
			560.00	90.00
	<u>LABOUR</u>			
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND RESETTING HEADLAMP FOCUSSING (TO FR).		60.00	30.00
	TO REMOVE ,CHARGE FRONT SUSPENSION PARTS ,ABSORBER ,LOWER ARM ,KNOCKLE ARM ,WHEEL BEARING ,BEATING HUB DRIVE SHAFT ,ANTI-ROLL BAR ,TOP-ARM AND STEERING RACK AND PINION .		380.00	220.00
	TO ROAD TEST DRIVING CHECK AND RESETTING WHEEL ALIGNMENT SYSTEM.		140.00	80.00
	TO RE-SRPAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT.		1,000.00	700.00
	TO PROVIDE LABOUR WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RE-CONSRUCT AND RE-ALIGN BODY STRUCTURE BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .		600.00	500.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	50.00
			2,300.00	1,580.00
	GRAND TOTAL		11,624.27	8,970.75
	RECOMMENDED COST OF LUMP SUM REPAIRS			7 100 00

RECOMMENDED COST OF LUMP SUM REPAIRS		7,100.00
(TO ITS PRE-ACCIDENT CONDITION)		·

Report Ref No. CC4/FCI20005095/Aea3q2



ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 3654P

INSPECTION
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

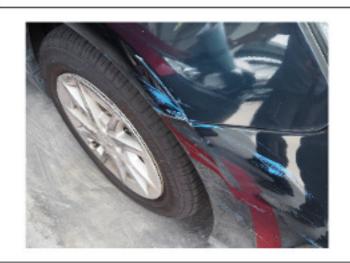














51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315










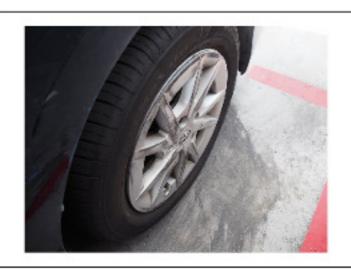

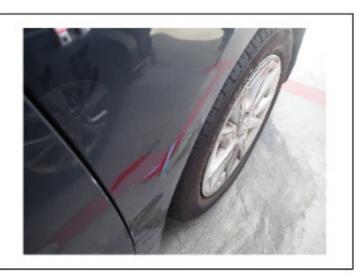



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 3654P

RE-INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 3654P

RE-INSPECTION

