

# PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/ Adjusters Cargo Surveyors & Licensed Appraisers

227 Simei St 4 #06-42 Singapore 520227 Fax: 64444886 Company Registration No. 53139926E



## AUTOMOBILE INSPECTION REPORT

To:

**NG CHEE BOON**

**C/O 7 Soon Lee Street #01-19**

**ISPACE Singapore 627608**

### INSURANCE DETAILS

Insured : -  
Policy No. / Claim No. : -  
Sum Insured : -  
Excess Clause : -  
Windscreen Coverage : -  
Type of Claims : Third Party Claims  
Third Party Insurer : -  
Third Party Policy No. : -

### REFERENCE

Assigned By : As above  
Accident Date : 25 FEBRUARY 2020  
Assignment Date : 25 FEBRUARY 2020  
Inspection Date : 25 FEBRUARY 2020  
Our Reference No. : PAS/PF/200309/TP

**Inspection Report Date : 16 March 2020**

**Workshop Name :**

**POWER FOOK VEHICLE SERVICE**

**Inspection Address :**

**7 Soon Lee Street #01-19 ISPACE**

**Singapore 627608**

### PARTICULARS OF VEHICLE

Registration No.	: SBY 885 H	Mileage	: 59122	Km/h
Make/Model	: TOYOTA COROLLA ALTIS 1.6 CVT	Radio/Cassette	: Fitted	
Yr of Manuf/Regn	: 2016 / 2017	CD Disc Player	: Fitted	
Carrying Capacity	: 4 Seater	Air Conditioner	: Fitted	
Chassis No.	: MR053REH104560328	Clock	: Fitted	
Engine No.	: 1ZRY339916	Seat Belt	: Fitted	
Colour	: Metallic White	Wing Mirror Other	: Fitted	
Class	: Passenger ( Private )	Accessories	: Fitted	

### PRE-ACCIDENT CONDITION (Static Check Only)

Body Work : Good  
Paint Work : Good  
Handbrake : Serviceable  
Footbrake : Serviceable  
Steering : Serviceable  
Any Apparent : None  
Eng Modifications

### VEHICLE VALUE

Market Value : X  
Wreck Value (Parf) : X

### TYRE SIZE & CONDITION

Front N/s Size	: 215/45R17	80 %	Front O/s Size	: 215/45R17	80 %
Make	: LINGLONG		Make	: LINGLONG	
Rear N/s size	: 215/45R17	80 %	Rear O/s Size	: 215/45R17	80 %
Make	: LINGLONG		Make	: LINGLONG	
Spare Size	: 215/45R17	80 %	Spare Size		
Make	: LINGLONG		Make		


**Type of Wheel Rims: Alloy**

**Jack & Tools : Intact/Missing**

**Note: The above percentage % represent the estimated remaining tyre threads.**

# PRECISION APPRAISAL SERVICES

Insurance Loss Assessors / Adjusters Cargo Surveyors & Licensed Appraisers

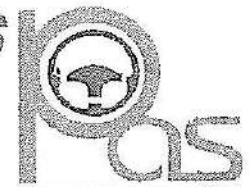


VEHICLE REGISTRATION NO. : SBY 885 H

APPENDIX A

## POINT OF IMPACT

(Diagram A) (Diagram B) (Diagram C) (Diagram D)  
Direction of impact/damage marked (→) (X) FRONT FRONT FRONT FRONT

**The vehicle sustained impact on its O/s Front Portion. It was also affected on its Front Portion (see Diagram D)**

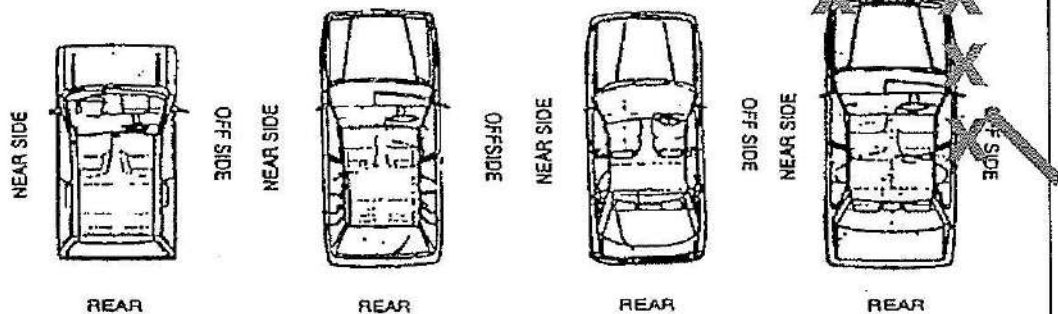

## GENERAL DESCRIPTION OF DAMAGES

Parts damaged were :

**The front and rear o/s door, o/s rocker panel, front o/s door pillar and side mirror, bonnet and hinges, front o/s fender and wheel rim were dented.**

## ADJUSTMENTS & RECOMMENDATIONS

A static inspection was carried out on 25/02/2020 & our report is here with enclosed for your perusal. The Repairs Estimate submitted by M/s POWER FOOK VEHICLE SERVICE as per attached Appraisalment Schedule have been revised and scrutinised thoroughly by us & in our opinion, we consider it to be fair and reasonable. The repairer has agreed to effect repairs to the owners satisfaction & to roadworthy condition on an agreed Part - By - Part Repair Basis of \$ 8,886.52 after deducting the Policy Excess Clause of \$ NA. As instructed, we have not authorised any of the repairs on your behalf.

	Repairer's		Our	
	Estimate	Amount	Revised	Amount
Spares Parts	11553	60	5946	52
Towing Charges	300	00	240	00
PB Labour Charges	1400	00	980	00
Others Misc Charges	720	00	520	00
Paintwork	1600	00	1200	00
Total	\$ 15573	60	\$ 8886	52

Under normal circumstances, the duration of repairs should not exceed Seven ( 07 ) days

excluding Pre - Repair Inspection ( PRI ) / Pre - Repair Survey ( PRS ) & Public Holidays waiting time frame. Attached photographs taken during inspection Ninety ( 90 ) Photographs.

## SPECIAL REMARKS

1. The inspection was conducted on a 'without prejudice' basis
2. On 27/02/2020, we examined the extent of damages
3. On 29/02/2020, we examined the new replacement parts.
4. On 03/03/2020, we examined the repaired vehicle.

Yours Faithfully,



T F N G PHILIP FOO  
A C I I CAE, AMIMI  
AIAME, AMSAE-A  
Licensed Appraiser/Adjuster

Inspection Report Date: 16 March 2020

VEHICLE REGN NO :

SBY 885 H

OUR REFERENCE :

PAS/PF/200309/TP

INSPECTION REPORT DATE :

16-Mar-20

CONTINUATION SHEET NO :

1

## APPRAISEMENT SCHEDULE

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount	Recommendation / Revised Amount
<u>PARTS SUPPLY - LIST ITEMS</u>					
1	1pc	Front o/s door	Badly Torn	\$ 850.60 <sup>cts</sup>	\$ 850.60 <sup>cts</sup>
2	1pc	Front o/s door regulator	Badly Bent	240.70	240.70
3	1pc	Front o/s door upper hinges	Bent	108.70	108.70
4	1pc	Front o/s door lower hinges	Bent	108.70	108.70
5	2pcs	Front o/s door upper hinge bolt@\$5	Necessary	10.00	10.00
6	2pcs	Front o/s door lower hinge bolt@\$5	Necessary	10.00	10.00
7	1pc	Front o/s door striker	Bent	48.00	48.00
8	1pc	Front o/s door handle	Dented/Defaced	150.70	150.70
9	1pc	Front o/s fender	Badly Dented/Torn	398.50	398.50
10	1pc	Front o/s fender 'Vvti' emblem	Necessary	71.50	71.50
11	14pcs	Front o/s fender bolt@\$5	Necessary	70.00	70.00
12	1pc	O/s side mirror	Broken	728.50	728.50
13	1pc	O/s side mirror garnish	Broken	120.30	120.30
14	3pcs	O/s side mirror bolt@\$5	Necessary	15.00	15.00
15	1pc	Front o/s door pillar outer garnish	Broken	65.50	65.50
16	1pc	Front o/s door pillar	Badly Dented	742.50	Repair
17	6pcs	Front o/s door bolt@\$5	Necessary	30.00	30.00
	1pc	Bonnet	Badly Dented	717.50	717.50
19	1pc	Bonnet hinges o/s	Dented/Bent	110.20	110.20
20	3pcs	Bonnet hinges bolt o/s@\$5	Necessary	15.00	15.00
21	1pc	Bonnet hinges n/s	Serviceable	110.20	-
22	1pc	O/s Wiper blade	Dented/Defaced	118.20	118.20
23	1pc	O/s Wiper arm	Dented/Defaced	108.90	108.90
24	1pc	O/s Rocker panel	Badly Dented	808.20	Repair
25	1pc	O/s Headlamp	Defaced/Cracked	1816.50	1816.50
26	1pc	N/s Headlamp	Defaced/Cracked	1816.50	1816.50
27	1pc	Front bumper	Dented/Defaced	401.50	Repair
28	1pc	Front bumper bracket o/s	Bent	99.60	99.60
29	1pc	Front bumper bracket n/s	Bent	99.60	99.60
30	1pc	Rear o/s door	Defaced	912.50	Spraypaint
				10903.60	7928.70
		Less: 25% discount		-	1982.18
				10903.60	5946.52
<u>SPECIAL NETT ITEMS</u>					
1	1pc	Front o/s wheel rim	Dented/Defaced	650.00	Repair
		Total spare parts		11553.60	5946.52
<u>LABOUR &amp; MISC. CHARGES</u>					
1		Towing		300.00	240.00
2		Remove the necessary affected parts, straighten front o/s door pillar, o/s lower rocker panel and replace parts		1400.00	980.00
3		Putty and Spraypaint on all affected parts		1600.00	1200.00
4		Check electrical		20.00	20.00
5		Tuff Kote		100.00	60.00
6		Rewire front portion and refocus both headlamps beam		100.00	60.00
7		Remove and refit front o/s door parts		150.00	120.00
8		Reset wheel alignment		100.00	80.00
9		Repair front o/s wheel rim		200.00	150.00
10		Remove and rewire o/s door mirror		50.00	30.00
SUB / GRAND TOTAL				15573.60	8886.52

PRECISION APPRAISAL SERVICES













