

ASS. REC. BY:

REF:

F02/20005248K ka3

C

Kenneth

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 QD / TP / WS / TP RES / QD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s 1 Hui Yang
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

☒	☐
N/S	O/S
☐	☐

Bal. or Market Value: 60k
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 03 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SUK 24605 Yr Regn: 01, 17
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or

Make: Honda Vezel c.c. 1496
 Colour: M. P. White A/C: Insured / Std / NI / NA
 Sp. Reading: 74425 T/Radio: Insured / Std / NI / NA
 Eng/No: _____

C/No: RU 3 1217051
 Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / SRM / STD A/Rim or

Tyre Size: F: 215/55R17
 R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Front: 7 mm Rear: 7 mm
 R/Bal. 7 mm R/Bal. 7 mm
 L/Bal. 7 mm L/Bal. 7 mm
 D.O.A. 3/4/20 D.O.I. 16/4/2020

Survey held at ✓

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Frt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

22/4 11:30pm 8 2550f email & confirm

Date/Time, File Pass to?

☐ : Prell. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech Invs (\$)☐ : Weekend (\$)

輝陽汽車有限公司 HUI YANG MOTOR PTE. LTD.

Contact Add : SIN MING AUTOCARE Blk 176 Sin Ming Drive #04-02 Singapore 575721
Tel: 64515752 (2 Lines) . Fax: 64514658
GST Reg No. 201629438M

03/04/2020

Owner: JA TRANSPORT

ESTIMATE TO REPAIR HONDA VEZEL - SLK2460S

1pc	front LH headlamp
1pc	front LH headlamp lower bracket
1pc	front bumper 801.70
1pc	front bumper LH side retainer
1pc	front bumper lower spoiler
20pcs	front bumper clip @\$5.00
1pc	front bumper reinforcement
1pc	front bumper LH fog lamp garnish
1pc	front LH fender
1pc	front LH fender protector
1pc	front LH fender "HYBIRD" emblem

less 20%

1pc front LH sport rim


alignment
wiring
tuffkote
spray painting
labour charges
Total

mycom	\$ 1,559.40	✓
	\$ 35.00	X
mycom	\$ 927.50	✓
	\$ 31.70	✓
sn	\$ 351.00	X
in	\$ 100.00	✓
R	\$ 321.50	X
sn	\$ 185.85	X
R	\$ 580.00	X
nu	\$ 195.00	✓
nu	\$ 65.50	✓

\$ 4,352.45
\$ 870.49
\$ 3,481.96

sn s.nett \$ 680.00 X

	\$ 80.00	601
	\$ 60.00	201
nn	\$ 80.00	X
	\$ 800.00	5501
	\$ 800.00	3601
	\$ 5,981.96	

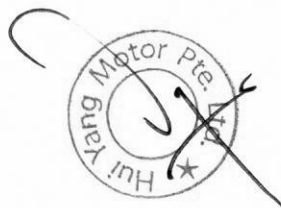

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

M2 First up

Kenneth
16/04/20
12noon.

Not Authorised
L1 Sing @ 2550h
Recovery After Rain

3 days