



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SINGAPORE CIVIL DEFENCE FORCE

Ref : CS/SCD20005265/Qsf3e2

91 UBI AVE 4SINGAPORE 408827

Date : 06-05-2020



ATTN : SHAUN LIM CHI TUCK

Code : SCD

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	YN 3945J
Policy No.		Coverage (\$)	0.00
Claim No.	ACC-SMRT-19-15	Excess (\$)	0.00
Assign From	SHAUN LIM CHI TUCK	Assign Date	16/04/2020

2. Vehicle Particulars & Condition

Make & Model	ISUZU	c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.	NJR857029455	Colour	WHITE
Odometer	-	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/75 R15	YOKOHAMA	6 mm
L/H Front Tyre	195/75 R15	YOKOHAMA	6 mm
R/H Rear Tyre	195/75 R15	YOKOHAMA	6 mm
L/H Rear Tyre	195/75 R15	YOKOHAMA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	09/12/2019	Inspection Date	17/04/2020
Survey held at	HOME TEAM -1 GALI BATU C1		
Repairer	-		

5a. Remarks

--



Registration No.YN 3945J

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	Cabin mounting bar assy	1				
1.2	Power steering pump	1				
1.3	Power steering shaft	1				
1.4	Front bumper	1				
1.5	Front bumper support	2				
1.6	Fog lamp LH & RH	2				
1.7	Signal lamp LH & RH	2				
1.8	Head lamp LH & RH	1				
1.9	Radiator grille	1				
1.10	Wind screen	1				
1.11	Wind screen moulding	1				
1.12	Wind screen sealant	1				
1.13	Wind screen preimer	1				
1.14	L/H mud flap	1				
1.15	L/H door garnish	1				
1.16	R/H step board	1				
1.17	Steel rim	1				
1.18	L/H dented door shell	1				
1.19	L/H door signal lamp	1				
1.20	Air bag & sensor	1				
1.21	Front number plate	1				
1.22	Panel sticker	1				
1.23	Gear box	1				
1.24	Gear box mountings	3				
1.25	Engine mountings	4				
	LABOUR DESCRIPTION					
1	SCOPE OF REPAIRS					

1.1	Remove & replace cabin dented mounting bar					5
1.2	Remove & replace power sterling unit					2
1.3	Remove & replace dented power sterling shaft					2
1.4	Remove & replace front dented bumper					2
1.5	Remove & replace front dented bumper support					2
1.6	Remove & replace both dislodged fog lamp					1
1.7	Remove & replace both signal lamp					1
1.8	Remove & replace both head lamp					2
1.9	Replace dislodged radiator grille					1
1.10	Remove & replace shuttered wind screen					3
1.11	Replace wind screen moulding					1
1.12	Water seepage for wind screen					1
1.13	Remove & replace L/H mud flap					1
1.14	Replace L/H door garnish					0.5
1.15	Remove & replace front R/H step board					1
1.16	Remove & replace front L/H dented door shell					2
1.17	Transfer front L/H door inner panel, door handle & accessories to new door shell					4
1.18	Replace L/H door signal lamp					0.5
1.19	Remove & replace driver air bag & sensor					0
1.20	Remove & replace front dented number plate					0.5
1.21	Repair & align misalign dash board					3
1.22	Repair & align tilted cabin					20
1.23	Remove & replace front panel sticker					1
1.24	Panel beat front dented panel					3
1.25	Remove & replace gear box					5
1.26	Remove & replace gear box mounting					2
1.27	Remove & replace engine mounting					2
1.28	Putty & spray whole complete front cabin					20
1.29	Wiring for all replacement lighting					4

3	COLLECTION & DELIVERY					
3.1	Collection From Station - Workshop (SOR 9)	1				
3.2	Delivery From Workshop - Station (SOR 9)	1				
4	ADDITIONAL SERVICES					
4.1	Admin Support					0
2.1						0
COSTING		TOTAL PARTS COST			\$0.00	
		TOTAL MAN-HOUR				92.5


Registration No.YN 3945J

Vehicle Inspected By



OI SUN PIN

Asst. Automotive Assessor

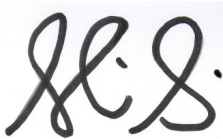

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YN 3945J

INSPECTION

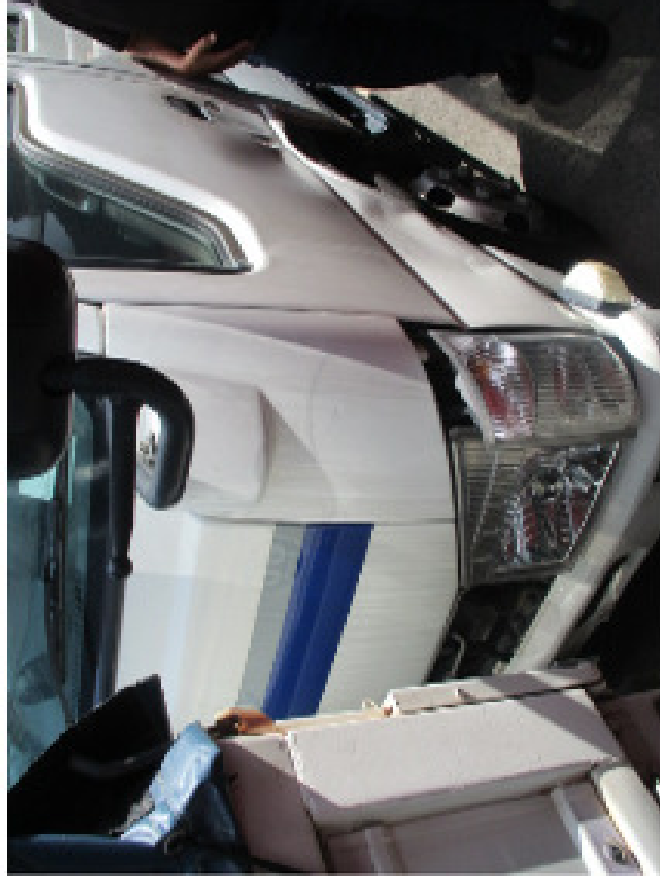



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

