



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2100317

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 14/01/2021
Reference CC4/FCI20005333/Aba3s2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMA 5871K
Insured Veh. SHA 610P
Claim No. D20001955MFSH
Policy No. D-20094921MFSH
Accident Date 18/04/2020
Inspection Date 04/05/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

NSA



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Ref: CC4/FCI20005333/Aba3s2

Date: 14/01/2021

Code: FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHA 610P	Veh. Inspected	SMA 5871K
Policy No.	D-20094921MFSH	Coverage (\$)	0.00
Claim No.	D20001955MFSH	Excess (\$)	0.00
Assign From	ERIC WOO	Assign Date	21/04/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA SIENTA	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	NHP1707126823	Colour	GREEN
Odometer	162575 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/60 R15	HABILEAD	6 mm
L/H Front Tyre	185/60 R15	HABILEAD	6 mm
R/H Rear Tyre	185/60 R15	HABILEAD	6 mm
L/H Rear Tyre	185/60 R15	HABILEAD	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	18/04/2020	Inspection Date	04/05/2020
Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMA 5871K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BUMPER	DEFORMED	950.00	750.00
1	REAR BUMPER CENTER PROTECTOR GARNISH	CUT	209.00	209.00
2	REAR BUMPER REFLECTOR L/R @ \$85.00	NOT NECESSARY	170.00	-
2	REAR BUMPER SIDE PROTECTOR GARNISH L/R @ \$155.00	NOT NECESSARY	310.00	-
2	REAR BUMPER SIDE RETAINER L/R @ \$90.00	NECESSARY	180.00	180.00
1	REAR END PANEL 'INNER'	TO REPAIR SEE LABOUR	607.00	-
1	REAR END PANEL 'OUTER'	DENTED	599.00	599.00
1	REAR END PANEL INNER TOP GARNISH	DEFORMED	207.00	207.00
1	REAR FLOOR COMPARTMENT TRAY	DEFORMED	519.00	519.00
2	REAR FLOOR COMPARTMENT TRAY TOP BOARD COVER L/R @\$378.00	NOT NECESSARY	756.00	-
1	REAR TAILGATE	DENTED	1,088.00	1,088.00
1	REAR TAILGATE 'HYBRID' EMBLEM	NECESSARY	78.00	78.00
1	REAR TAILGATE 'LOGO' EMBLEM	NECESSARY	110.00	110.00
2	REAR TAILGATE HINGE L/R @ \$78.00	NOT NECESSARY	156.00	-
1	REAR TAILGATE INNER PULL GARNISH	NOT NECESSARY	48.00	-
2	REAR TAILGATE INNER RUBBER GUIDE STOPPER L/R @ \$19.00	NOT NECESSARY	38.00	-
1	REAR TAILGATE INNER TRIM BOARD	NOT NECESSARY	455.00	-
1	REAR TAILGATE LOCK STRIKER		40.00	-
1	REAR TAILGATE MECHANIM LOCK	DAMAGED	265.00	265.00
1	REAR TAILGATE WEATHER STRIP	CUT	385.00	385.00
2	REAR TAILGATE WINDSCREEN MOULDING L/R @ \$50.00	NECESSARY	100.00	100.00
2	REAR TAILGATE WINDSCREEN SEAL (TOP & LOWER) @ \$50.00	NECESSARY	100.00	100.00
	LESS 25% DISCOUNT		-1,842.50	-1,147.50
			5,527.50	3,442.50
SPECIAL NETT ITEMS				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SE REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	300.00	200.00

Report Ref No. CC4/FCI20005333/Aba3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR END PANEL INNER TOP GARNISH CLIPS (SN)	NECESSARY	40.00	10.00
1	SET REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
1	REAR TAILGATE NUMBER PLATE (SN)	NOT NECESSARY	25.00	-
1	REAR TAILGATE NUMBER PLATE HOLDER (SN)	NOT NECESSARY	50.00	-
1	REAR TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
			625.00	300.00
	LABOUR			
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING, AND REWIRE FOR PARKING SENSOR.		100.00	30.00
	TO REMOVE, REINSTALL TAILGATE WINDSCREEN.		150.00	120.00
	TO REMOVE, REINSTALL ROOF TOP TRIM UPHOLSTERY, CUSHION SEAT, TRIM GARNISH, TRIM LINER CARPET. (TO FR)		60.00	60.00
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT.		1,000.00	700.00
	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF REAR END PANEL 'INNER'.		1,000.00	800.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	60.00
	TO TRANSFER REAR TAILGATE INNER TRIM BOARD, WIPER MOTOR, MECHANISM LOCK OUTER HANDLE.		80.00	80.00
			2,510.00	1,850.00
GRAND TOTAL			8,662.50	5,592.50
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,400.00

Report Ref No. CC4/FCI20005333/Aba3s2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 5871K

INSPECTION

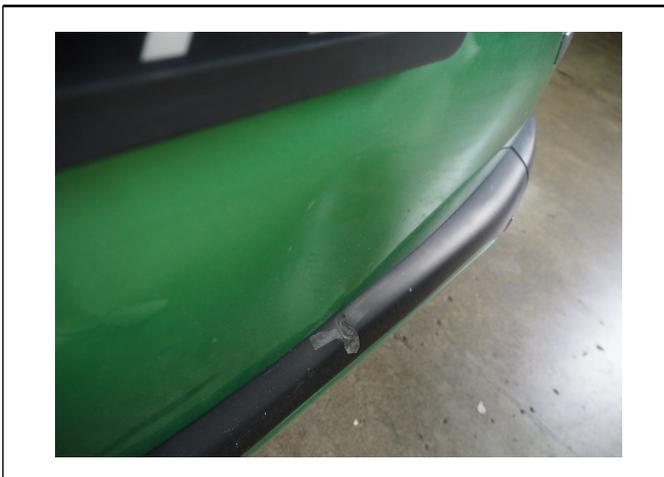



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

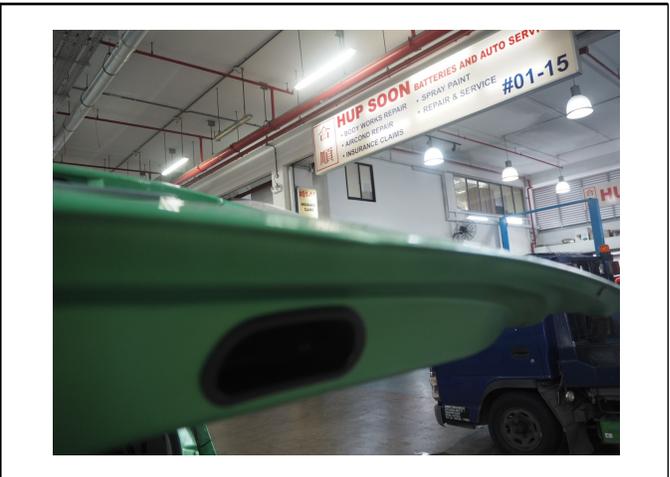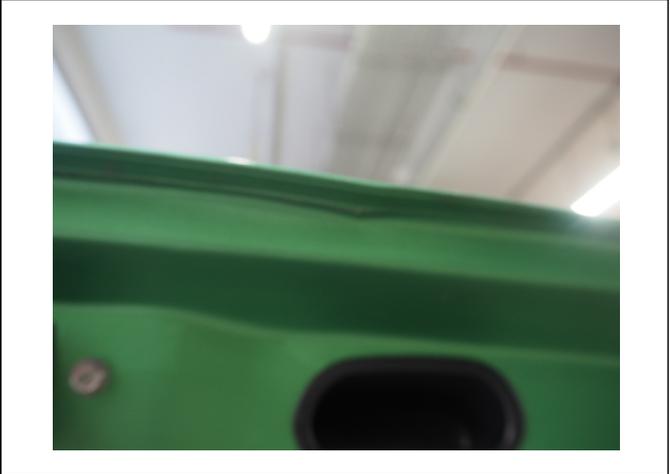



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 5871K

RE-INSPECTION

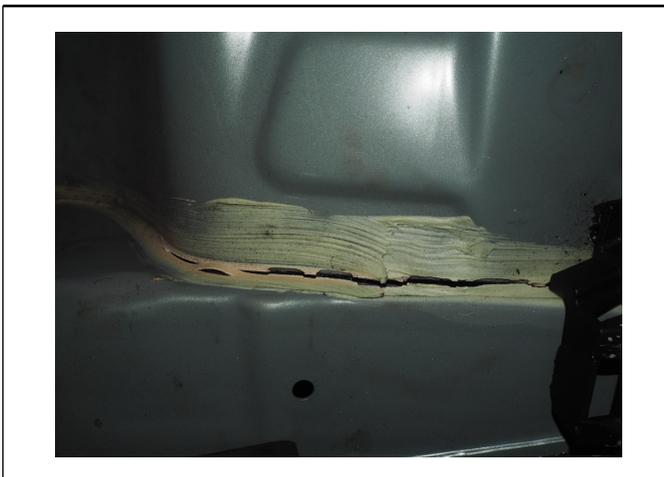



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 5871K

RE-INSPECTION

