

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CK VEHICLE RENTAL PTE LTD BLK 1003 EUNOS AVE 8 #01-57 (OFF EUNOS ROAD) SINGAPORE 409498 ON BEHALF OF GOH HEOK SENG INV No. AC2003956

INV Date 15/05/2020

Reference CS/TP20005347/Asf3n2

Code TP241

PROFESSIONAL SERVICE FEE

Vehicle No. SLP 9483D

Insured Veh.

Claim No.

Policy No.

Accident Date 02/04/2020

Inspection Date 22/04/2020

Description	Total
Survey Inspection	459.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	459.00
GST (7%)	32.13
Grand Total	491.13

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

HYN



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile					
CK V	/EHICLE RENTAL PTE LTD Ref : CS/TP20005347/Asf3n2					
#01-5	1003 EUNOS AVE 57 (OFF EUNOS F BEHALF OF GOH	ROAD)SINGAPORE 409498	Date: 15-05-2020 Code: TP241			
1.		Policy Particulars	:- THIRD PARTY CLAIM			
	Insured Veh. Veh. Inspected SLP 9483D					
	Policy No.		Coverage (\$)	0.00		
	Claim No.		Excess (\$)	0.00		
	Assign From		Assign Date	22/04/2020		
2.		Vehicle Partic	culars & Condition			
	Make & Model	TOYOTA ALLION	c.c	1496		
	Engine No.	HIDDEN	Year of Reg.	2008		
	Chassis No.	NZT2603033553	Colour	BLACK		
	Odometer	166901	Steering	IN ORDER		
	Brakes	IN ORDER	Modification	SPORTS RIM		
	General	GOOD				
3.	3. Conditions of Tyres					
		Size	Make	Balance		
	R/H Front Tyre	195/65 R15	CONTINENTAL	6 mm		
	L/H Front Tyre	195/65 R15	CONTINENTAL	6 mm		
	R/H Rear Tyre	195/65 R15	CONTINENTAL	6 mm		
	L/H Rear Tyre	195/65 R15	CONTINENTAL	6 mm		
4.		Description	on of Damages			
	THE VEHICLE SU	STAINED DAMAGES AT THE N/S	BODY.			
	DAMAGES SEE D	ETAILS.				
5.		Genera	I Information			
	Accident Date	02/04/2020	Inspection Date	22/04/2020		
	Survey held at	CK VEHICLE RENTAL PTE LTD	0-1003 Eunos Ave 8			
	Repairer SIANG HUI MOTOR WORKS					
5a.		Re	emarks			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.					
5b.	5b. Estimate Days of Repair					
	ESTIMATED NORMAL PERIOD FOR REPAIR: 7 Working Days					



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 9483D

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER	DEFORMED	791.10	791.10
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	50.00
1	FRONT BUMPER SIDE HOLDER LH	NECESSARY	49.00	49.00
1	HEADLAMP LH	CUT	809.10	809.10
1	FRONT LH FENDER	DENTED	645.20	645.20
1	FRONT LH FENDER INNER SHIELD	DEFORMED	153.60	153.60
1	SET FRONT LH FENDER INNER SHIELD CLIPS	NECESSARY	30.00	30.00
1	FRONT LH DOOR	DENTED	1,154.60	1,154.60
1	FRONT LH DOOR LOCK	DAMAGED	485.10	485.10
1	FRONT LH DOOR OUTER HANDLE	NOT NECESSARY	212.60	-
1	FRONT LH DOOR BLACK TAPE	NECESSARY	85.00	85.00
1	REAR LH DOOR		1,245.20	1,245.20
1	REAR LH DOOR LOCK	DAMAGED	450.40	450.40
1	REAR LH DOOR BLACK TAPE	NECESSARY	85.00	85.00
1	FRONT LH LOWER ARM	NOT NECESSARY	387.90	-
1	FRONT LH KNUCKLE ARM	NOT NECESSARY	399.50	-
1	FRONT LH WHEEL HUB C/W BEARING	NOT NECESSARY	210.10	-
1	FRONT LH SHOCK ABSORBER	NOT NECESSARY	381.80	-
1	SILL PANEL RH	TO REPAIR SEE LABOUR	482.50	-
	LESS 25% DISCOUNT		-2,026.93	-1,508.33
			6,080.77	4,524.97
	SPECIAL NETT ITEMS			
	FRONT LH WHEEL RIM (SN)	CUT	680.00	550.00
1	FRONT LH TYRE (SN)	NOT NECESSARY	280.00	-
	REAR LH WHEEL RIM (SN)	NOT NECESSARY	680.00	-
	` '		1,640.00	550.00
	<u>LABOUR</u>			
	PANEL BEATING,REMOVE AND REFIT PARTS.INCLUSIVE OF THE REPAIR OF SILL PANEL RH.		1,400.00	1,000.00
	SPRAY PAINTING TO AFFECTED AREA.		1,400.00	1,200.00

Report Ref No. CS/TP20005347/Asf3n2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	WIRING CHECK.		50.00	30.00
	TUFF COAT.		150.00	60.00
	TO TRANSFER FRONT AND REAR DOOR FITTINGS.		300.00	200.00
	TO DISMANTLE FRONT UNDERCARRIAGE.	NOT NECESSARY	350.00	-
	TO PERFORM WHEEL ALIGNMENT.		150.00	80.00
			3,800.00	2,570.00
	GRAND TOTAL		11,520.77	7,644.97

RECOMMENDED COST OF LUMP SUM REPAIRS		6,100.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS/TP20005347/Asf3n2



ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315


Reg. No. 199607198R GST Reg. No. 19-9607198-R


INSPECTION




PHOTOGRAPHS FOR VEHICLE NO. SLP 9483D



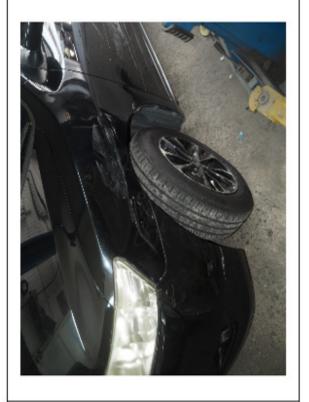


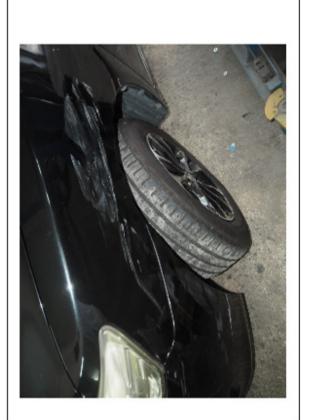


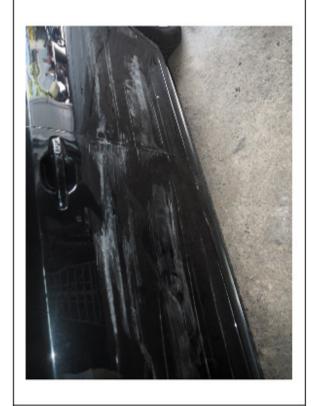




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

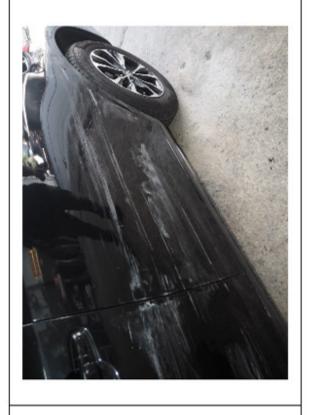

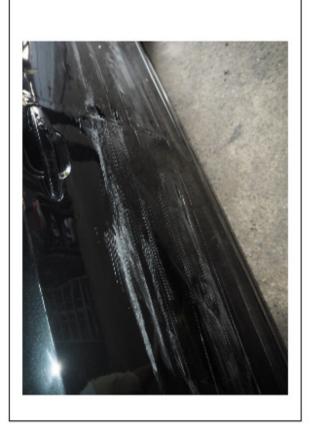



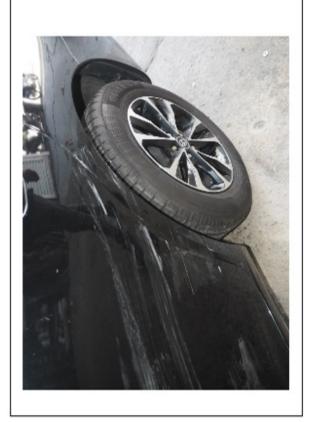




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No: 19-9607198-R






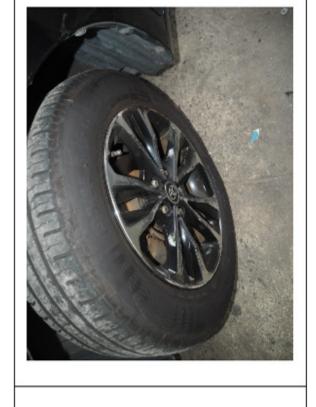







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

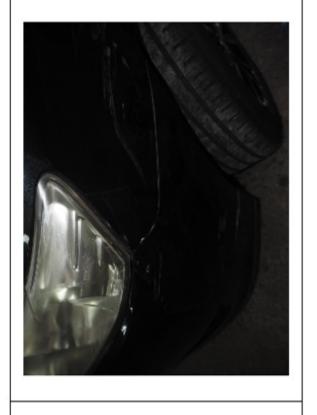

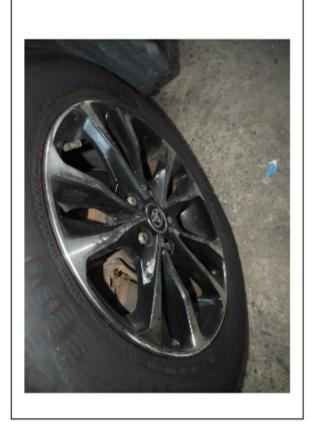

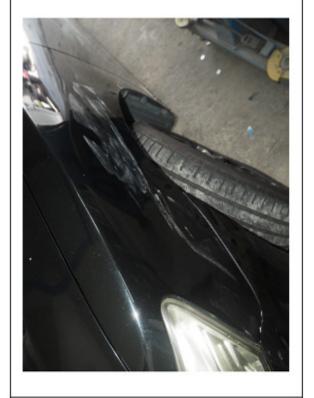







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No: 19-9607198-R



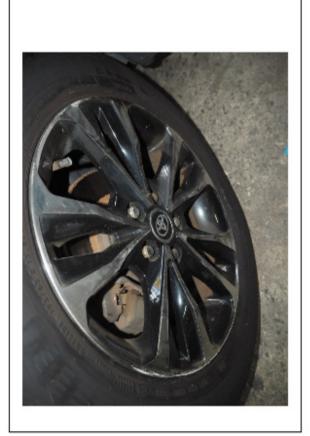



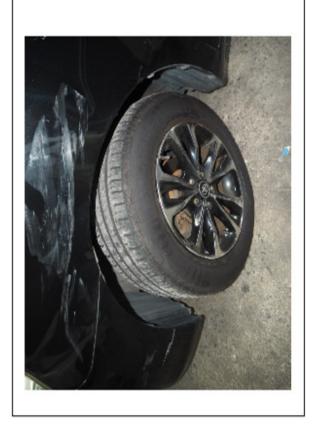




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933








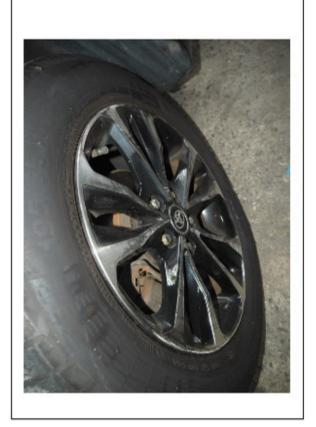



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

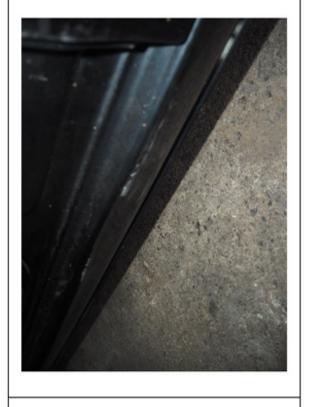









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933


Reg. No. 199607198R GST Reg. No. 19-9607198-R

RE-INSPECTION



PHOTOGRAPHS FOR VEHICLE NO. SLP 9483D



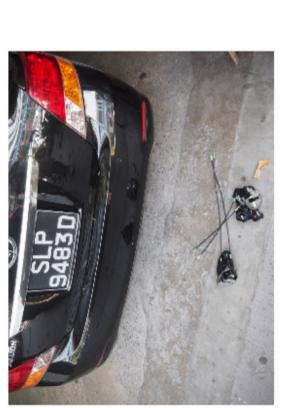





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315








PHOTOGRAPHS FOR VEHICLE NO. SLP 9483D

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

RE-INSPECTION

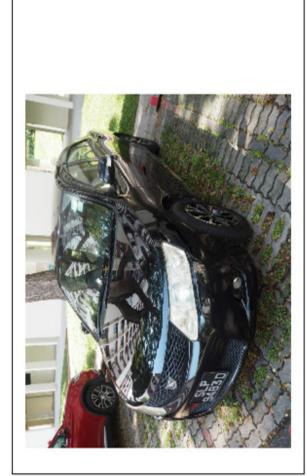









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315



