

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / IP / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: YP 4957H
at Workshop m/s: Tan Lm
of: SLQ8977Y
Insured: _____
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____
(Policy Condition)
Remark: The veh had commenced its
repair at the time of inspection
Bal. or Market Value: 70k
IDAC Accident Rpt: _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: 4 days Res.: Yes or No
Lum Sum: 20 % 3 Val.: Yes or No
CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____ Vehicle: IN / OUT

N/S	O/S

Veh No: YP 4957H Yr Regn: 12 16
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or (m)
Make: mit Fuso FK62 c.c. 7545
Colour: white A/C: Insured / Std / NI / NA
Sp. Reading: 132540 T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: FK62FMA30243
Gen. Cond: Good / Fair / Poor / Burnt
Steering: Good / Jammed / Leaked / Burnt or
Brake: Good / Jammed / Leaked / Burnt or
Modi: Nil / S/Rim / STD A/Rim or
Tyre Size: F: _____ R: 245/70 R19.5
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or Falken
Front Rear
R/Bal. 5- mm R/Bal. 5/5- mm
L/Bal. 5- mm L/Bal. 5/5- mm
D.O.A. 25/4/20 D.O.I. 27/4/20
Survey held at _____
Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Rear
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction
5/5/20 27A 24786
1/5 3700 confirmed with and Tan

Date/Time, File Pass to? ☐ : Preli. Report
1) ☐ : Final Report
Date/Time, File Return to?

2)

Days Of Repair:
Resurvey No. of Trip:
Add Fee: ☐ : Site Insp (\$) ☐ : S + RS \$
☐ : Interview (\$) ☐ : Photos
☐ : Tech. Invs (\$) ☐ : Others
☐ : Weekend (\$)

Survey Fee:
Transportation:

Report Format :
Lump Sum / I.B.I.: (\$)

TOTAL



陳林摩呀私人有限公司
TAN LIM MOTOR PTE LTD

1 Defu Lane 6 Singapore 539365
Tel : 68585151 (24 Hours) Fax : 68580877
GST Regn. No. : M2-8922054-2

AlGAsia Insured's Veh No : SLQ8977Y
Date of Accident : 25 April 2020

Messrs Skytruck Forwarders (S) Pte Ltd

Date : 27 April 2020

Estimate To Repair YP4957H - Mitsubishi FUSO FK62FMZ1RDEB
Chassis No : FK62FMA30243

S/No	Quantity	Description	Amount
LIST ITEMS			
01	1 pc	rear licence plate lamp <i>one</i>	\$ 100.00
02	2 ps	rear licence plate bracket @ \$200.00 <i>one</i>	\$ 400.00
03	1 pc	rear cross-member <i>one</i>	\$ 500.00
		Less 10 % <i>25.2</i>	\$ 1,000.00
			\$ 100.00
			\$ 900.00
SPECIAL NETT ITEMS			
04	2 ps	rear cross-member wooden bar (straight and long) @ \$1200.00 <i>one</i>	\$ 2,400.00
05	1 pc	rear step wooden bar <i>one</i>	\$ 300.00
06	1 pc	rear end panel wooden (top) <i>one</i>	\$ 700.00
07	8 ps	rear cross-member wooden bar u-bolt @ \$100.00 <i>one</i>	\$ 800.00
08	20 ps	rear cross-member wooden screw @ \$30.00 <i>one</i>	\$ 600.00
09	1 pc	rear licence plate <i>one</i>	\$ 50.00
10	1 pc	rear safety bar <i>one</i>	\$ 1,000.00
11	2 pc	rear safety bar bracket @ \$250.00 <i>one/one</i>	\$ 500.00
			\$ 6,350.00
LABOUR & MISC. CHARGES			
01		To check electrical lighting concerned.	\$ 100.00
02		To lift-up the rear cargo for facilities repair.	\$ 800.00
03		Panel beating, knocking and straighten the necessary portion, remove and renewal of parts, adjust and realign the same.	\$ 750.00
04		Putty and spray painting of the affected portion.	\$ 850.00
			\$ 2,500.00
			\$ 9,750.00

RR Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Not Authorized
2/5 \$3700 /
27/4/20
Whipre Affix rep
Ads

P-300
252
225
5.4-3414
L-1000
4639
202
3711