

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC6/AIG20005472/UGA3Q2

**Date:** 11/08/2020

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1800107370

**Claimant**  
**Vehicle No :** SKB208C **Insured Vehicle No :** SGM279L

Date of Loss: 26/04/2020 Nature of Claim: TP Claim No: 2402733019SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKB208C		
Make & Model:	VOLKSWAGEN GOLF, 1.4 TSI (A)	Engine No:	CZC999393
Reg. Date:	12/03/2019 (Man. Year: 2019)	Chassis No:	WVWZZZAUZKW093269
Colour:	Blue	Odometer:	11786 km
Engine Capacity:	1395 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	225/45 R17	Rear Tyre Size:	225/45 R17
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,660.51	1,270.37	390.14	23.50
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,570.00	870.00	700.00	44.59
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (\$\$)</b>	<b>3,230.51</b>	<b>2,140.37</b>	<b>1,090.14</b>	<b>33.75</b>
<b>Approved Total (Overridden) (\$\$)</b>		<b>1,700.00</b>		
<b>(\$\$)</b>	3,230.51	1,700.00	1,530.51	47.38
<b>+ GST 7.00/7.00% (\$\$)</b>	226.14	119.00	107.14	47.38
<b>Nett Amount (\$\$)</b>	<b>3,456.65</b>	<b>1,819.00</b>	<b>1,637.65</b>	<b>47.38</b>
<b>+ Loss of Use (2.0 x S\$60.00/day) (\$\$)</b>		120.00		
<b>Nett Liability (\$\$)</b>		<b>1,939.00</b>		

### INSPECTION

Date of Assignment: 28/05/2020

Date Inspected: 28/05/2020 Inspected At:

Jin Auto Services Pte Ltd (Defu)  
Blk 14 Defu Lane 10, #01-410/412  
Singapore 539195

Estimated Period of Repair: 2.0 days

**Adjuster:** MARCUS CHUA**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deep Cut	1,600.51 FL	*1,287.23 FL
2	1		*REAR BUMPER SIDE RETAINER	Serviceable	70.40 FL	*- FL
3	1		*REAR BUMPER CLIPS (7 PCS)	Necessary	77.00 FL	*50.00 FL
					<b>Sub Total (\$\$)</b>	<b>1,747.91</b>
					<b>- List Item Discount on L Items 5.00/5.00% (\$\$)</b>	<b>87.40</b>
					<b>Total Parts (\$\$)</b>	<b>1,660.51</b>
						<b>1,270.37</b>

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Labour Items</u></b>				
1	TUFF KOTE	New	80.00	0.00
2	LABOUR CHARGE	New	680.00	300.00
3	REMOVE AND REFIX SENSOR	New	80.00	50.00
4	SPRAY PAINTING	New	700.00	500.00
5	WIRING	New	30.00	20.00
<b>Gross Labour Cost (\$)</b>			<b>1,570.00</b>	<b>870.00</b>

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**