

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC3/AXA16003137/KEA3Q2-1

**Date:** 26/03/2021

### REFERENCE

Handling Insurer: AXA Insurance Pte Ltd

Policy No:

P1651321

**Claimant**

**Vehicle No :** SHF655J

**Insured Vehicle No :**

SKL3728X

Date of Loss: 17/02/2016

Nature of Claim:

TP

Claim No: C0372759

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHF655J**

Make & Model: RENAULT LATITUDE, 2.0 D dCi (A)

Engine No: M9R8839C001644

Reg. Date: 30/06/2014 (Man. Year: 2014)

Chassis No: VF1ABL15AUC278397

Colour: Metallic White/Red

Odometer: 213059 km

Engine Capacity: 1995 cc

Market Value/New Car

Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good

Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable):

Yes

Engine Modification:

No

Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 215/60R16

Rear Tyre Size:

215/60R16

Front Left Side: Rovel 9 mm

Rear Left Side:

Falken 7 mm

Front Right Side: Rovel 9 mm

Rear Right Side:

Falken 7 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	32,222.97	6,108.38	26,114.59	81.04
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,950.00	1,610.00	7,340.00	82.01
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>41,172.97</b>	<b>7,718.38</b>	<b>33,454.59</b>	<b>81.25</b>
<b>+ GST 7.00/7.00% (\$\$)</b>	2,882.11	540.29	2,341.82	81.25
<b>Nett Amount (\$\$)</b>	<b>44,055.08</b>	<b>8,258.67</b>	<b>35,796.41</b>	<b>81.25</b>
<b>+ Loss of Use (9.0 x S\$50.00/day) (\$\$)</b>		450.00		
<b>+ Car Rental (9.0 x S\$132.68/day) (\$\$)</b>		1,194.12		
<b>(\$\$)</b>		9,902.79		
<b>Liabile Amount (50.00%) (\$\$)</b>		<b>4,951.40</b>		
<b>+ Doc/Search Fee (\$\$)</b>		6.00		
<b>Nett Liability (\$\$)</b>		<b>4,957.40</b>		
<b>Global Sum Settlement (\$\$)</b>		<b>5,000.00</b>		

### INSPECTION

Date of Assignment: 19/02/2016

Date Inspected: 18/02/2016 Inspected At:

Trans-cab Auto Services Pte Ltd (Ang Mo Kio)  
2, Ang Mo Kio Street 63  
Singapore 569111

Estimated Period of Repair: 5.0 days

---

**Adjuster:** KENNETH KONG

**Manager:** Asher Sng Rong Yi

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

(REPAIR COST NOT CONCLUDE)

(EXCLUDE CHECK ITEMS S\$1,770.34 NETT)

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 04 Feb 2021)
<b>Parts:</b>	143	RENAULT LATITUDE 2.0 D dCi (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SHF655J)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER COVER FRT (CONSISTENT)	Cracked	968.79 FL	*968.79 FL
2	1		*BUMPER SPOILER FRT (CONSISTENT)	Torn	139.81 FL	*139.81 FL
3	1		*BUMPER ABSORBER FRT (CONSISTENT)	Torn	303.60 FL	*303.60 FL
4	1		*BUMPER BRACKET FRT LH (HEADLAMP LOWER) (CONSISTENT)	Cracked	116.47 FL	*116.47 FL
5	1		*BUMPER RETAINER FRT LH (CONSISTENT)	Distorted	18.37 FL	*18.37 FL
6	1		*BUMPER BRACKET FRT RH (HEADLAMP LOWER) (CONSISTENT)	Serviceable	115.98 FL	*- FL
7	1		*BUMPER RETAINER FRT RH (CONSISTENT)	Serviceable	18.37 FL	*- FL
8	1		*BUMPER UNDERTRAY FRT (CONSISTENT)	Serviceable	363.71 FL	*- FL
9	1		*BUMPER GRILLE LOWER FRT (CONSISTENT)	Distorted	205.23 FL	*205.23 FL
10	1		*BUMPER FOG LAMP GRILLE LH (CONSISTENT)	Distorted	159.39 FL	*159.39 FL
11	1		*BUMPER FOG LAMP GRILLE RH (CONSISTENT)	Serviceable	159.39 FL	*- FL
12	1		*BUMPER BEAM FRT (CONSISTENT)	Bent	703.14 FL	*703.14 FL
13	1		*RADIATOR GRILLE (CONSISTENT)	Not Necessary	1,313.68 FL	*- FL
14	1		*RADIATOR GRILLE BADGE RENAULT (CONSISTENT)	Not Necessary	173.36 FL	*- FL
15	1		*RADIATOR GRILLE FRAME (CONSISTENT)	Cracked	1,041.35 FL	*1,041.35 FL
16	1		*FRAME FULL SUPPORT PANEL (CONSISTENT)	Repair	473.77 FL	*- FL
17	1		*FRAME FULL SUPPORT BRACKET (CONSISTENT)	Repair	69.07 FL	*- FL
18	1		*FRONT BRACE PANEL (CONSISTENT)	Repair	136.32 FL	*- FL
19	1		*SUBFRAME OUTER FRT (CONSISTENT)	Serviceable	2,040.34 FL	*- FL
20	1		*HEADLAMP LH (CONSISTENT)	Cracked	911.10 FL	*911.10 FL
21	1		*HEADLAMP RH (CONSISTENT)	Serviceable	911.10 FL	*- FL
22	1		*HEADLAMP PANEL FRT RH (CONSISTENT)	Repair	134.59 FL	*- FL
23	1		*HEADLAMP PANEL FRT LH (CONSISTENT)	Repair	134.59 FL	*- FL
24	1		*BONNET (CONSISTENT)	Bent	1,493.56 FL	*1,493.56 FL
25	1		*BONNET INSULATOR (CONSISTENT)	Serviceable	312.10 FL	*- FL
26	1		*BONNET HINGE LH (CONSISTENT)	Repair	267.93 FL	*- FL
27	1		*BONNET HINGE RH (CONSISTENT)	Repair	267.93 FL	*- FL
28	2		*BAL HOOD (CONSISTENT)	Serviceable	75.60 FL	*- FL
29	1		*BONNET LOCK (CONSISTENT)	Repair	234.99 FL	*- FL
30	1		*BONNET SEAL OUTER (CONSISTENT)	Serviceable	71.04 FL	*- FL
31	1		*FENDER PANEL FRT LH (CONSISTENT)	Bent	602.95 FL	*602.95 FL
32	1		*FENDER PANEL FRT RH (CONSISTENT)	Repair	602.95 FL	*- FL
33	1		*FENDER WHEELARCH FRT LH (LINNER) (CONSISTENT)	Serviceable	107.32 FL	*- FL
34	1		*FENDER WHEELARCH FRT RH (LINNER) (CONSISTENT)	Serviceable	214.49 FL	*- FL
35	1		*FENDER PANEL BRACKET FRT RH (CONSISTENT)	Repair	161.52 FL	*- FL
36	1		*FENDER PANEL BRACKET FRT LH (CONSISTENT)	Repair	161.52 FL	*- FL
37	1		*RADIATOR (CONSISTENT)	Serviceable	924.77 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
38	1		*RADIATOR FAN COWLING L70Y (CONSISTENT)	Serviceable	525.99 FL	*- FL
39	1		*RADIATOR FAN MOTOR LH L70Y (CONSISTENT)	Serviceable	620.10 FL	*- FL
40	1		*RADIATOR FAN MOTOR RH L70Y (CONSISTENT)	Serviceable	948.37 FL	*- FL
41	1		*RADIATOR TANK (CONSISTENT)	Serviceable	208.09 FL	*- FL
42	1		*RADIATOR HOSE UPPER (CONSISTENT)	Serviceable	154.20 FL	*- FL
43	1		*RADIATOR HOSE LOWER (CONSISTENT)	Serviceable	314.86 FL	*- FL
44	1		*WATER HOSE PUMP (CONSISTENT)	Serviceable	439.00 FL	*- FL
45	1		*RADIATOR TANK HOSE (CONSISTENT)	Serviceable	39.22 FL	*- FL
46	1		*AIR CLEANER HOSE (CONSISTENT)	Serviceable	58.57 FL	*- FL
47	1		*AIR CLEANER LOWER (CONSISTENT)	Serviceable	311.95 FL	*- FL
48	1		*ENGINE UNDERTRAY (CONSISTENT)	Serviceable	434.60 FL	*- FL
49	1		*A/C CONDENSER (CONSISTENT)	Serviceable	1,554.13 FL	*- FL
50	1		*A/C CONDENSER GARNISH LH UPPER (CONSISTENT)	Serviceable	24.12 FL	*- FL
51	1		*A/C CONDENSER GARNISH RH UPPER (CONSISTENT)	Serviceable	24.12 FL	*- FL
52	1		*A/C CONDENSER GARNISH LH (CONSISTENT)	Serviceable	35.76 FL	*- FL
53	1		*A/C CONDENSER GARNISH RH (CONSISTENT)	Serviceable	36.24 FL	*- FL
54	1		*AIR INTERCOOLER (CONSISTENT)	Serviceable	852.66 FL	*- FL
55	1		*AIR INTERCOOLER HOSE (LONG) (CONSISTENT)	Serviceable	616.68 FL	*- FL
56	1		*AIR INTERCOOLER HOSE (SHORT) (CONSISTENT)	Serviceable	228.12 FL	*- FL
57	1		*STEERING PUMP ELECTRIC (CONSISTENT)	Serviceable	1,543.08 FL	*- FL
58	1		*STEERING HOSE LOW PRESSURE LONG (CONSISTENT)	Serviceable	442.50 FL	*- FL
59	1		*STEERING HOSE LOW PRESSURE (CONSISTENT)	Serviceable	247.18 FL	*- FL
60	1		*WINDSCREEN FRT (CONSISTENT)	Serviceable	1,327.34 FL	*- FL
61	1		*WIPER RESERVOIR (CONSISTENT)	Serviceable	190.96 FL	*- FL
62	1		*WIPER RESERVOIR NECK (CONSISTENT)	Serviceable	27.78 FL	*- FL
63	1		*WIPER RESERVOIR MOTOR (CONSISTENT)	Serviceable	100.95 FL	*- FL
64	1		*DOOR FRT RH (CONSISTENT)	Repair	2,188.20 FL	*- FL
65	1		*DOOR MIRROR RH (CONSISTENT)	Serviceable	1,141.08 FL	*- FL
66	1		*DOOR SEAL FRT RH (CONSISTENT)	Serviceable	50.92 FL	*- FL
67	1		*DOOR FRT LH (CONSISTENT)	Repair	2,188.20 FL	*- FL
68	1		*DOOR MIRROR LH (CONSISTENT)	Serviceable	1,141.08 FL	*- FL
69	1		*SET RADIATOR GRILLE FRAME CLIP (CONSISTENT)	Not Necessary	52.00 FS	*- FS
70	1		*SET BUMPER CLIP FRT (CONSISTENT)	Necessary	66.00 FS	*66.00 FS
71	1		*TOW COVER FRT (CONSISTENT)	Serviceable	14.50 FS	*- FS
72	1		*SET RADIATOR GRILLE SCREW (CONSISTENT)	Not Necessary	16.00 FS	*- FS
73	1		*SET BUMPER GRILLE LOWER CLIP (CONSISTENT)	Not Necessary	69.00 FS	*- FS
74	1		*SET FRAME FULL SUPPORT PANEL CLIP (CONSISTENT)	Not Necessary	70.00 FS	*- FS
75	2		*FRAME FULL SUPPORT PANEL NUT (CONSISTENT)	Not Necessary	20.00 FS	*- FS
76	2		*FRAME FULL SUPPORT PANEL STUD (CONSISTENT)	Not Necessary	30.00 FS	*- FS
77	2		*BONNET CABLE CLIP (CONSISTENT)	Not Necessary	6.40 FS	*- FS
78	1		*SET WHEELARCH CLIP FRT LH (CONSISTENT)	Not Necessary	30.50 FS	*- FS
79	1		*SET WHEELARCH CLIP FRT RH (CONSISTENT)	Not Necessary	29.40 FS	*- FS
80	1		*DOOR STICKER TRANS-CAB LH (CONSISTENT)	Not Necessary	80.00 FS	*- FS
81	1		*DOOR STICKER CLASSIC LH (CONSISTENT)	Not Necessary	30.00 FS	*- FS
82	1		*DOOR STICKER TRANS-CAB RH (CONSISTENT)	Not Necessary	80.00 FS	*- FS
83	1		*DOOR STICKER CLASSIC RH (CONSISTENT)		30.00 FS	*- FS
Report was unsubmitted during this print-out.						

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
				Not Necessary		
84	1		*DASHBOARD SCREW (CONSISTENT)	Serviceable	55.55 FS	*- FS
85	1		*CAP HUB LH FRT (CONSISTENT)	Serviceable	35.00 FS	*- FS
86	1		*RIM LH FRT (CONSISTENT)	Serviceable	385.00 FS	*- FS
87	1		*TYRE LH FRT (CONSISTENT)	Serviceable	330.00 FS	*- FS
88	1		*SET FRONT LICENCE PLATE WITH HOLDER (CONSISTENT)	Dented	80.00 FS	*45.00 FS
F=Franchise part. S=SpcNett. L=ListItemDisc.						
					<b>Sub Total (\$\$)</b>	<b>35,635.59</b>
					<b>6,774.76</b>	
					<b>- List Item Discount on L Items 10.00/10.00% (\$\$)</b>	<b>3,412.62</b>
						<b>666.38</b>
					<b>Total Parts (\$\$)</b>	<b>32,222.97</b>
						<b>6,108.38</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Labour Items</u></b>				
1	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME.	New	2,800.00	600.00
2	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.	New	3,000.00	880.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS.	New	170.00	60.00
4	TOWING FEES.	New	120.00	50.00
5	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	New	220.00	0.00
6	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	New	170.00	0.00
7	TO DISMANTLE AND REFIT FRONT END SUSPENSION, UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.	New	380.00	0.00
8	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	New	440.00	0.00
9	TO CHECK ABS BRAKE EFFICIENCY, FINAL CHECKING AND TESTING.	New	380.00	0.00
10	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.	New	380.00	0.00
11	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.	New	170.00	0.00
12	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.	New	170.00	0.00
13	TO DISMANTLE AND REFIT INETRIOR ASSY AND ATTACHMENT, VACUUM AND CHARGE-IN-GAS.	New	380.00	0.00
14	TO CHECK ELECTRICAL LIGHTING CONCERNED.	New	170.00	20.00
<b>Gross Labour Cost (\$\$)</b>			<b>8,950.00</b>	<b>1,610.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >