



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL  
(BUDGET DIRECT INSURANCE)  
190 CLEMENCEAU AVENUE #03-01  
SINGAPORE SHOPPING CENTRE  
SINGAPORE 239924

INV No. AC2003995  
INV Date 18/05/2020  
Reference CS/AGI20005641/Evf3n2  
Code AGI



### PROFESSIONAL SERVICE FEE

Vehicle No. SML 9408G

Insured Veh. SGQ 1697K

Claim No. C10006289

Policy No.

Accident Date 07/05/2020

Inspection Date 11/05/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>450.00</b>
<b>GST (7%)</b>	<b>31.50</b>
<b>Grand Total</b>	<b>481.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

*HYN*



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20005641/Evf3n2

(BUDGET DIRECT INSURANCE)

190 CLEMENCEAU AVENUE #03-01

SINGAPORE SHOPPING CENTRESINGAPORE

239924

Date : 18-05-2020



Code : AGI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SGQ 1697K	<b>Veh. Inspected</b>	SML 9408G
<b>Policy No.</b>		<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	C10006289	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	STANLEY LAI	<b>Assign Date</b>	11/05/2020

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA PRIUS PLUS	<b>c.c</b>	1798
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2019
<b>Chassis No.</b>	JTDZS3EU70J038298	<b>Colour</b>	BLUE
<b>Odometer</b>	73677	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	205/60 R16	WANLI	6 mm
<b>L/H Front Tyre</b>	205/60 R16	WANLI	6 mm
<b>R/H Rear Tyre</b>	205/60 R16	WANLI	6 mm
<b>L/H Rear Tyre</b>	205/60 R16	WANLI	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

### 5. General Information

<b>Accident Date</b>	07/05/2020	<b>Inspection Date</b>	11/05/2020
<b>Survey held at</b>	MY CAR CONSULTANT PTE LTD 53 UBI AVENUE 1 #01-33 PAYA UBI INDUSTRIAL PARK SINGAPORE 408934		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	<b>5 Working Days</b>
-------------------------------------	-----------------------

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

**ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SML 9408G**

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	REAR BUMPER	BROKEN	630.54	523.90
1	REAR BUMPER SIDE RETAINER LH	BROKEN	113.60	113.60
1	REAR BUMPER SIDE RETAINER RH	BROKEN	113.60	113.60
1	REAR BUMPER REINFORCEMENT	BENT	350.50	350.50
1	REAR BUMPER BRACKET LH	BENT	115.30	115.30
1	REAR BUMPER BRACKET RH	BENT	115.30	115.30
1	REAR BUMPER LIP	CUT	728.90	728.90
1	REAR BUMPER REFLECTOR LH	NOT NECESSARY	80.60	-
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	80.60	-
1	REAR TAILGATE	DENTED	1,180.60	929.00
1	REAR TAILGATE LOCK	BENT	361.10	361.10
1	REAR TAILGATE LOCK CATCH	NOT NECESSARY	89.50	-
1	REAR TAILGATE LOCK SENSOR	NOT NECESSARY	360.90	-
1	REAR TAILGATE LOCK OUTER HANDLER	NOT NECESSARY	127.60	-
1	REAR TAILGATE INNER TRIM BOARD	CRUSHED	428.20	428.20
1	REAR TAILGATE INNER TRIM INSULATOR	NECESSARY	348.60	243.60
1	REAR TAILGATE INNER SIDE TRIM BOARD LH	NOT NECESSARY	119.70	-
1	REAR TAILGATE INNER SIDE TRIM BOARD RH	NOT NECESSARY	119.70	-
1	REAR TAILGATE OUTER GARNISH	NOT NECESSARY	228.30	-
1	REAR TAILGATE LOGO	NOT NECESSARY	95.50	-
1	REAR TAILGATE EMBLEM PRIUS	NECESSARY	89.40	50.00
1	REAR TAILGATE EMBLEM HYBRID	NECESSARY	82.30	52.30
1	REAR NUMBER PLATE LAMP LH	NOT NECESSARY	78.40	-
1	REAR NUMBER PLATE LAMP RH	NOT NECESSARY	78.40	-
1	REAR TAILGATE WIRE HARNESS	NOT NECESSARY	998.40	-
1	REAR TAILLAMP RH	BROKEN	690.50	630.00
1	REAR TAILLAMP INNER PANEL RH	TO REPAIR SEE LABOUR	280.40	-
1	REAR TAILLAMP LOWER BRACKET RH	BROKEN	89.10	68.00
1	REAR TAILLAMP CLIPS RH	NOT NECESSARY	9.80	-
1	REAR TAILLAMP LH	NOT NECESSARY	690.50	-

Report Ref No. CS/AGI20005641/Evf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TAILLAMP INNER PANEL LH	NOT NECESSARY	280.40	-
1	REAR TAILLAMP LOWER BRACKET LH	BROKEN	89.10	68.00
1	REAR TAILLAMP CLIPS	NOT NECESSARY	9.80	-
1	REAR FENDER LH	NOT NECESSARY	850.30	-
1	REAR TOOLS SPONGE	TORN	680.40	230.00
1	REAR KEYLESS SENSOR	BROKEN	169.50	169.50
1	REAR KEYLESS SENSOR WIRE HARNESS	NOT NECESSARY	438.60	-
1	REAR END PANEL	DENTED	660.20	660.20
1	REAR END PANEL TOP GARNISH	DEFORMED	225.10	225.10
1	REAR SPARE TYRE COMPARTMENT	TO REPAIR SEE LABOUR	694.30	-
1	REAR BUMPER LOWER COVER	DEFORMED	179.00	179.00
1	REAR TOOLS TOP COVER	BROKEN	518.30	396.70
1	BOOTLID RUBBER	TORN	196.00	196.00
	LESS 25% DISCOUNT		-3,466.71	-1,736.95
			10,400.13	5,210.85
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SET REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	80.00	20.00
1	SET REAR TAILGATE OUTER GARNISH CLIPS (SN)	NOT NECESSARY	80.00	-
1	REAR CAMERA (SN)	NOT NECESSARY	350.00	-
1	REAR REVERSE SENSOR (SN)	NECESSARY	250.00	200.00
1	SET REAR FENDER INNER TRIM BOARD CLIPS LH (SN)	NOT NECESSARY	80.00	-
1	SET REAR FENDER INNER TRIM BOARD CLIPS RH (SN)	NOT NECESSARY	80.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	80.00	10.00
1	SET REAR END PANEL SEALANT (SN)	NECESSARY	60.00	30.00
1	SET REAR FLOOR PANEL SEALANT (SN)	NOT NECESSARY	60.00	-
1	REAR WINDSCREEN GLASS SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	60.00	-
			1,320.00	350.00

Report Ref No. CS/AGI20005641/Evf3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	PANEL BEATING ON AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF REAR TAILLAMP INNER PANEL RH AND REAR SPARE TYRE COMPARTMENT		1,800.00	800.00
	TO CHECK REAR ELECTRICAL WIRING.		80.00	30.00
	TO REMOVE AND RENEW REVERSE SENSOR.		150.00	30.00
	TO REMOVE AND RENEW REAR REVERSE CAMERA.		150.00	30.00
	TO REMOVE AND TRANSFER WINDSCREEN GLASS.		150.00	120.00
	REMOVE AND RENEW REAR GARNISH/UPHOLSTERY.		200.00	50.00
	TO RESPRAY UNDERCOATING.	NOT NECESSARY	150.00	-
	APPLY ANTI RUST ON AFFECTED AREAS.		200.00	30.00
	SPRAY PAINTING ON AFFECTED AREAS.		1,200.00	600.00
			4,080.00	1,690.00
<b>GRAND TOTAL</b>			<b>15,800.13</b>	<b>7,250.85</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>5,800.00</b>

Report Ref No. CS/AGI20005641/Evf3n2

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.