



INSURER:

Lonpac Insurance Bhd (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (Own Damage)	Ref. No:	
Policy No:	Z20VCD5004764	Date of Loss:	00/00/20
Vehicle Reg. No.:	YP620E	Driveable?	
Driver Age/Info:	50 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	YES	Third Party Involved:	
Insured/Claimant:	SHANGHAI TUNNEL ENGINEERING CO (SINGAPORE) PTE LTD		
Driver:	MARAN GOKULA RAMANA		
Make/Model:	ISUZU NJR85AUE6W, 3.0 D (M)	Vehicle Reg. Date:	23/12/2015
Vehicle Colour:	White		
Engine No:	4JJ12F2914	Chassis No:	JAANJR85EF7100041
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	28		
Description of Accident/Loss	PLEASE SEE POLICE REPORT.		
Present Location:	S & H MOTOR PTE LTD (SIN MING)		

COST OF CLAIMS

	Amount
Parts	
Miscellaneous Items	10,808.85
Labour	12,300.00
Paintwork Labour	5,660.00
Towing	0.00
	0.00
Gross Total (S\$)	28,768.85
+ GST 7.00% (S\$)	2,013.82
Nett Amount (S\$)	30,782.67

This claim is handled by: LUM WEE KEAT

Generated using Merimen e-Claims Internet Estimation & Adjusting System

Parts

No.	Particulars	%Disc	%Depr	Amount
	*Front windscreen <i>CRA</i>	0.00	0.00	*850.00 F
	*Front windscreen moulding <i>MC</i>	0.00	0.00	*190.00 F
	*Front panel "ISUZU" emblem <i>WA</i>	0.00	0.00	*155.00 F
	*Front grille assembly <i>Dis</i>	0.00	0.00	*350.00 F
	*RH head lamp <i>Dis</i>	0.00	0.00	*385.00 F
	*LH head lamp <i>Dis</i>	0.00	0.00	*385.00 F
	*RH signal lamp <i>Dis</i>	0.00	0.00	*195.00 F
	*LH signal lamp <i>Dis</i>	0.00	0.00	*195.00 F
	*Front bumper <i>BT</i>	0.00	0.00	*450.00 F
	*LH front bumper lamp <i>Dis</i>	0.00	0.00	*115.00 F
	*Front bumper bottom dust panel <i>CRA</i>	0.00	0.00	*140.00 F
	*RH front door window glass <i>Dis</i>	0.00	0.00	*240.00 F
	*RH front door window glass outer moulding <i>See</i>	0.00	0.00	*180.00 F
	*RH front door window glass inner moulding <i>See</i>	0.00	0.00	*165.00 F
	*RH front door front black garnish <i>See</i>	0.00	0.00	*220.00 F
	*RH front door bottom garnish <i>See</i>	0.00	0.00	*125.00 F
	*LH front door signal lamp <i>CRA</i>	0.00	0.00	*135.00 F
	*LH front door window glass <i>See</i>	0.00	0.00	*240.00 F
	*LH front door window glass outer moulding <i>See</i>	0.00	0.00	*180.00 F
	*LH front door window glass inner moulding <i>See</i>	0.00	0.00	*165.00 F
	*LH front door front black garnish <i>See</i>	0.00	0.00	*180.00 F
	*LH front door front black garnish <i>See</i>	0.00	0.00	*220.00 F
	*LH front door bottom garnish <i>See</i>	0.00	0.00	*125.00 F
	*RH front wheel cowling <i>See</i>	0.00	0.00	*160.00 F
	*RH front wheel cowling clips (1 set) <i>See</i>	0.00	0.00	*22.00 F
	*LH front wheel cowling <i>NN</i>	0.00	0.00	*160.00 F
	*LH front wheel cowling clips (1 set) <i>NN</i>	0.00	0.00	*22.00 F
	*LH rear wheel cowling <i>See</i>	0.00	0.00	*125.00 F
	*RH front wheel bearing <i>See</i>	0.00	0.00	*160.00 F
	*LH front wheel bearing <i>See</i>	0.00	0.00	*160.00 F
	*Front stabilizer bar <i>NN</i>	0.00	0.00	*240.00 F
	*RH front stabilizer bar <i>NN</i>	0.00	0.00	*140.00 F
	*LH front stabilizer bar <i>NN</i>	0.00	0.00	*140.00 F
	*RH front shock absorber <i>See</i>	0.00	0.00	*140.00 F
	*LH front shock absorber <i>See</i>	0.00	0.00	*140.00 F
	*RH steering tie rod <i>BT</i>	0.00	0.00	*180.00 F
	*LH steering tie rod <i>BT</i>	0.00	0.00	*180.00 F
	*RH steering tie rod end <i>BT</i>	0.00	0.00	*95.00 F
	*LH steering tie rod end <i>BT</i>	0.00	0.00	*95.00 F
	*Air con condensor <i>Dis</i>	0.00	0.00	*480.00 F
	*Air con condensor support bracket <i>BT</i>	0.00	0.00	*140.00 F
	*Air con condensor auto fan <i>CRA</i>	0.00	0.00	*450.00 F
	*RH rear wheel bearing <i>See</i>	0.00	0.00	*90.00 F
	*LH front sun visor <i>See</i>	0.00	0.00	*115.00 F
	*Engine air cleaner box <i>CRA</i>	0.00	0.00	*380.00 F

Sub Total (S\$)

9 399.00

+ Margin on L,N Items 15.00% (S\$)

1,409.85

Total Parts (S\$)

10,808.85

te Ltd/YP620E/11/05/2020 18:08. Not valid without Reference section.
Generated using **Merlmen e-Claims IEAS**

mates on Miscellaneous Items

Qty	Particulars	Amount
<u>Miscellaneous Items</u>		
1	Engine coolant / <i>McC.</i>	40.00
1	Front number plate / <i>BT</i>	15 45.00
1	Front windscreen inner rubber seal / <i>McC.</i>	40 95.00
1	Front windscreen sealant /	20 80.00
1	LH front tyre / <i>Pun</i>	60 180.00
1	RH front tyre /	60 180.00
1	RH rear outer tyre / <i>Cut</i>	60 180.00
1	Towing (to flip lorry upright and tow to workshop) - <i>Bill</i>	NN X 350.00
1	Used front cabin	6000 7 8,000.00
1	Used LH front control arm <i>BT</i>	600.00
1	Used LH front knuckle arm / <i>BT</i>	300.00
1	Used LH front upper arm <i>BT</i>	250.00
1	Used LH front wheel rim / <i>BT</i>	80 200.00
1	Used RH drive shaft <i>NN</i>	250.00
1	Used RH front control arm <i>BT</i>	600.00
1	Used RH front knuckle arm / <i>BT</i>	300.00
1	Used RH front upper arm <i>BT</i>	250.00
1	Used RH front wheel rim / <i>Cut</i>	80 200.00
1	Used RH rear wheel rim / <i>BT</i>	80 200.00
Sub Total (S\$)		12,300.00

Estimates on Labour

No Particulars

Labour Items

		Lab Type	Amount
1	To remove and install dashboard and centre console, including instrument panel, radio, climate control module	New	200 200.00
2	To remove and reinstall air con blower box, air con condenser, dryer, aluminium pipes, valves and reinstall components and vacuum and charge refrigerant R134a and check for leakage and full functionality	New	120 180.00
3	To remove and reinstall front windscreen and conduct water leak test	New	✓ 120.00
4	To repair and reshape LH side cargo aluminium roof top, and replace aluminium panel	NN New	X 380.00
5	To remove and install rear differential and RH rear drive shaft. To check for damage and replace damaged parts	New	200 380.00
6	To remove and check RH & LH front suspension system, front cross member and replace damaged parts	New	500 550.00
7	To perform computerised wheel alignment	New	60 80.00
8	To remove and install Roof lining, front seats, front door trims, and pillar trims	New	80 250.00
9	To remove and check engine, gearbox, radiator, engine & gearbox mountings, intake and exhaust manifold & for damage and reinstall components and check engine running functionality	80 New	→ 320.00
10	To remove front damaged parts, to replace front cabin, and cut out damaged parts, to straighten out front chassis, to repair and reshape front chassis member, to remove and replace all front cabin parts and adjust body panel alignment	New	1000 1,200.00
11	To disconnect wire harness to facilitate repairs and check for damage and reconnect wiring system and check for full functionality. To focus headlamp	New	30 120.00
12	To spray paint affected front and rear and inner damaged portion inclusive of preparatory works and material	New	600 1,800.00

Gross Labour Cost (S\$) 5,660.00

S & H Motor Pte Ltd/YP620E/11/05/2020 18:08. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Workshop: 160 Sin Ming Drive #01-02 Sin Ming AutoCity, Sin Ming EP75722 Tel: 6453 4730 Fax: 6457 1931 E-mail: shmotor@singnet.com.sg
Co. Reg. No. 198701022K GST Reg. No. M2-0076265-0

14 Days
Unpym repair
After repair
Not Authorised.
Excess \$700

Gino Qiang
82880282

Gino Qiang @ lkk auto. com
12/5/2020

LKK Auto City/Insurance house notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary part(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: