

Report No: 0342-19-JK

05 July 2019

ACCIDENT VEHICLE SURVEY REPORT

Jit Keong Trading Co
28 Benoi Place
Singapore 629945

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	YM7689C	<i>Odometer:</i>	676781km
<i>Make & Model:</i>	Mitsubishi Fuso	<i>Colour:</i>	White
<i>Chassis number:</i>	FE83BEA10462	<i>Date of accident:</i>	17/06/2019
<i>Year of Regn.:</i>	28/12/2007	<i>Date inspected:</i>	18/06/2019
<i>Repairer at:</i>	Jit Keong Trading Co 28 Benoi Place Singapore 629945	<i>Date inspected (After Repair):</i>	01/07/2019

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	6mm/Asumina	6mm/Asumina	7.00-16
<i>Rear:x2</i>	6mm/Westlake	6mm/Westlake	185R14

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front LH portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No: 0342-19-JK

Vehicle No: YM7689C

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Front bumper	1	bent	1,044.96	1,044.96 986
Front bumper bracket RH/LH	2	bent LH bent, RH X NA	332.82	332.82 166.81
Front corner side panel LH	1	dented	329.57	329.57
Front corner side panel LH	1	fractured	82.05	82.05
Front grille	1	fractured	485.50	485.50
Front grille emblem "Fuso"	1	necessary	127.23	127.23
Front grille logo "Mitsubishi"	1	necessary	67.77	67.77
Front grille bracket	1	bent	130.00	130.00
Front grille clip	8	necessary	52.00	52.00
Front panel	1	buckled	1,580.67	1,580.67
Front headlamp LH	1	fractured	768.05	768.05 X damage No
Front headlamp clip LH	4	necessary	26.00	26.00 X photo
Front headlamp lower rubber seal LH	1	deformed	18.15	18.15 X
Front headlamp panel LH	1	repair	139.15	0.00
Front mirror arm garnish LH	1	fractured	70.43	70.43
Front round mirror LH	1	abraded	65.83	65.83
Front side mirror LH	1	abraded	113.9	113.90 X
Front side mirror arm LH	1	bent	484.96	484.96 X
Front side mirror arm cover LH	1	fractured	14.52	14.52 X
Front side mirror back cover LH	1	fractured	21.54	21.54 X No
Front mirror arm garnish clip LH	1	necessary	6.50	6.50 X damage
Front side lamp LH	1	fractured	159.75	159.75 X photo
Front side lamp clip LH	3	necessary	19.50	19.50 X
Front signal lamp LH	1	fractured	227.65	227.65
Front signal lamp clip LH	4	necessary	26.00	26.00
Front windscreen rubber moulding	1	necessary	412.18	412.18
Subtotal before discount			6,806.68	6,667.53 7809.69
Percentage discount	0%	and 10%	0.00	666.75 4328.72
Sub-total 1			6,806.68	6,000.78
Front number plate	1	bent	25.00	25.00 X SVC
Front windscreen sealant	1	necessary	100.00	100.00
Subtotal before discount			125.00	125.00 100
Percentage discount	0%	and 0%	0.00	0.00
Sub-total 2			125.00	125.00
Parts-total			6,931.68	6,125.78

LABOUR

1. To straighten and panel beating front door pillar LH, front panel inner panel and front LH frame members. To cut and weld front outer panel. To remove and refit above parts.
2. To putty, re-spray painting and polish affected areas.
3. To remove and refit aircon system and recharge gas to assist repair.
4. To remove and refit front windscreen
5. To remove and refit front dashboard.
6. To check and rectify wiring system.
7. To rust proof affected areas.

1,500.00	1,250.00	1000
		700
1,500.00	1,000.00	
200.00	150.00	
200.00	120	150.00
300.00	n X	250.00
80.00	30	50.00
120.00	30	60.00

Labour total	3,900.00	2,910.00
Parts & Labour total	10,831.68	9,035.78

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based repairs is :
and the recommended number of working days for the repairs is :

1880
6308.72
4/5 \$5050
\$7,200.00 7 days

8


B J Loi (I Eng. MIMI, AIRTE)
Automotive Appraiser