MOVA Automotive Pte Ltd Blk 1008, Bukit Merah Lane 3, #01-04/06/08. Singapore 159722

Insurer Reference: Full Report

Repairer Reference: CK138236 Registration: SLJ1011S Date calculated: 17/06/2020 4:44 PM Printed: 17/06/2020 4:44 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: ERGO Insurance Pte Ltd

Printed by: GOH CHAI HOCK Currency: SGD
Claim Reference: Date of Incident: 10/05/20

Estimated Repair Time: Hire Car Start: Actual Repair Days: Hire Car End:

Vehicle Details

Vehicle

Manufacturer: BMW

Model: 7-SERIES F01/02

Sub Model: 730 LI
Model Sheet Number: 01 06 16
Registration: SLJ1011S

VIN number: WBAKB22060C951181

Odometer: **Model Specs**

PREPARE OFF VEHICLE

FROM 03/2011 INTER LIGHT AMBIENCE AIR CON AUTO 4-ZOI DIP/FOLD MIRROR NAVIG-SYST PROFESS HI-FI SPEAKER SYST

AUTO TAILGATE CONTR SOFT CLOSE AUTOMATIC DAKOTA LEATHER TF FRONT COMFORT SEATS SIDE ROLLER BLIND REARVIEW CAMERA

PARK DISTANCE CONT 3.0 LTR 190 KW O2 VOLUME TYRES 245/50 WR 18 WHEELS 8J X 18 ALLOY ELECTRIC SUN

AIR CON AUTO 4-ZONES
HI-FI SPEAKER SYSTEM
DAKOTA LEATHER TRIM
REARVIEW CAMERA

DVD CHANGER
COMFORT ACCESS SYST
LUMBAR SUPPORT
NOBLE WOOD FINELINE

O2 VOLUME INTEGRAL ACTIVE STRG ELECTRIC SUNROOF TWO COAT METALLIC


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

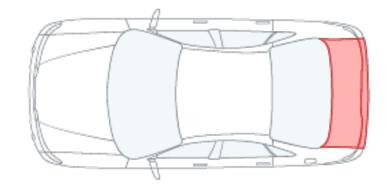

Labour

	Time Base 12 WU/h	Price = 45	5.00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK	2.0	7.50
NO NUMBER	R + R REAR CENTRE FLOOR PANEL COVER	2.0	7.50
51 12 656	R + R REAR BUMPER	8.0	30.00
51 12 552	R + R REAR BUMPER CARRIER (BUMPER REMOVED)	5.0	18.75
51 12 657	RENEW REAR BUMPER TRIM (BUMPER REMOVED)	1.0	3.75
51 12 825	R + R RR CTR BUMPER GUIDE	3.0	11.25
66 20 603	ADD/WORK PARK DISTANCE CONTROL	3.0	11.25
51 46 549	R + R REAR END PANEL COVER	3.0	11.25
51 49 500	R + R TAILGATE TRIM	3.0	11.25
51 13 900)	R + R TAILGATE COVER	2.0	7.50
9852	FAULT MEM AFTER REP READ OUT	20.0*	75.00
2603	REAR BUMPER TRIM REPAIR	10.0*	37.50
2711	REAR PANEL REPAIR	20.0*	75.00
2987	TAILGATE TRIM REPAIR	5.0*	18.75
	Labour Cost	Hrs WU	
	Panel / Mechanical Labour	7.30 87.0	326.25
	Total of Labour		326.25

Paint

Paint Work	SYSTEM AZT Time Basis 10 WU/	
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR BUMPER NEW PART PAINT K1R	14.0
	REAR BUMPER TRIM REPAIR PAINT PLASTIC	10.0

Paint Work	/ork SYSTEM AZT Time Basis	
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR PANEL REPAIR PAINTING <50%	10.0
	TAILGATE TRIM REPAIR PAINT PLASTIC	10.0

Paint Material Per Part

Code	Description	Price SGD
2583	REAR BUMPER NEW PART PAINT K1R	70.36
2603	REAR BUMPER TRIM REPAIR PAINT PLASTIC	10.13
2711	REAR PANEL REPAIR PAINTING <50%	9.37
2987	TAILGATE TRIM REPAIR PAINT PLASTIC	12.15

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	45.00 SGD/h			
Time Paint			44.0	
Preparation Main Work Metal		2.50	25.0	112.50
Preparation Comp. Work Plastic		0.80	8.0	36.00
Total	10 WU/h	7.70	77.0	346.50
Total	12 WU/h	7.70	92.4	346.50

Material Cost - Paint	Price SGD
New Part Painting - Plastic K1R	70.36
Repair Painting	9.37
Repair Painting Plastic	22.28
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	143.31

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2020-06-15 Price SGD
2669 2670 2625 2643 2583 2650 4267 2623	L/INN U-SONIC SENDER R/INN U-SONIC SENDER REAR BUMPER ADAPTER REAR BUMPER CARRIER REAR BUMPER COVER REAR BUMPER MNTG KIT REAR CTR FLOOR COVER RR BUMPER CTR GUIDE	8 66 20 2 180 495 51 12 7 186 826 51 12 7 183 884 51 12 7 209 926 TUSE SINGLE PART R 51 75 7 187 958	Original Original Original Original Original S Original Original Original	200.00 200.00 155.00 600.00 1,400.00 30.00 250.00 120.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Addition(+10.00%) Total			0.00 2,955.00 295.50 3,250.50

Final Calculation

SGD	SGD
2,955.00	
295.50	
	3,250.50
326.25	
	326.25
346.50	
143.31	
	489.81
	4,066.56
	284.66
	4,351.22
	2,955.00 295.50 326.25

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.