

MOTOR STOP PTE LTD
NO 8 KAKI BUKIT AVENUE 4
PREMIER@KAKI BUKIT
#01-07 SINGAPORE 415875
TEL: 93261342
FAX: 64524584

EMAIL: motorstopoffice@gmail.com

Order: R003887
 se: SFY1432C
 31.10.19 12:11

Ford : S-MAX : 01/15- (S-MAX 2015.5) : Front Wheel Drive : Standard Suspension
4-Wheel Total Alignment

Front : Left

Actual	Before	Specified Range
-1°33'	-1°35'	-1°29' 0°01'
2°12'	2°12'	2°39' 4°09'
0°00'	0°00'	0°00' 0°12'
13°06'	13°19'	
11°43'	11°43'	

Camber
 Caster
 Toe
 SAI
 Included Angle
 Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-1°33'	-1°35'	-1°29' 0°01'
2°12'	2°12'	2°39' 4°09'
0°00'	0°00'	0°00' 0°12'
13°12'	13°09'	
12°25'	12°25'	

Front

Cross Camber
 Cross Caster
 Cross SAI
 Total Toe
 Cross Turn Diff.

Actual	Before	Specified Range
-0°35'	-0°51'	
-0°01'	-0°01'	
-0°06'	0°10'	
0°00'	0°00'	0°00' 0°24'

Rear : Left

Actual	Before	Specified Range
-1°57'	-2°01'	-1°57' -0°27'
0°05'	0°05'	0°05' 0°17'

Camber
 Toe

Rear : Right

Actual	Before	Specified Range
-1°57'	-2°01'	-1°57' -0°27'
0°05'	0°05'	0°05' 0°17'

Rear

Cross Camber
 Total Toe
 Thrust Angle

Actual	Before	Specified Range
0°07'	-0°09'	
0°11'	0°11'	0°11' 0°35'
0°02'	0°05'	

AJAX

Inspection Services Pte Ltd

INSPECTION REPORT

MS Car Auto Pte Ltd

8 Kaki Bukit Ave 4 #01-07, Premier @ Kaki Bukit Singapore 415875

Assign Date:	24/10/2019	Inspection Date:	24/10/2019	TP Report Date:	21/10/2019
Accident Date:	20/10/2019	TP Policy No:	P10094939R00	Our Ref:	AVS2019-21317/PN
Place of Inspection:	MS Car Auto Pte Ltd 8 Kaki Bukit Ave 4 #01-07, Premier @ Kaki Bukit Singapore 415875			Your Ref:	SFY1432C
				Claimant:	Irina Teo Su Yen

Description of Vehicle:

Veh. No:	SFY1432C	Make/Model:	Ford S-Max 2.0 GTDI 240PS Auto		
Colour:	Black	Engine No:	BP38701	Sum Insured (\$\$):	Market Value
Engine Capacity:	1,999 cc	Chassis No:	WF0SXXGBWSBP38701	Mkt Value (\$\$):	\$44,000.00
Odometer:	131478	Reg. Date:	23/03/2012		


Condition of Vehicle:

General:	Fair	Modification:	No	Steering:	Serviceable
Air-Conditioner:	Yes	Radio/Cassette/CD:	Yes	Wing Mirror:	Yes
Handbrake:	Serviceable	Footbrake:	Serviceable	Paint work:	Fair
Tyre Make:	Falken				
Front Tyre Size:	225/45R18	Front Left Side:	5mm	Front Right Side:	5mm
Rear Tyre Size:	225/45R18	Rear Left Side:	5mm	Rear Right Side:	5mm

Description of Damage:

The damage was found on the rear and front right portions. The tailgate, both the front and rear bumpers, end panel, right headlamp, lower arm, front right shock absorber were among other parts affected.

Point of Impact:

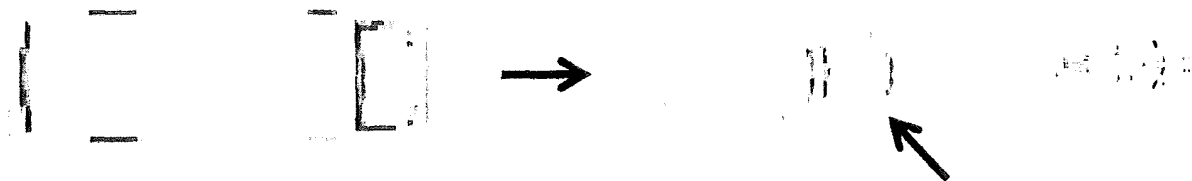

Adjuster:

Patrick Ng
Motor Appraiser

COMPLETED 19 NOV 2019

Date

Note: This report is confidential and solely for the use of the client. The inspection was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R



Inspection Services Pte Ltd

Adjustment of Repair Cost for Vehicle:			SFY1432C	Our Ref: AVS2019-21317/PN	
No.	Qty	Description of Parts	Condition	Repairer's Estimate S\$	Our Recommendation S\$
List Items					
1	1	Tailgate	Repair	2,171.00	--
2	2	Tailgate hinge	Not necessary	374.00	--
3	2	Tailgate damper	Not necessary	390.00	--
4	1	Tailgate outer cover	Damaged	788.00	788.00
5	1	Tailgate outer cover centre emblem	Necessary	54.00	54.00
6	1	Tailgate outer cover side emblem	Necessary	65.00	65.00
7	1	Tailgate "Ford" emblem	Necessary	162.00	162.00
8	1	Tailgate outer garnish	Damaged	458.00	458.00
9	1	Tailgate outer garnish handle	Damaged	186.00	186.00
10	2	Rear number plate lamps	Cracked	216.00	216.00
11	1	Tailgate weather strip	Deformed	296.00	296.00
12	1	Tailgate inner lock assembly	Not necessary	286.00	--
13	1	Tailgate inner lock striker	Not necessary	154.00	--
14	1	Tailgate inner lock assembly switch	Malfunction	389.00	389.00
15	1	Tailgate inner lock assembly sensor	Malfunction	354.00	354.00
16	1	Tailgate inner trim board	Damaged	1,873.10	1,873.10
17	1	Tailgate windscreen glass moulding	Necessary	321.00	321.00
18	2	Tailgate lamp	Damaged	1,084.00	1,084.00
19	2	Taillamp	Not necessary	1,596.00	--
20	2	Taillamp panel	Not necessary	332.00	--
21	1	Rear bumper upper	Damaged	1,650.00	1,650.00
22	1	Rear bumper lower	Damaged	752.00	752.00
23	1	Rear bumper tow cover	Not necessary	85.00	--
24	2	Rear bumper side retainer	Necessary	170.00	170.00
25	2	Rear bumper reflector	Not necessary	372.00	--
26	1	Rear bumper lower moulding	Damaged	551.00	551.00
27	1	Rear bumper inner pad	Damaged	345.00	345.00
28	1	Rear bumper reinforcement	Bent	769.00	769.00
29	2	Rear bumper side support	Cracked	308.00	308.00
30	2	Rear bumper centre support	Bent	294.00	294.00
31	2	Rear bumper side cover	Not necessary	968.00	--

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co Reg No.: 201318067R

AJAX

Inspection Services Pte Ltd

Adjustment of Repair Cost for Vehicle:			SFY1432C	Our Ref: AVS2019-21317/PN	
No.	Qty	Description of Parts	Condition	Repairer's Estimate S\$	Our Recommendation S\$
32	1	End panel inner	Deformed	563.00	563.00
33	1	End panel outer	Deformed	563.00	563.00
34	1	End panel top garnish	Cracked	489.00	489.00
35	1	Headlamp o/s	Damaged	1,978.00	1,978.00
36	1	Headlamp lower bracket o/s	Cracked	178.00	178.00
37	1	Front fender o/s	Damaged	899.00	899.00
38	1	Front fender inner cowl o/s	Damaged	287.00	287.00
39	1	Front shock absorber o/s	Bent	479.00	479.00
40	1	Front shock absorber top mounting o/s	Jammed	155.00	155.00
41	1	Front shock absorber top mounting bearing o/s	Necessary	98.00	98.00
42	1	Steering tie rod end o/s	Damaged	253.00	253.00
43	1	Sway bar end link o/s	Bent	195.00	195.00
44	1	Front knuckle o/s	Bent	592.00	592.00
45	1	Front wheel hub o/s	Jammed	356.00	356.00
46	1	Front lower arm o/s	Bent	713.00	713.00
47	1	Front bumper	Damaged	1,037.00	1,037.00
48	2	Front bumper side retainer	Cracked	232.00	232.00
49	1	Day running lamp o/s	Damaged	349.00	349.00
50	1	Day running lamp garnish o/s	Damaged	145.00	145.00
Sub Total:				27,374.10	20,646.10
Discount (less 20%):				0.00	4,129.22
				27,374.10	16,516.88

Special Nett Items					
1	6	End panel top garnish clips	Necessary	39.00	35.00
2	10	Rear bumper clips	Necessary	65.00	55.00
3	4	Reverse sensor	Malfunction	1,120.00	1,120.00
4	1	Reverse camera	Malfunction	480.00	480.00
5	1	End panel sealant	Necessary	100.00	80.00
6	1	Rear licence plate & frame	Damaged	55.00	35.00
7	1	Rear windscreen sealant	Necessary	100.00	80.00

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208 Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Adjustment of Repair Cost for Vehicle:			SFY1432C	Our Ref: AVS2019-21317/PN	
No.	Qty	Description of Parts	Condition	Repairer's Estimate S\$	Our Recommendation S\$
8	10	Tailgate inner trim clips	No photo	65.00	55.00
9	1	Front alloy wheel 18" o/s	Damaged	550.00	550.00
10	1	Front tyre 225/45R18 o/s	Cut	380.00	380.00
11	8	Front fender inner cowling clip o/s	Necessary	52.00	50.00
12	10	Front bumper clips	Necessary	65.00	55.00
13	1	Sundries	Necessary	50.00	40.00
Sub Total:				3,121.00	3,015.00
Total Parts Price:				30,495.10	19,531.88

Labour Cost			
1	To dismantle/ renew accident damaged portion, to panel beat, reshape, straighten, orientate and align repair/ replacement parts.	1,200.00	1,100.00
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	50.00	40.00
3	To remove, refit tailgate components to replace tailgate check and re-adjust close gap, alignment and water seepage.	100.00	90.00
4	To remove and refit rear windscreen to facilitate repair work.	150.00	140.00
5	Supply spray paint material and necessary items to respray rear bumper, tailgate, end panel and other affected area/ panel.	1,200.00	1,100.00
6	To rust proof all affected portions after repair.	100.00	90.00
Sub Total:		2,800.00	2,560.00
Grand Total:		33,295.10	22,091.88

Recommendation and Conclusion:

We have inspected the actual damages found on the vehicle and recommended the replacement of parts and repairs accordingly. The estimate repair cost is S\$33,295.10. The repairer has agreed to undertake the repairs at our adjusted lumpsum amount of S\$17,600.00.

We have not authorised the repair. Under normal circumstances, estimated eight (08) working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

The inspection was conducted entirely on a "Without Prejudice" basis.

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R