

ASS. REC. BY:

REF:

CC6/AIG20005793/Ab a3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SJM3212Z Yr Regn: 2008 / DecType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda Stream c.c. 1799Colour: Silver A/C: Insured / Std / NI / NASp. Reading: 301441 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JHMRN68408S205832Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim STD A/Rim orTyre Size: F: 205/65R15R: 205/65R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Tourador

Front _____ Rear _____

R/Bal. 06 mm R/Bal. 06 mmL/Bal. 06 mm L/Bal. 06 mmD.O.A. _____ D.O.I. 18/05/20.Survey held at LeangDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

COE Expiry: 28/12/23.

Date / Time Action / Instruction

TPAIG

MV:

PV:

Nett:

Date/Time, File Pass to?

☐ : Prel. Report
☐ : Final Report

1)

Date/Time, File Return to?

2)

Report Format:

Lump Sum / L.R.:

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Insp (\$)
☐ : Weekend (\$)

Survey Fee:

Transportation:

\$ + P.S. \$

Photos

Other:

TOTAL

No:

MON TUE WED THU FRI SAT SUN

Date:

SJM3212Z.

TP A16

Honda Stream

Jasper.

IHMRN684085205832

Front Number Plate Dented.

30(SN) ✓

Front Number Plate Holder all new

30(SN) x

Front Bumper Dented

638 ✓

Front Bumper Clips all

30 ✓

Front Bumper Side Holder x2 2 all

20.5 x 2 = 41 x

Front Bumper Reinforcement 1 all

218.80 x

Front Grille ut

20810 ✓

Front Grille Chrome Moulding ut

210.30 ✓

Front Grille Logo all

23.40 ✓

Front Grille Clips all

10 ✓

Headlamp x2 2 all

680.8 x 2 = 1361.60 x

Headlamp Lower Bracket x2 1 all

36.5 x 2 = 73. x

1119.80

S.N: 30

Len 20%: 895.84

Panel Beating
Spray Painting
Wiring~~500~~ 200~~500~~ 200~~100~~ 30

430

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Total: 1355.84

H/S : 1050

03 Days.

JBC