



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2004697
INV Date 01/07/2020
Reference CS/SMO20005839/Kqf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SKG 2686R
Insured Veh. SMR 9875J
Claim No. CMTD2001564/MYE
Policy No.
Accident Date 08/05/2020
Inspection Date 20/05/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SOMPO INSURANCE SINGAPORE PL

Ref : CS/SMO20005839/Kqf3n2

50 RAFFLES PLACE

#05-01/06

SINGAPORE LAND TOWERSINGAPORE 048623

Date : 01-07-2020



Code : SMO

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMR 9875J	Veh. Inspected	SKG 2686R
Policy No.		Coverage (\$)	0.00
Claim No.	CMTD2001564/MYE	Excess (\$)	0.00
Assign From	GRACE TEO	Assign Date	20/05/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA ODYSSEY (A)	c.c	2356
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	RC11116879	Colour	METALLIC DARK BLUE
Odometer	88763	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/55 R17	MICHELIN	6 mm
L/H Front Tyre	215/55 R17	MICHELIN	6 mm
R/H Rear Tyre	215/55 R17	MICHELIN	7 mm
L/H Rear Tyre	215/55 R17	MICHELIN	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	08/05/2020	Inspection Date	20/05/2020
Survey held at	HENG YAP SENG AUTO SERVICE BLK 13 SIN MENG IND. EST. SECTION B, #01-39 SINGAPORE 575657		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKG 2686R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	BUCKLED	782.60	782.60
2	REAR BUMPER BRACKETS	TO REPAIR SEE LABOUR	131.20	-
1	SET REAR BUMPER CLIPS	NECESSARY	40.00	40.00
2	REAR BUMPER REFLECTORS	SERVICEABLE	166.80	-
2	REAR BUMPER RETAINERS	SERVICEABLE	84.90	-
1	REAR TAILGATE	BENT	1,259.80	1,100.00
1	REAR TAILGATE LOCK	DENTED	218.10	218.10
1	REAR TAILGATE CENTRE LOGO	NECESSARY	30.90	30.90
1	REAR TAILGATE OUTER CHROME TOP MOULDING	SERVICEABLE	283.10	-
1	REAR TAILGATE OUTER CHROME BOTTOM MOULDING	WARPED / MTG DISTORTED	218.50	218.50
2	REAR TAILGATE HINGES	TO REPAIR SEE LABOUR	184.00	-
2	REAR TAILGATE DAMPERS	SERVICEABLE	387.40	-
1	REAR TAILGATE INNER TRIM BOARD	MTG CRACKED	342.70	342.70
1	SET REAR TAILGATE INNER TRIM CLIPS	NECESSARY	60.00	60.00
2	REAR TAILGATE INNER SIDE GARNISHS	SERVICEABLE	850.30	-
2	TAIL LAMPS (OUTER & INNER)	SERVICEABLE	1,972.10	-
1	REAR WINDSCREEN MOULDING	NECESSARY	120.00	120.00
1	REAR WIPER ARM	SERVICEABLE	80.10	-
1	REAR END PANEL TOP GARNISH	SERVICEABLE	121.90	-
1	REAR SPARE TYRE COMPARTMENT	TO REPAIR SEE LABOUR	721.50	-
1	REAR SPARE TYRE TOP BOARD	SERVICEABLE	345.90	-
1	REAR EXHAUST SILNECR	TO REPAIR SEE LABOUR	764.30	-
1	REAR EXHAUST SILNECR MOUNTING	SERVICEABLE	84.80	-
	LESS 20% DISCOUNT		-	-582.56
			9,250.90	2,330.24
<u>SPECIAL NETT ITEMS</u>				
1	REAR END PANEL (LOCAL REPAIR)(SN)	DENTED	542.10	120.00

Report Ref No. CS/SMO20005839/Kqf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR NUMBER PLATE (SN)	SERVICEABLE	60.00	-
1	SET REVERSE SENSOR (SN)	SHORTED	600.00	200.00
			1,202.10	320.00
	LABOUR			
	LABOUR CHARGE TO REMOVE,CUT OUT DAMAGE PORTION,JACK OUT,STRAIGHTEN,PANEL BEATING,WELDING,ALIGN AND RENEW REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER BRACKETS ,REAR TAILGATE HINGES,REAR SPARE TYRE COMPARTMENT AND REAR EXHAUST SILNECR.		2,000.00	500.00
	TO PUTTY AND RESPRAY PAINTING ON AFFECTED AREAS.		1,200.00	600.00
	TO REMOVE,REPLACE REAR TAILGATE FITTINGS TO FACILITATE REPAIR.		250.00	60.00
	TO REMOVE,REPLACE REAR WINDCSREEN GLASS.		200.00	120.00
	TO REMOVE,REPLACE REVERSE SENSOR.		200.00	60.00
	TO REMOVE,REPLACE REAR EXHAUST SILENCER.	NOT NECESSARY	100.00	-
	TO CHECK WIRING AND LIGHTINGS.		80.00	20.00
			4,030.00	1,360.00
GRAND TOTAL			14,483.00	4,010.24
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,200.00

Report Ref No. CS/SMO20005839/Kqf3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKG 2686R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKG 2686R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

