



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101550

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 11/03/2021
Reference CC4/FCI20006120/Ara3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKQ 3661C
Insured Veh. SHD 4330E
Claim No. D20002288MFSH
Policy No. D-20094922MFSH
Accident Date 01/06/2020
Inspection Date 04/06/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI20006120/Ara3q2 Date: 11/03/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHD 4330E	Veh. Inspected	SKQ 3661C
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20002288MFSH	Excess (\$)	0.00
Assign From	VIC	Assign Date	03/06/2020
2. Vehicle Particulars & Condition			
Make & Model	MAZDA 5	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JM6CW1071F0120462	Colour	BRONZE
Odometer	107384 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/55 R16	PIRELLI	6 mm
L/H Front Tyre	205/55 R16	PIRELLI	6 mm
R/H Rear Tyre	205/55 R16	PIRELLI	6 mm
L/H Rear Tyre	205/55 R16	PIRELLI	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	01/06/2020	Inspection Date	04/06/2020
Survey held at	TRANS EUROKARS PTE LTD 12 SUNGEI KADUT AVE SINGAPORE 729648		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKQ 3661C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BUMPER	DISTORTED	961.20	961.20
1	RETAINER LHS	NOT NECESSARY	47.60	-
1	RETAINERS RHS	NOT NECESSARY	47.60	-
1	BRACKET LHS	NOT NECESSARY	5.70	-
1	BRACKET RHS	NOT NECESSARY	5.70	-
1	REFLECTOR LHS	NOT NECESSARY	53.00	-
1	REFLECTOR RHS	NOT NECESSARY	53.00	-
1	GUARD LHS ,REFLECTOR	NOT NECESSARY	21.60	-
1	GUARD RHS ,REFLECTOR	NOT NECESSARY	21.60	-
1	SHIELD SPLASH LHS	DEFORMED	39.60	39.60
1	SHIELD SPLASH RHS	DEFORMED	39.60	39.60
1	REAR REINFORCEMENT	BENT	155.40	155.40
4	GROMMET ,REAR BUMPER	NECESSARY	12.00	12.00
2	GROMMET ,REAR BUMPER	NECESSARY	9.40	9.40
2	FASTENER ,REAR BUMPER	NECESSARY	6.40	6.40
4	RIVET ,REAR BUMPER	NECESSARY	22.80	22.80
2	GROMMET ,REAR BUMPER	NECESSARY	6.00	6.00
2	RIVET ,REAR BUMPER	NECESSARY	6.00	6.00
2	REAR END PANEL	NOT NECESSARY	1,031.40	-
1	TRIM ,END PANEL	NOT NECESSARY	80.40	-
1	BEZEL ,LOCK	NOT NECESSARY	13.70	-
1	TRIM LHS ,BOOTSIDE	NOT NECESSARY	496.50	-
1	TRIM RHS ,BOOTSIDE	NOT NECESSARY	496.50	-
1	SUB TRUNK ,REAR FLOOR PANEL	TO REPAIR SEE LABOUR	359.70	-
1	SPARE WHEEL BOARD	NOT NECESSARY	496.30	-
1	TAILGATE	DENTED	1,637.00	1,637.00
1	WEATHERSTRIP ,TAILGATE	NOT NECESSARY	177.50	-
1	VALVE ,ONEWAY	NOT NECESSARY	13.80	-
2	TRIM LOWER ,TAILGATE	NOT NECESSARY	864.00	-
5	FASTENER ,TRIM	NOT NECESSARY	15.00	-

Report Ref No. CC4/FCI20006120/Ara3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LOCK ,TAILGATE	JAMMED	256.20	256.20
1	STRIKER ,LOCK	NOT NECESSARY	57.90	-
1	FINISHER ,TAILGATE	NOT NECESSARY	447.90	-
3	CLIP ,FINISHER	NOT NECESSARY	17.10	-
1	ORNAMENT ,MAZDA	NECESSARY	45.30	45.30
1	ORNAMENT ,5	NECESSARY	36.30	36.30
1	ORNAMENT SKYACTIVE	NECESSARY	80.00	80.00
1	LAMP LHS ,TAILGATE	NOT NECESSARY	388.50	-
1	LAMP RHS ,TAILGATE	NOT NECESSARY	409.40	-
1	GASKET LHS ,TAILGATE	NOT NECESSARY	95.40	-
1	GASKET RHS ,TAILGATE	NOT NECESSARY	95.40	-
1	REAR WINDSCREEN MOULDING	NECESSARY	60.50	60.50
6	FASTENER ,REAR WINDSCREEN	NECESSARY	16.80	16.80
2	FASTENER ,REAR WINDSCREEN	NECESSARY	16.40	16.40
4	SPACER ,REAR WINDSCREEN	NECESSARY	51.20	51.20
1	PIN STUD ,REAR WINDSCREEN	NECESSARY	11.10	11.10
2	PROTECTOR ,SPOILER	NOT NECESSARY	11.00	-
2	PROTECTOR ,SPOILER	NOT NECESSARY	24.00	-
2	PROTECTOR ,SPOILER	NOT NECESSARY	28.20	-
3	CLIP ,SPOILER	NECESSARY	23.10	23.10
1	CLIP ,SPOILER	NECESSARY	8.70	8.70
1	TAILLAMP PANEL LOWER LHS	NOT NECESSARY	56.60	-
1	TAILLAMP PANEL LOWER RHS	NOT NECESSARY	63.50	-
1	CHAMBER EXTRACTOR LHS	NOT NECESSARY	74.90	-
1	HEAT INSULATOR ,EXHAUST	NOT NECESSARY	157.10	-
1	SILENCER ,EXHAUST	NOT NECESSARY	1,109.50	-
1	RING SEAL ,EXHAUST	NOT NECESSARY	64.60	-
			10,902.60	3,501.00
	<u>SPECIAL NETT ITEMS</u>			
1	NUMBER PLATE (SN)	NOT NECESSARY	70.00	-
1	SUNDRIES (SN)	NOT NECESSARY	100.00	-
			170.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REPLACE REAR BUMPER ,REAR REINFORCMENT ,REAR END PANEL AND TAILGATE TO REPAIR REAR FLOOR PANEL,REAR FENDER LH,REAR FENDER RH AND ALL AREAS AFFECTED BY THE ACCIDENT .INCLUSIVE OF THE REPAIR OF SUB TRUNK ,REAR FLOOR PANEL .		5,610.00	1,980.00
	TO RESPRAY REAR BUMPER ,REAR REINFORCEMENT ,REAR END PANEL,REAR FLOOR PANEL ,TAILGATE ,REAR FENDER LH AND REAR FENDER RH .		4,095.00	1,890.00
	TO REMOVE & REFIT THE WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST .		560.00	560.00
	TO SUPPLY SEALER ON THE WINDSCREEN GLASS .		120.00	120.00
	TO REMOVE AND REFIX SPOILER TAILGATE .	NOT NECESSARY	180.00	-
	TO TRANSFER TAILGATE MECHANISM .		330.00	330.00
	TO TRANSFER REVERSE SENSORS (WITH REVERSE SENSOR).		660.00	330.00
	TO TRANSFER REVERSE CAMERA (WITH REVERSE CAMERA).		660.00	180.00
	TO SUPPLY EXHAUST TIP MUFFLER.	NOT NECESSARY	150.00	-
	TO REMOVE & INSTALL REAR EXHAUST ASSY .	NOT NECESSARY	660.00	-
	TO REMOVE & REFIT CARPET & TRIMS ON THE REAR SECTION TO GIVE WAY TO THE REPAIR ON THE REAR SECTION .	NOT NECESSARY	990.00	-
	TO SUPPLY SPRAY TEROSTAT SEALANT ON THE CUTTING.	NOT NECESSARY	350.00	-
	TO CARRY -OUT CAVITY PRESERVATION .		250.00	150.00
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	120.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		350.00	180.00
	TO TOW THE VEHICLE FROM THE ACCIDENT SITE TO THE WORKSHOP.	NOT NECESSARY	120.00	-
			15,335.00	5,840.00
	GRAND TOTAL		26,407.60	9,341.00



RECOMMENDED COST OF REPAIRS			9,341.00
------------------------------------	--	--	-----------------

Report Ref No. CC4/FCI20006120/Ara3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKQ 3661C

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

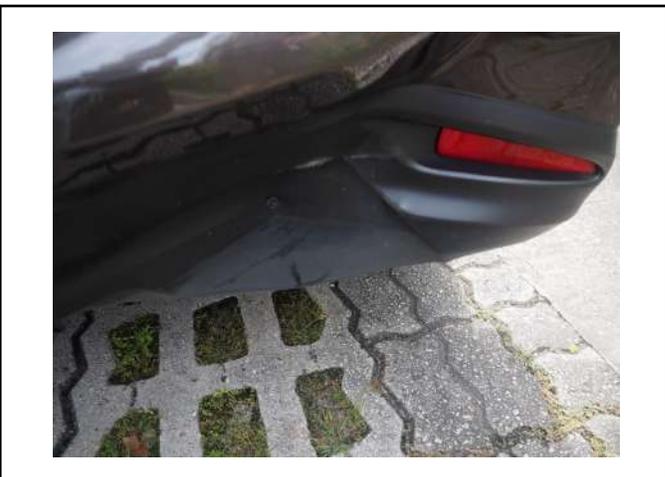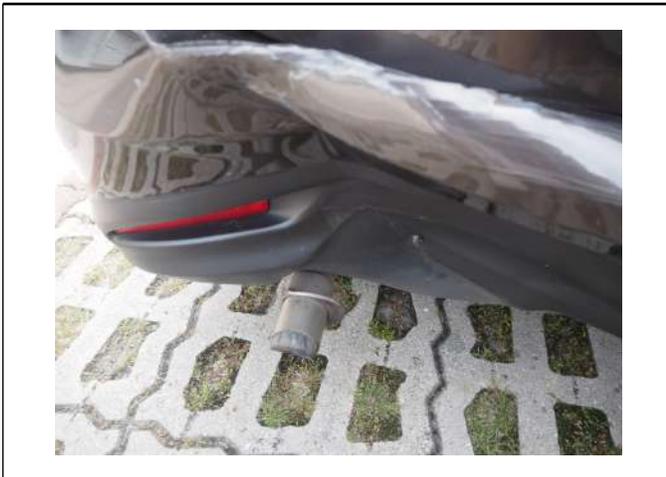



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

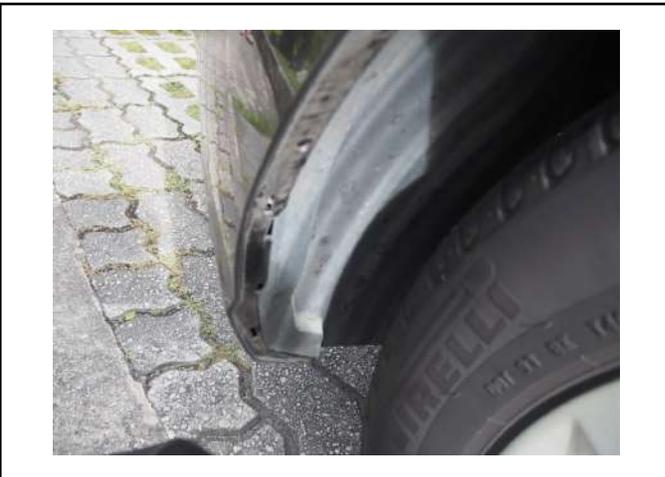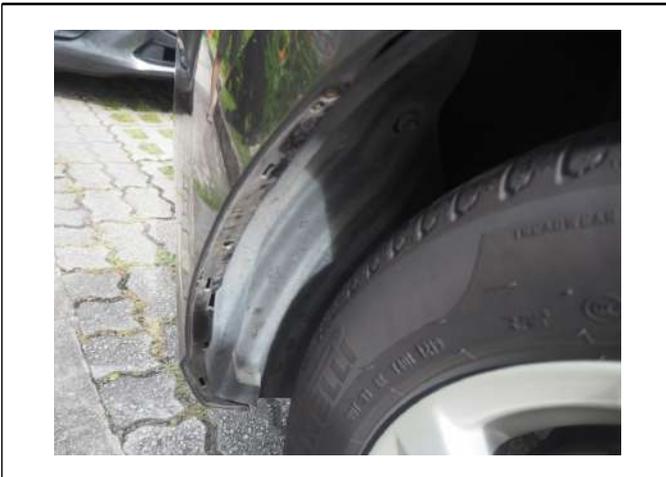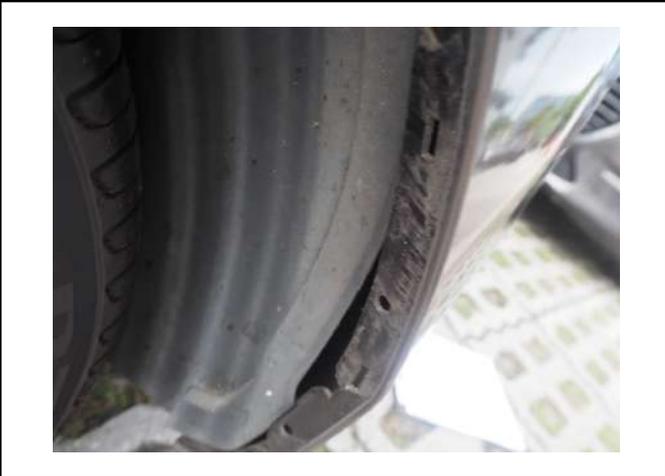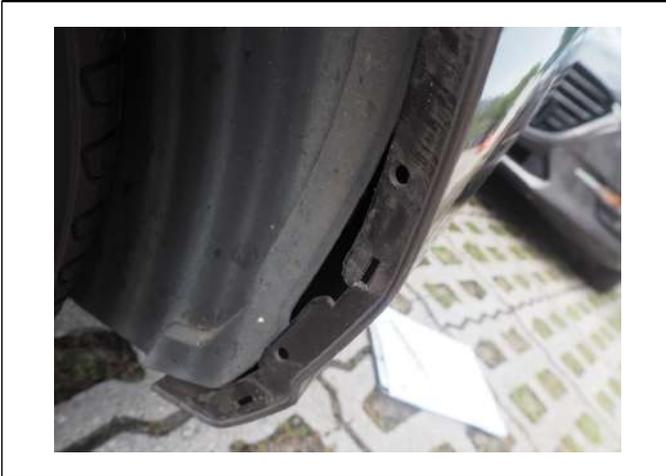



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKQ 3661C

RE-INSPECTION

