



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2005650
INV Date 18/08/2020
Reference CS/SMO20006281/Kvf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SLX 408P
Insured Veh. SKV 8849U
Claim No. CMTD2001798/LOR
Policy No.
Accident Date 12/06/2020
Inspection Date 17/06/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SOMPO INSURANCE SINGAPORE PL

Ref : CS/SMO20006281/Kvf3n2

50 RAFFLES PLACE

#05-01/06

SINGAPORE LAND TOWERSINGAPORE 048623

Date : 18-08-2020



Code : SMO

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKV 8849U	Veh. Inspected	SLX 408P
Policy No.		Coverage (\$)	0.00
Claim No.	CMTD2001798/LOR	Excess (\$)	0.00
Assign From	GRACE TEO	Assign Date	15/06/2020

2. Vehicle Particulars & Condition

Make & Model	VOLKSWAGEN GOLF TSI	c.c	1395
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	WWWZZZAUZHW123435	Colour	METALLIC SILVER
Odometer	43963	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/40 R18	MICHELIN	7 mm
L/H Front Tyre	225/40 R18	MICHELIN	7 mm
R/H Rear Tyre	225/40 R18	MICHELIN	7 mm
L/H Rear Tyre	225/40 R18	MICHELIN	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	12/06/2020	Inspection Date	17/06/2020
Survey held at	TROPICAL SUCCESS AUTO CARE BLK 5032 ANG MO KIO AVENUE 3 #01-303 INDUSTRIAL PARK 2 SINGAPORE 569535.		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLX 408P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR WINDSCREEN	NOT NECESSARY	1,067.00	-
1	REAR BOOT	BENT	1,499.00	1,499.00
1	REAR BOOT LOCK	TO REPAIR SEE LABOUR	345.00	-
1	REAR BOOT RUBBER	SERVICEABLE	386.00	-
2	REAR BOOT LAMP @\$300.00	SERVICEABLE	600.00	-
2	REAR TAIL LAMP @\$330.00	SERVICEABLE	660.00	-
2	REAR TAIL LAMP LOWER BRACKET @\$48.00	SERVICEABLE	96.00	-
1	REAR BUMPER	BUCKLED	1,487.00	1,080.00
4	REAR BUMPER PARKTRONIC SENSOR @\$105.00	SHORTED (2 PCS ONLT)	420.00	210.00
4	REAR BUMPER PARKTRONIC SENSOR SEAL RING @\$5.00	NECESSARY	20.00	20.00
4	REAR BUMPER PARKTRONIC SENSOR HOLDER @\$33.00	NECESSARY	132.00	132.00
2	REAR BUMPER LICENSE LAMP @\$33.00	SERVICEABLE	66.00	-
1	REAR BUMPER LOWER COVERING	SERVICEABLE	26.00	-
2	REAR BUMPER REFLECTOR @\$69.00	SERVICEABLE	138.00	-
1	REAR BUMPER LOWER LIP	DENTED / CUT	375.00	320.00
2	REAR BUMPER SIDE BRACKET @\$60.00	SERVICEABLE	120.00	-
1	REAR BUMPER CENTRE FRAME (TOP)	CRACKED	87.00	87.00
1	REAR BUMPER REINFORCEMENT	BENT	594.00	484.00
1	REAR SILENCER BOX ASSY	TO REPAIR SEE LABOUR	984.00	-
	LESS 10% DISCOUNT		-910.20	-383.20
			8,191.80	3,448.80
<u>SPECIAL NETT ITEMS</u>				
1	REAR BOOT OUTER EMBLEM (SN)	SERVICEABLE	111.00	-
1	REAR BOOT "GOLF 230 TSI" DESIGNATION (SN)	NECESSARY	150.00	150.00
			261.00	150.00
<u>LABOUR</u>				
	REMOVE AND REFIT REAR WINDSCREEN.		180.00	120.00

Report Ref No. CS/SMO20006281/Kvf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & TRANSFER REAR BOOT NECESSARY ATTACHMENT SPARE PART ITEMS.}		1,500.00	500.00
	REMOVE & TRANSFER REAR BUMPER NECESSARY ATTACHMENT SPARE PART ITEMS.}		-	-
	REMOVE & REFIT REAR BOOT,REAR BOOT LOCK,REAR BOOT RUBBER,REAR BOOT LAMP,REAR TAIL LAMP,REAR TAIL LAMP LOWER BRACKET,REAR BUMPER,REAR BUMPER PARKTRONIC SENSOR,REAR BUMPER PARKTRONIC SENSOR SEAL RING,REAR BUMPER PARKTRONIC SENSOR HOLDER,REAR BUMPER LICENSE LAMP,REAR BUMPER TOWING COVERING,REAR BUMPER REFLECTOR,REAR BUMPER LOWER LIP,REAR BUMPER SIDE BRACKET,REAR BUMPER CENTRE FRAME (TOP),REAR BUMPER REINFORCEMENT,REAR SILENCER BOX ASSY. }		-	-
	HEAT/WELD/BEATING/PULL/ STRAIGHTEN/ALIGN REAR CHASSIS FRAME BY CHASSIS ALIGNMENT JACK. }		-	-
	DIAGNOSTIC REAR BUMPER PARKTRONIC SENSOR.		100.00	60.00
	TUFF KOTE REAR DAMAGED PORTION.		200.00	30.00
	TO CHECK AND REFIT REAR TAIL-LAMP WIRING HARNESS (LEFT & RIGHT).		80.00	20.00
	PUTTY/PRIMER APPLICATION,SPRAY PAINTING ON REAR BOOT,REAR BUMPER,REAR BUMPER PARKTRONIC SENSOR,REAR BUMPER TOWING COVERING.		1,500.00	480.00
			3,560.00	1,210.00
	GRAND TOTAL		12,012.80	4,808.80
RECOMMENDED COST OF REPAIRS				4,808.80

Report Ref No. CS/SMO20006281/Kvf3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 408P

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 408P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

