

# S K AUTO CONSULTANTS

## Invoice

Bill To: SKYWAY MOTOR PTE LTD  
c/o Kim Motoring  
Blk 3, 391A Woodlands Road  
Yew Tee Industrial Estate  
Singapore 677964

Invoice No:	2020057
Date:	28/3/2020
Our Ref	TP/020/0057SK

Description	Amount (S\$)
PARTICULARS	
Vehicle Registration No : SMS 4665B	500.00
Date of Accident : 12/03/2020	
Date of Inspection : 16/03/2020	
SERVICES:	
Assessment with report (inclusive of transport charges and photographs etc)	
<b>Total</b>	500.00
<b>Balance Due</b>	500.00

We would appreciate your cheque crossed and made payable to:  
S K AUTO CONSULTANTS



Authorized Signature

# S K AUTO CONSULTANTS

## AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference: TP/020/0057SK

Your Reference: TBA

Date: 28/3/2020

TO: SKYWAY MOTOR PTE LTD  
c/o Kim Motoring  
Blk 3, 391A Woodlands Road  
Yew Tee Industrial Estate  
Singapore 677964

Assessment of Vehicle No : SMS 4665B  
Date of Accident : 12/03/2020  
Date of Inspection : 16/03/2020

We have carried out a physical assessment of SMS 4665B at Kim Motoring according to your instructions on 16/03/2020 and are pleased to submit our report as follows;

### 1.VEHICLE PARTICULARS

Registration No.	:	<b>SMS 4665B</b>
Make & Model	:	<b>HONDA VEZEL HYBRID</b>
Year of Registration	:	<b>27/2/2020 (SEE NOTE IN NEXT PAGE)</b>
Engine Capacity (cc)	:	<b>1496</b>
Chassis No.	:	<b>RU31321983</b>
Engine No.	:	<b>LEB6741994</b>
Colour	:	<b>Silver</b>
Mileage (km)	:	<b>2874</b>

### 2.VEHICLE CONDITION

Body Paint:	:	<b>Good</b>
Steering	:	<b>Serviceable</b>
Foot Brake	:	<b>Serviceable</b>
Parking Brake	:	<b>Serviceable</b>

### 3.TYRE PARTICULARS & CONDITION

#### **Front**

RH Make/Size	:	<b>Enasave 215/60R16 - 100%</b>
LH Make/Size	:	<b>Enasave 215/60R16 - 100%</b>

#### **Rear**

RH Make/Size	:	<b>Enasave 215/60R16 - 100%</b>
LH Make/Size	:	<b>Enasave 215/60R16 - 100%</b>

Note: % denotes the remaining percentage of the tyre

# S K AUTO CONSULTANTS

Page No. 2


Our Reference      TP/020/0057SK  
Vehicle No.        SMS 4665B

## 4.DESCRPTION OF DAMAGE

At the time of inspection observed that this vehicle had sustained damages to the REAR portion

**(BADLY DAMAGED)**

Please see attached schedule for details.

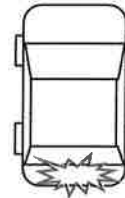

**NOTE: The date of registration of SMS 4665B is 27 Feb 2020**  
**As at the date of accident the car was 14 days old (new car)**

Estimated Amount                : S\$14,266.20  
Adjusted Amount                : S\$10,700/-  
Estimated Repair Days\*        : 12 days  
\*including spray painting works

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.  
The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 Days** from the date hereof, this report shall be treated as correct

### Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **S K AUTO CONSULTANTS** for any reliance on this report by any third party.

# S K AUTO CONSULTANTS

Page No. 3

Our Reference TP/020/0057SK  
Vehicle No. SMS 4665B

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)		OUR ASSESSMENT(\$\$)	
	<b><u>PARTS (LIST ITEMS)</u></b>					
1	Tailgate	Distorted		1420.00		1420.00
1	Tailgate Honda emblem (badge)	Necessary		42.00		42.00
1	Tailgate VEZEL emblem	Necessary		98.00		98.00
1	Tailgate HYBRID emblem plate	Necessary		78.00		78.00
1	Tailgate inner lock	Damaged		328.00		328.00
1	Tailgate inner lock catch	Bent		58.00		58.00
1	Tailgate inner trim board	Deformed		342.00		342.00
1	Tailgate reflector RHS	Cracked		579.00		579.00
1	Tailgate centre chrome moulding	Refix		292.00		0.00
2	Tailgate dampers @242.50	Stiffened		485.00		485.00
1	Rear boot edge weatherstrip	Deformed		278.00		278.00
1	Rear bumper	Deformed		1124.00		1124.00
2	Rear bumper side retainers	Necessary		144.00		144.00
2	Rear bumper reflectors @72.00	Refix		144.00		0.00
1	RHS Rear corner panel	Deformed		398.00		398.00
2	RHS & LHS Rear wheel arch garnish	Deformed		476.00		476.00
1	Rear floor panel	Distorted		1254.00		1254.00
1	Rear floor panel tool tray	Compressed		278.00		278.00
1	Rear floor panel lower cover	Deformed		428.00		428.00
2	Rear end panel outer beams	Bent		344.00		344.00
1	Rear exhaust silencer assembly	Bent		782.00		782.00
1	Rear exhaust silencer chrome end pipe	Dented		198.00		198.00
2	Rear exhaust silencer mounting @48.00	Necessary		96.00		96.00
1	Rear end panel	Dented		762.00		762.00
1	Rear end panel top garnish	Deformed		261.00		261.00
				10689.00		10253.00
		less 20%		2137.80	20%	2050.60
				8551.20		8202.40
	<b><u>SPECIAL NETT ITEMS</u></b>					
1 set	Rear Bumper clips	Necessary		60.00		40.00
1 set	Reverse sensor	Damaged		280.00		250.00
1	Rear licence plate w/holder	Dented		75.00		50.00
1	Hybrid battery assembly complete	Refix		0.00		0.00
1	Rear floor panel sealant	Necessary		150.00		120.00
1	Rear end panel top garnish clips	Necessary		60.00		40.00
1set	Tailgate inner trim board clips	Necessary		60.00		40.00
1	Rear end panel sealant	Necessary		100.00		80.00
1	Rear windscreen sealant	Necessary		100.00		80.00
1	Reverse camera	Refix		480.00		0.00
		TOTAL PARTS		9916.20		8902.40

# S K AUTO CONSULTANTS

Page No. 4

Our Reference TP/020/0057SK  
Vehicle No. SMS 4665B

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (\$\$)	OUR ASSESSMENT (\$\$)
	<b>LABOUR</b>		
1	To remove the affected parts & fittings to commence repairs; replace damaged parts and components	1800.00	1600.00
2	To supply paint materials, expandable items & putty, respray paint on parts replaced	1200.00	1000.00
3	To remove and re-fix wiring and check all electrical components at damaged areas for proper functions	150.00	120.00
4	To remove and refix/replace rear trims, garnish and fittings so as to facilitate repairs at rear	180.00	150.00
5	To remove and refix rear windscreen	140.00	120.00
6	To remove and refix reverse camera and check for proper function	120.00	80.00
7	To remove and refix Hybrid battery to facilitate repair (replacement of rear floor panel including welding works)	200.00	150.00
8	To remove and replace rear exhaust silencer assembly, realign to fit and check system function	200.00	150.00
9	To remove and replace reverse sensors and check for proper function	120.00	80.00
10	To provide anti-rust treatment on affected areas	240.00	210.00
Labour Total :		4350.00	3660.00
TOTAL (PARTS & LABOUR):		14266.20	12562.40

**Note: (For Lump Sum Repair)**


The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or the use of ex stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements.

**The final adjusted Lump Sum contract amount is S\$10,700/-**

  
S. Kumanan  
Motor Surveyor



VEHICLE REGN.NO. SMS 4665B

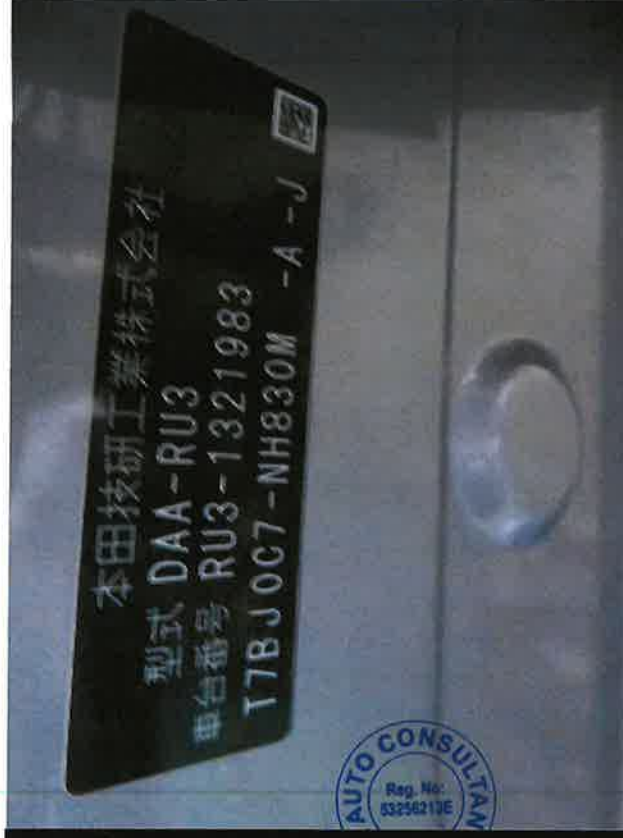



























SK AUTO CONSULTING  
Reg. No:  
53256213E

SK AUTO CONSULTING  
Reg. No:  
53256213E











