

INVOICE

TO: CHUA WEI KIAT(CAI WEIJIE)
C/O: SKM GARAGE & TRADING LLP

10 KAKI BUKIT ROAD 2,

#03-31/32 FIRST EAST CENTRE,

SINGAPORE 417868

Invoice No.:

0220/SM469

Date:

28-Feb-2020

PARTICULARS

Vehicle Registration No.:

SJS 2805 M

Date of Loss:

11-Feb-2020

Date of Assessment:

17-Feb-2020

SERVICES

FEES

1. Assessment with report Photographs - Including films, developing, storage and Transport.

\$500.00

TOTAL

\$500.00

SINGAPORE DOLLARS FIVE HUNDRED ONLY

We would appreciate your cheque crossed and made payable to: "AEON AUTO CONSULTANTS LLP" with our invoice no. written on the back of the cheque.

AEON AUTO CONSULTANTS LLP



50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874
Telephone +65 97687958 Facsimile +65 68264112 Email info@aeonac.com
Reg. No. LL0701273L (registered with limited liability)

AUTOMOBILE ASSESSMENT REPORT

TO: CHUA WEI KIAT(CAI WEIJIE)
C/O: SKM GARAGE & TRADING LLP

10 KAKI BUKIT ROAD 2,

- #03-31/32 FIRST EAST CENTRE,

SINGAPORE 417868

Our Reference:

0220/SM469

Date:

28-Feb-2020

ASSESSMENT OF VEHICLE NO. SJS 2805 M

DATE OF LOSS:

11-Feb-2020

We have carried out a physical assessment at SKM GARAGE & TRADING LLP, 10 Kaki Bukit Road 2, #03-31/32 First East Centre, Singapore 417868, according to your instruction

on 17-Feb-2020 and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No.:

SJS 2805 M

Make & Model:

HONDA CIVIC 3DRS TYPE R

Year of Registration:

2009

Engine Capacity:

1998

Chassis No.:

SHHFN23608U300164

Engine No.:

K20Z42008046

Colour:

BLACK

2. VEHICLE CONDITION

Body Paint:

GOOD

Steering:

SERVICEABLE

Foot Brake:

SERVICEABLE SERVICEABLE

Parking Brake: Modification:

NIL

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size/Thread:

TOYO

225/40 R18 - 70%

LH Make/Size/Thread:

TOYO

225/40 R18 - 70%

Rear

RH Make/Size/Thread:

JINYU

235/40 R18 - 70%

LH Make/Size/Thread:

UYNIL

235/40 R18 - 70%

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874

Telephone +65 97687958 Facsimile +65 68264112 Email info@aeonac.com

Reg. No. LL0701273L (registered with limited liability)

4. DESCRIPTION OF DAMAGE

At the time of the inspection, the vehicle sustained damages to the FRONT and REAR portion.

5. REMARKS

Market Value:

Na

Salvage Value:

Na

Repair Limit:

Na

Estimated Amount:

\$21,056.29

Adjusted Amount:

 
\$14,785.68

Lump Sum:

\$11,500.00

Estimated Repair Days:

12 days



Pursuant to your instruction, we have NOT AUTHORISED repair.

The assessment was conducted on a "Without Prejudice" basis.

If we are not notified of anything to the contrary within 14 days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by Aeon Auto Consultants LLP for any reliance on this report by any third party.

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874

Telephone +65 97687958 Facsimile +65 68264112 Email info@aeonac.com

Reg. No. LL0701273L (registered with limited liability)

ASSESSMENT REPORT FOR VEHICLE NO. SJS 2805 M

PARTS (LIST ITEMS)

| Qty | Description | Condition | Workshop's Estimate | Our |
|-----|--|-------------|------------------------|-----------------|
| 1 | FRONT BONNET | | | Assessment |
| 2 | FRONT BONNET HINGES L/R | Repair | 875.80 | - |
| 1 | FRONT BONNET MECHANISM LOCK | Repair | 77.80 | |
| 4 | FRONT BONNET RUBBER GUIDE STOPPER L/R X SVC | Bent | 85.10 | 85.10 |
| 1 | FRONT GRILLE | Bent | 24.00 | X 24.00 |
| 1 | FRONT GRILLE 'LOGO' EMBLEM | Cracked | 358.90 | 358.90 |
| 4 | FRONT GRILLE CLIPS | Necessary | 84.90 | 84.90 |
| 2 | FRONT HEADLAMP L/R | Necessary | 26.00 | 26.00 |
| 4 | FRONT HEADLAMP CLIPS L/R | Cracked | 2,200.00 | 2,200.00 |
| 2 | FRONT HEADLAMP LOWER BRACKET L/R | Necessary | 26.00 | 26.00 |
| 1 | FRONT BUMPER | Bent | 58.20 | 58.20 |
| 2 | FRONT BUMPER FOGLAMP L/R X SVC | Cracked | 873.90 | V 873.90 |
| 4 | FRONT BUMPER INNER AIR DUCT CLIPS L/R X SVC | Faulty | 500.40 | X 500.40 |
| 2 | FRONT BUMPER INNER AIR DUCT L/R X SVC | Necessary | 26.00 | X 26.00 |
| 1 | FRONT BUMPER LOWER CENTER GRILLE X SVC | Bent | 169.80 | X 169.80 |
| 1 | FRONT BUMPER LOWER UNDER COVER | Cracked | 489.60 | X 489.60 |
| 1 | FRONT BUMPER REINFORCEMENT | Repair | 68.00 | , - |
| 2 | FRONT BUMPER REINFORCEMENT BRACKET L/R X SVC | Bent | 309.50 | V 309.50 |
| 2 | FRONT BUMPER SIDE RETAINER L/R | Bent | 140.00 | X 140.00 |
| 2 | FRONT FENDER L/R | Bent | 36.00 | 36.00 |
| 2 | FRONT FENDER ARCH GARNISH L/R | Repair | 1,213.00 | - |
| 1 | FRONT SUPPORT PANEL TOP GARNISH | Bent | 306.00 | 306.00 |
| 6 | FRONT SUPPORT PANEL TOP GARNISH CLIPS | Cracked | 89.40 | 89.40 |
| 1 | FRONT SUPPORT PANEL | Necessary | 33.00 | 33.00 |
| 2 | FRONT SUB CHASSIS FRAME L/R | Repair | 550.00 | - |
| 2 | | Repair | 1,800.00 | |
| 2 | AIRCON CONDENSER TOP BRACKET L/R | Bent | 30,00 | 30.00 |
| 1 | AIRCON CONDENSER TOP RUBBER BUSH L/R | Bent | 18.00 | 18.00 |
| | AIRCON CONDENSER | Cracked | 729.40 | 729.40 |
| 1 | AIRCON COOLING PIPE | Repair | 240.00 | - |
| 1 | AIRCON DISCHARGE PIPE | Repair | 150.00 | - |
| 1 | RADIATOR | Cracked | 1,41 0.20 | 1,410.20 |
| 2 | RADIATOR LOWER RUBBER BUSH L/R | Bent | 16.00 | 16.00 |
| 1 | RADIATOR FAN COWLING | Repair | 109.40 | - |
| 1 | RADIATOR TOP HOSE | Repair | 36.50 | - |
| 1 | RADIATOR LOWER HOSE | Repair | 36.56 | - |
| 1 | REAR TAILGATE | Bent | 950.2 1,207.00 | 1,207.00 |
| 2 | REAR TAILGATE DAMPER L/R | Repair | 211.80 | - |
| 2 | REAR TAILGATE HINGES L/R | Repair | 93.40 | - |
| 1 | REAR TAILGATE 'LOGO' EMBLEM (RED) X SVC | Necessary | 60.00 | X 60.00 |
| 1 | REAR TAILGATE 'CIVIC' EMBLEM | Necessary | 5 5.00 | 55.00 |

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874

Telephone +65 97687958 Facsimile +65 68264112 Email info@aeonac.com

Reg. No. LL0701273L (registered with limited liability)

ASSESSMENT REPORT FOR VEHICLE NO. SJS 2805 M

| 1 1 | REAR TAILGATE INNER TRIANDOADO | Necessary | 53.00 | 53.00 |
|---------------------------------|---|--|---|---|
| | REAR TAILGATE INNER TRIM BOARD | Cracked | 152.80 | 152.80 |
| 2 | REAR TAILGATE REFLECTOR LAMP L/R X SVC | Cracked | 481 .40 | X 481.40 |
| 1 | REAR TAILGATE CENTRE LIGHT CLUSTER X SVC | Cracked | 282.70 | X 282.70 |
| 1 | REAR TAILGATE OUTER GARNISH X SVC | Cracked | 422.00 | X 422.00 |
| 1 | REAR TAILGATE MECHANISM LOCK | Bent | 165.20 | 165.20 |
| 1 | REAR TAILGATE MECHANISM LOCK GARNISH | Ben t | 12.50 | 12.50 |
| 2 | REAR TAILGATE RUBBER GUIDE L/R X SVC | Bent | 21.00 | X 21.00 |
| 1 | REAR TAILGATE WEATHER STRIP | Cut | 161.90 | 161.90 |
| 2 | REAR TAILLAMP L/R | Reuse SVC | 610.00 | - |
| 1 | REAR BUMPER | Cracked | 920.30 | 920.30 |
| 2 | REAR BUMPER SIDE RETAINER L/R X SVC | Bent | 29.20 | X 29.20 |
| 1 | REAR BUMPER LOWER DIFFUSER ASSY | Cracked | 388.00 | 388.00 |
| 2 | REAR BUMPER SIDE SHIELD L/R X SVC | Bent | 64.00 | X 64.00 |
| . 6 | REAR BUMPER SIDE SHIELD CLIPS L/R X SVC | Necessary | 39.00 | X 39.00 |
| 1 | REAR BUMPER REINFORCEMENT | Bent | 275.60 | 275.60 |
| 1 | REAR END PANEL INNER TOP GARNISH | Cracked | 122,80 | 122.80 |
| 4 | REAR END PANEL INNER TOP GARNISH CLIPS | Necessary | 26,00 | 26.00 |
| 1 | REAR END PANEL LOCK STRIKER X SVC | Bent | 12.00 | X 12.00 |
| 1 | REAR END PANEL LOCK STRIKER COVER X SVC | Bent | 10.00 | X 10.00 |
| 1 | REAR END PANEL | Bent | 330.40 | 330,40 |
| 1 | SPARE TYRE PANEL INNER TOP UPHOLSTERY BOARD | Repair | 316.00 | V , |
| 1 | SPARE TYRE PANEL | Repair | 1,100.00 | _ |
| | | | | |
| | 10304.2 | | 20,820.36 | 13,332.10 |
| | -20%: 8243.36 | Less 20% discount | 4,164.07 | 2,666.42 |
| | | Parts Total: | 16,656.29 | 10,665.68 |
| SPECI | AL NETT ITEMS | | | |
| 1 | FRONT BUMPER CLIPS ~ SET | Necessary | 30.00 | 30.00 |
| 1 | FRONT BUMPER NUMBER PLATE | Cracked | 25.00 | 15 25.00 |
| 1 | FRONT BUMPER NUMBER PLATE HOLDER | Cracked | | - |
| | | CIBCNEU | 50.00 | 25 50 00 |
| 1 | FRONT BUMPER LOWER UNDER COVER CLIPS - SET X SVC | | 50.00 30.00 | 25 50.00 x 30.00 |
| 2 | FRONT HEADLAMP BULB L/R X SVC | Necessary Faulty | 30.00 | X 30.00 |
| _ | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC | Necessary | 30.00 160.00 | X 30.00 X 160.00 |
| 2 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC | Necessary Faulty Faulty | 30.00 160.00 80.00 | X 30.00 X 160.00 X 80.00 |
| 2 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC | Necessary Faulty | 30.00 160.00 80.00 20.00 | X 30.00 X 160.00 X 80.00 X 20.00 |
| 2 2 2 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC RADIATOR COOLANT - BOTTLE | Necessary Faulty Faulty Faulty Faulty | 30.00 160.00 80.00 20.00 30.00 | X 30.00 X 160.00 X 80.00 X 20.00 X 30.00 |
| 2 2 2 2 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC RADIATOR COOLANT - BOTTLE REAR TAILGATE NUMBER PLATE X SVC | Necessary Faulty Faulty Faulty | 30.00 160.00 80.00 20.00 30.00 80.00 | X 30.00 X 160.00 X 80.00 X 20.00 X 30.00 40 80.00 |
| 2 2 2 2 1 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC RADIATOR COOLANT - BOTTLE REAR TAILGATE NUMBER PLATE X SVC REAR TAILGATE NUMBER PLATE HOLDER X SVC | Necessary Faulty Faulty Faulty Necessary | 30.00 160.00 80.00 20.00 30.00 80.00 25.00 | X 30.00 X 160.00 X 80.00 X 20.00 X 30.00 40 80.00 X 25.00 |
| 2 2 2 2 1 1 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC RADIATOR COOLANT - BOTTLE REAR TAILGATE NUMBER PLATE X SVC REAR TAILGATE NUMBER PLATE HOLDER X SVC REAR BUMPER CLIPS - SET | Necessary Faulty Faulty Faulty Faulty Necessary Cracked | 30.00 160.00 80.00 20.00 30.00 80.00 25.00 50.00 | X 30.00 X 160.00 X 80.00 X 20.00 X 30.00 40 80.00 X 25.00 X 50.00 |
| 2 2 2 2 1 1 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC RADIATOR COOLANT - BOTTLE REAR TAILGATE NUMBER PLATE X SVC REAR TAILGATE NUMBER PLATE HOLDER X SVC | Necessary Faulty Faulty Faulty Faulty Necessary Cracked Cracked | 30.00 160.00 80.00 20.00 30.00 80.00 25.00 | X 30.00 X 160.00 X 80.00 X 20.00 X 30.00 40 80.00 X 25.00 |
| 2 2 2 2 1 1 1 | FRONT HEADLAMP BULB L/R X SVC FRONT HEADLAMP 'HIGH' BEAM BULB L/R X SVC FRONT HEADLAMP 'PARKING' BULB L/R X SVC FRONT HEADLAMP 'SIGNAL' BULB L/R X SVC RADIATOR COOLANT - BOTTLE REAR TAILGATE NUMBER PLATE X SVC REAR TAILGATE NUMBER PLATE HOLDER X SVC REAR BUMPER CLIPS - SET | Necessary Faulty Faulty Faulty Faulty Necessary Cracked Cracked Necessary | 30.00 160.00 80.00 20.00 30.00 80.00 25.00 50.00 | X 30.00 X 160.00 X 80.00 X 20.00 X 30.00 40 80.00 X 25.00 X 50.00 √ 30.00 |

140

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874 Telephone +65 97687958 Facsimile +65 68264112 Email info@aeonac.com Reg. No. LL0701273L (registered with limited liability)

ASSESSMENT REPORT FOR VEHICLE NO. SJS 2805 M

| LABO | JR . | | |
|------|---|-----------|-------------------|
| S/N | Description | | Our Assessment |
| 1 | To remove, reinstall electrical wiring harness, check lighting, and rewire for parking sensor. | 140.00 | X 120.00 |
| 2 | To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. | | 60 100.00 |
| 3 | To remove, change air con parts, vacuums, refill air con gas. | 160.00 | 120 140.00 |
| 4 | To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident. To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re- | | 1,100.00 |
| 5 | | | 200 1,600.00 |
| 6 | To apply anti-rust chemical on repaired and replaced panel. | 120.00 | 60 100.00 |
| | 2540 Labour Total : | 3,440.00 | 3,160.00 |
| | TOTAL (PARTS & LABOUR) \$ | 21,056.29 | 14,785.68 |

The workshop has agreed to undertake the repair on a Lump Sum basis. The final adjusted Lump Sum contract amount is

\$11,500.00

(SINGAPORE DOLLARS ELEVEN THOUSAND FIVE HUNDRED ONLY)

Amas Ong Automobile Assessor 10923.36

-20%: 8700

8 days

















