

NEW AUTO SPEC APPRAISAL

25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Tel : 68468023 Fax : 68427801

Vehicle Survey Report

Reg No	: <u>NAS1225</u>	Date	: <u>25-02-2020</u>
Our Reference No.	: <u>SJJ6315G25112019</u>	Date Of Survey	: <u>25-11-2019</u>
Claim Type	: <u>Third Party</u>	Date Of Accident	: <u>24-11-2019</u>
Assignment Given By	: <u>Chong Wen Chyi</u>	Survey Conduct At	: <u>Multilateral Services</u>
		Address	: <u>160 Sin Ming Drive</u>
			: <u>Sin Ming Auto City</u>
			: <u>#06-01 Singapore 575722</u>

Particulars of vehicle

Vehicle Reg. No.	: <u>SJJ6315G</u>	Engine Number	: <u>Hidden</u>
Date Of Registration	: <u>22-09-2008</u>	Chassis Number	: <u>Z27A0501408</u>
Make	: <u>Mitsubishi</u>	Transmission Type	: <u>Automatic</u>
Model	: <u>Colt Ralliart</u>	Vehicle Colour	: <u>White</u>
		Mileage Reading	: <u>186338</u>

Visual and static test on vehicle during survey

Hand brake condition	: <u>Serviceable</u>	Body Condition	: <u>Fair</u>
Foot brake condition	: <u>Serviceable</u>	Paint Work condition	: <u>Fair</u>
Steering condition	: <u>Serviceable</u>	Remarks	: <u>None</u>
Modification	: <u>None</u>		

Condition of vehicle tyre

	Size	Make / Right Tread	Make / Left Tread
Front Tyre	: 205/45R18	Michelin / 6MM	Michelin / 6MM
Rear Tyre	: 205/45R18	Michelin / 6MM	Michelin / 6MM


Description on vehicle's point of impact and

Portion of the vehicle
(For more detail of the damages, please refer photographs attached)

Remarks

In accordance to your instruction, we have **NOT** authorised any repairs.
Estimated duration of repairs 08 days.
This survey was conducted entirely on a **"WITHOUT PREJUDICE"** basis.

Point Of Impact

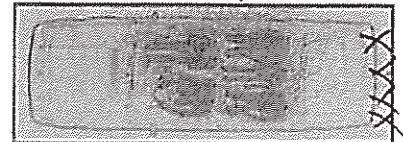

AUTO SPEC APPRAISER


25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Tel : 68468023 Fax : 68427801

Adjustment on Spare Parts & Repair Cost

S/No	Qty	Vehicle Parts Description	Condition	Original Quotation (\$\$)	Recommendation (\$\$)
1	1	Tailgate	Dent	1,654.00	1,654.00
2	1	Tailgate lock	Dent	308.00	308.00
3	1	Tailgate w/strip	Cut	225.00	225.00
4	1	Tailgate handle	Crack	103.40	103.40
5	1	Tailgate emblem logo	Necessary	36.30	36.30
6	1	Tailgate emblem colt	Necessary	46.00	46.00
7	1	Tailgate windscreen moulding	Necessary	134.45	134.45
8	1	Tailgate inner trim	Crack	458.00	458.00
9	1	Rear bumper	Crack	1,254.00	1,254.00
10	1	Rear bumper clip	Necessary	55.00	55.00
11	2	Rear bumper side guide	Necessary	28.80	28.80
2	2	Rear bumper bracket	Bent	48.80	48.80
13	1	Rear spare tyre panel	Repair	1,587.00	0.00
14	1	Rear centre panel	Buckled	1,154.00	1,154.00
15	1	Rear end panel top garnish	Deform	213.10	213.10
16	2	Taillamp	Crack	1,415.00	1,415.00
17	1	Exhaust pipe muffler	Repair	932.00	0.00
18	2	Exhaust mounting	Necessary	148.20	148.20
TOTAL :				9,801.05	7,282.05
<i>Less market discount 10%</i>				0.00	728.21
				9,801.05	6,553.85
1	1	Reverse sensor	Cut	280.00	280.00
2	1	Rear glass sealant	Necessary	180.00	150.00
3	1	No plate rear	Dent	80.00	80.00
TOTAL :				540.00	510.00
1		Check electrical wiring system.		50.00	30.00
2		Remove and refit carpet and upholstery.		250.00	180.00
3		Remove and refit exhaust pipe.		250.00	220.00
4		Anti rust.		200.00	150.00
5		Remove and refit rear windscreen glass.		280.00	220.00
6		Transfer tailgate fitting.		200.00	150.00
7		To putty and spray paint charges		1200.00	1000.00
8		Remove and refit damaged parts, cut,weld, panel beat, straighten and realign etc.		1200.00	1000.00
TOTAL :				3630.00	2950.00
TOTAL PARTS AND LABOUR				13,971.05	10,013.85
RECOMMENDED COST OF PART-BY-PART REPAIR					10,013.85

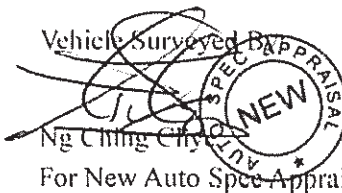Vehicle Surveyed By

 Ng Ching Chyng
 For New Auto Spec Appraisal

Information in this report is confidential and may be legally privileged. It is intended solely for the person to whom it is addressed. If you are not the intended recipient, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.