



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2005552
INV Date 13/08/2020
Reference CS/SMO20006580/R1sf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SGE 8885B
Insured Veh. GBF 4015B
Claim No. CMTD2001875/MYE
Policy No.
Accident Date 20/06/2020
Inspection Date 30/06/2020

Description	Total
Survey Inspection	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SOMPO INSURANCE SINGAPORE PL

Ref : CS/SMO20006580/R1sf3n2

50 RAFFLES PLACE

#05-01/06

SINGAPORE LAND TOWERSINGAPORE 048623

Date : 13-08-2020



Code : SMO

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBF 4015B	Veh. Inspected	SGE 8885B
Policy No.		Coverage (\$)	0.00
Claim No.	CMTD2001875/MYE	Excess (\$)	0.00
Assign From	GRACE TEO	Assign Date	23/06/2020

2. Vehicle Particulars & Condition

Make & Model	NISSAN SUNNY 1.6 EXA	c.c	1597
Engine No.	HIDDEN	Year of Reg.	2006
Chassis No.	JN1CFAN16Z0099211	Colour	GOLD
Odometer	240443	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/65 R15	FIRENZA	6 mm
L/H Front Tyre	185/65 R15	FIRENZA	6 mm
R/H Rear Tyre	185/65 R15	FIRENZA	6 mm
L/H Rear Tyre	185/65 R15	FIRENZA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	20/06/2020	Inspection Date	30/06/2020
Survey held at	MOVA AUTOMOTIVE PTE LTD BLK 1008 BUKIT MERAH LANE 3 #01-04/06/08 SINGAPORE 159722		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	7 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGE 8885B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT (N)	BENT	745.20	745.20
1	REAR BOOT LOGO (N)	NECESSARY	64.70	64.70
1	REAR BOOT EMBLEM "SUNNY" (N)	NECESSARY	68.30	68.30
1	REAR BOOT EMBLEM "EX SALOON" (N)	NECESSARY	68.30	68.30
1	REAR BOOT EMBLEM "CVTC" (N)	NECESSARY	65.50	65.50
1	REAR BOOT EMBLEM "E-THROTTLE" (N)	NECESSARY	65.50	65.50
1	REAR BOOT CHROME TOP (N)	SERVICEABLE	171.20	-
1	REAR BOOT CHROME LOWER (N)	SERVICEABLE	165.30	-
8	REAR BOOT CHROME CLIPS @\$5.90 (N)	NECESSARY	47.20	47.20
1	REAR BOOT LOCK TOP (N)	SERVICEABLE	114.20	-
1	REAR BOOT LOCK LOWER (N)	SERVICEABLE	76.50	-
1	REAR BOOT RUBBER (N)	TWISTED	177.20	177.20
2	REAR LAMP L+R @\$299.70 (N)	N/S CRACKED	599.40	299.70
1	REAR LAMP PANEL LH (N)	TO REPAIR SEE LABOUR	114.20	-
2	REAR LAMP CLIPS LH @\$5.90 (N)	NECESSARY (1 PC ONLY)	11.80	5.90
1	REAR END PANEL (N)	BENT	398.20	398.20
1	REAR END PANEL GARNISH (N)	SERVICEABLE	171.50	-
1	REAR PANEL TRIM (N)	SERVICEABLE	169.70	-
1	REAR BUMPER (N)	DEFORMED	595.20	595.20
1	REAR BUMPER CHROME (N)	NECESSARY	212.10	212.10
1	REAR BUMPER SPONGE (N)	SERVICEABLE	89.70	-
1	REAR BUMPER BRACKET LH (N)	NECESSARY	68.30	68.30
2	REAR BUMPER INNER BRACKET L+R @\$44.10 (N)	SERVICEABLE	88.20	-
2	REAR BUMPER RETAINER L+R @\$72.60 (N)	N/S NECESSARY	145.20	72.60
10	REAR BUMPER CLIPS @\$3.90 (N)	NECESSARY	39.00	39.00
2	REAR FENDER L+R (NPA)(N)	TO REPAIR SEE LABOUR	-	-
	LESS 10% DISCOUNT		-453.16	-299.29
			4,078.44	2,693.61

Report Ref No. CS/SMO20006580/R1sf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER SENSOR (SN)	NOT WORKING	200.00	200.00
1	REAR NUMBER PLATE (SN)	SERVICEABLE	45.00	-
			245.00	200.00
	<u>LABOUR</u>			
	TO CUT & WELD REAR PANEL.TO REPAIR REAR FENDER L+R,REAR FLOOR PANEL,REAR CHASSIS L+R.TO REMOVE & REFIX DAMAGED PARTS,STRAIGHTEN & REALIGN AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF REAR LAMP PANEL LH AND REAR FENDER L+R.		840.00	700.00
	TO SPRAY AFFECTED AREAS.		850.00	800.00
	TO REMOVE & REFIX LUGGAGE COMPARTMENT SIDE GARNISH,SIDE TRIM BOARD,CARPET & OTHER ATTACHMENT PARTS.		100.00	60.00
	TO REMOVE & REFIX REVERSE SENSOR & CHECK WATER SEEPAGE.		80.00	30.00
	TO RUST PROOF AFFECTED AREAS.		60.00	60.00
			1,930.00	1,650.00
GRAND TOTAL			6,253.44	4,543.61
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,500.00

Report Ref No. CS/SMO20006580/R1sf3n2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGE 8885B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGE 8885B

RE-INSPECTION

