

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/III20006677/EBA3Q2

**Date:** 03/09/2020

#### REFERENCE

Handling Insurer: India International Insurance Pte Ltd	Policy No:	MCOM0015
<b>Claimant</b>		
<b>Vehicle No :</b> SJS258E	<b>Insured Vehicle No :</b>	SHD4133H
Date of Loss: 24/06/2020	Nature of Claim: TP	Claim No: MCT20060295

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJS258E	Engine No:	L15B4433320
Make & Model:	HONDA VEZEL, 1.5 X CVT (A)	Chassis No:	RU11233312
Reg. Date:	21/06/2018 (Man. Year: 2017)	Odometer:	47847 km
Colour:	Silver		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

#### CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Dunlop 5 mm	Rear Left Side:	Dunlop 5 mm
Front Right Side:	Dunlop 5 mm	Rear Right Side:	Dunlop 5 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,964.48	4,550.88	4,413.60	49.23
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,190.00	1,810.00	1,380.00	43.26
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>12,154.48</b>	<b>6,360.88</b>	<b>5,793.60</b>	<b>47.67</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>5,100.00</b>		
<b>Nett Amount (S\$)</b>	<b>12,154.48</b>	<b>5,100.00</b>	<b>7,054.48</b>	<b>58.04</b>
<b>+ Car Rental (6.0 x S\$120.00/day) (S\$)</b>		720.00		
<b>+ Doc/Search Fee (S\$)</b>		7.49		
<b>Nett Liability (S\$)</b>		<b>5,827.49</b>		
<b>Global Sum Settlement (S\$)</b>		<b>5,800.00</b>		

#### INSPECTION

Date of Assignment:	25/06/2020	
Date Inspected:	25/06/2020 Inspected At:	My Car Consultant Pte Ltd (Ubi) 53 Ubi Ave 1, #01-33, Paya Ubi Industrial Park Singapore 408934

Estimated Period of Repair: 5.0 days

**Adjuster:** CHEN TSUE YEE

**Manager:** CHUA ZHEN LI

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Reference

<b>Part Source:</b> MRM-SG	Version: 1.0 (Last Synchronised: 29 Jul 2020)
<b>Parts:</b> M1-SUV	HONDA VEZEL 1.5 X CVT (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b> Repairer's	(Price-denominated Standard List)
<b>Print Code:</b> (Unsubmitted, no print-code for SJS258E)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Dented	1,184.20 FL	*1,100.00 FL
2	2		*TAILGATE HINGE L/R	Not Necessary	116.40 FL	*- FL
3	1		*TAILGATE WINDSCREEN MOULDING	Necessary	132.60 FL	*132.60 FL
4	1		*TAILGATE NO PLATE GARNISH ASSY	Not Necessary	241.60 FL	*- FL
5	2		*TAILGATE NO PLATE LAMP L/R	Not Necessary	130.00 FL	*- FL
6	2		*TAILGATE REFLECTOR LAMP L/R	Broken	594.40 FL	*594.40 FL
7	1		*TAILGATE EMBLEM -LOGO	Necessary	28.30 FL	*28.30 FL
8	1		*TAILGATE EMBLEM -VEZEL	Necessary	51.50 FL	*51.50 FL
9	1		*TAILGATE INNER TRIM BOARD	Broken	295.90 FL	*295.90 FL
10	10		*TAILGATE INNER TRIM BOARD CLIP	Necessary	32.00 FL	*20.00 FL
11	1		*TAILGATE LOCK	Bent	212.70 FL	*212.70 FL
12	1		*TAILGATE LOCK STRIKER	Not Necessary	28.60 FL	*- FL
13	1		*WEATHERSTRIP	Torn	240.80 FL	*240.80 FL
14	2		*TAILLAMP L/R	Not Necessary	1,006.40 FL	*- FL
15	2		*TAILLAMP PANEL L/R	Not Necessary	399.40 FL	*- FL
16	1		*REAR BUMPER	Dented	923.10 FL	*762.70 FL
17	2		*REAR CORNER BUMPER L/R	Broken	390.80 FL	*390.80 FL
18	1		*REAR BUMPER REFLECTOR L/R	N/S Broken	131.00 FL	*65.50 FL
19	2		*REAR BUMPER SUPPORT L/R	Not Necessary	62.80 FL	*- FL
20	2		*REAR BUMPER RETAINER L/R	Broken	53.00 FL	*53.00 FL
21	1		*REAR END PANEL	Dented	565.80 FL	*565.80 FL
22	1		*REAR END PANEL TOP GARNISH	Broken	210.50 FL	*210.50 FL
23	2		*REAR END PANEL GARNISH CLIP	Necessary	6.40 FL	*6.40 FL
24	1		*REAR COMPARTMENT LID	Repair	1,130.30 FL	*- FL
25	1		*REAR COMPARTMENT TOOL TRAY	Broken	282.40 FL	*226.00 FL
26	1		*REAR FLOOR PANEL	Repeated	1,176.30 FL	*- FL
27	1		*REAR FLOOR UNDERCOVER	Torn	246.50 FL	*190.00 FL
28	1		*REAR EXHAUST HEAT SHIELD	Not Necessary	233.70 FL	*- FL
29	1		*REAR EXHAUST SILENCER MOUNTING	Not Necessary	55.00 FL	*- FL
30	1		*REAR LOCK ANTENNA	Not Necessary	189.00 FL	*- FL
31	1		*REAR KEYLESS ENTRY WARNING BUZZER	Broken	154.20 FL	*154.20 FL
32	1		*SET REAR REVERSE SENSOR	Broken	250.00 FS	*200.00 FS
33	1		*SET REAR BUMPER CLIP	Necessary	80.00 FS	*30.00 FS
34	1		*SET REAR END PANEL GARNISH CLIP	Necessary	30.00 FS	*10.00 FS
35	1		*REAR NUMBER PLATE W/FRAME	Not Necessary	50.00 FS	*- FS
36	1		*TAILGATE WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
37	1		*FLOOR PANEL SEALANT	Not Necessary	50.00 FS	*- FS
38	1		*END PANEL SEALANT	Necessary	50.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$\$)</b>	<b>11,065.60</b>	<b>5,611.10</b>
<b>- List Item Discount on L Items 20.00/20.00% (\$\$)</b>	2,101.12	1,060.22
<b>Total Parts (\$\$)</b>	<b>8,964.48</b>	<b>4,550.88</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO CHECK REAR ELECTRICAL WIRING	New	50.00	30.00
2	TO REMOVE AND REFIT REVERSE SENSOR	New	80.00	30.00
3	TO REMOVE AND REFIT WINDSCREEN MOULDING	New	120.00	120.00
4	TO REMOVE AND RENEW FLOOR PANEL	New	120.00	0.00
5	TO REMOVE AND RENEW EXHAUST SILENCER	New	200.00	0.00
6	TO RESPRAY UNDERCOATING	New	100.00	0.00
7	APPLY ANTI RUST ON AFFECTED AREAS	New	120.00	30.00
8	SPRAY PAINTING ON AFFECTED AREAS	New	1,200.00	800.00
9	PANEL BEATING ON AFFECTED AREAS	New	1,200.00	800.00
<b>Gross Labour Cost (\$\$)</b>			<b>3,190.00</b>	<b>1,810.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >