

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	29 Jun 2020 Edit Reg		30 Jun 2020 00:00 Edit Adj Rpt	S\$0.00 Edit Estimates	S\$0.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS			[Created by adjuster]						
Insured: HU YU , ID: S8562479B									
Main Claimant: CHUA WEI MENG									
Vehicle Reg. No.: SKE1450X		Date of Loss: 26/06/2020 19:00 - :59 [100 Months and 16 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / 0104952037SG		Policy/Cover Note No.: 1900005647 (Comprehensive)							
Vehicle Reg. No. (Insured): SMH4668B		Policy No. (Claimant):							
		Excess:							
Repairer: Bluwel Automotive Service Pte Ltd (HQ) 1 Kaki Bukit Avenue 6, #01-28/37/53/55/56 Autobay@Kaki Bukit, 417883 Kaki Bukit - Tel: 67452088									
Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. (Express) - Tel: 65-6419-3000 ... [Handled by Ler, Bernard-JQ] BernardJiQian.Ler@aig.com									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 09/07/2020]									
ASSOCIATED MAIL RECEIVED				View All Compose Case Mail					
AIG_SG (01/07/2020): Request to upload TP GIA Report									
ALL ASSOCIATED TASKS			View All Search Tasks Create New Task Complete						
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SKE1450X (0104952037SG)**
[SMH4668B]

TP

CHUA WEI MENG

Jun 26 2020 7:00PM

[HU YU]

Bluwel Automotive Service Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser ▼		
Photos/Images			3 per page	▼	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	01/07/20 17:01	Chassis Number		Load JPG	☒
2	01/07/20 17:01	Odometer Reading		Load JPG	☒
3	01/07/20 17:02	General View		Load JPG	☒
4	01/07/20 17:02	General View		Load JPG	☒
5	01/07/20 17:02	General View		Load JPG	☒
6	01/07/20 17:02	General View		Load JPG	☒
7	01/07/20 17:02	General View		Load JPG	☒
8	01/07/20 17:02	General View		Load JPG	☒
9	01/07/20 17:02	General View		Load JPG	☒
10	01/07/20 17:02	General View		Load JPG	☒
11	01/07/20 17:02	General View		Load JPG	☒
12	01/07/20 17:02	General View		Load JPG	☒
13	01/07/20 17:02	General View		Load JPG	☒
14	01/07/20 17:02	General View		Load JPG	☒
15	01/07/20 17:02	General View		Load JPG	☒
16	01/07/20 17:02	General View		Load JPG	☒
17	01/07/20 17:02	General View		Load JPG	☒
18	01/07/20 17:02	General View		Load JPG	☒
19	01/07/20 17:02	General View		Load JPG	☒
20	01/07/20 17:02	General View		Load JPG	☒
21	01/07/20 17:02	General View		Load JPG	☒
22	01/07/20 17:02	General View		Load JPG	☒
23	01/07/20 17:02	General View		Load JPG	☒
24	01/07/20 17:02	General View		Load JPG	☒
25	01/07/20 17:02	General View		Load JPG	☒
26	01/07/20 17:02	General View		Load JPG	☒
27	01/07/20 17:02	General View		Load JPG	☒
28	01/07/20 17:02	General View		Load JPG	☒
29	01/07/20 17:02	General View		Load JPG	☒
30	01/07/20 17:02	General View		Load JPG	☒
31	01/07/20 17:02	General View		Load JPG	☒
32	01/07/20 17:02	General View		Load JPG	☒
33	01/07/20 17:02	General View		Load JPG	☒
34	01/07/20 17:02	Reinspection Photo		Load JPG	☒
35	01/07/20 17:02	Reinspection Photo		Load JPG	☒
36	01/07/20 17:03	Reinspection Photo		Load JPG	☒
37	01/07/20 17:03	Reinspection Photo		Load JPG	☒
38	01/07/20 17:03	Reinspection Photo		Load JPG	☒
39	01/07/20 17:03	Reinspection Photo		Load JPG	☒
40	01/07/20 17:03	Reinspection Photo		Load JPG	☒

Photos/Images			3 per page	✓
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
41	01/07/20 17:03	Reinspection Photo	Load JPG	✓
42	01/07/20 17:03	Reinspection Photo	Load JPG	✓
43	01/07/20 17:03	Reinspection Photo	Load JPG	✓
44	01/07/20 17:03	Reinspection Photo	Load JPG	✓
45	01/07/20 17:03	Reinspection Photo	Load JPG	✓
46	01/07/20 17:03	Reinspection Photo	Load JPG	✓
47	01/07/20 17:03	Reinspection Photo	Load JPG	✓
48	01/07/20 17:03	Reinspection Photo	Load JPG	✓
49	01/07/20 17:03	Reinspection Photo	Load JPG	✓
50	01/07/20 17:03	Reinspection Photo	Load JPG	✓
51	01/07/20 17:03	Reinspection Photo	Load JPG	✓
52	01/07/20 17:03	Reinspection Photo	Load JPG	✓
53	01/07/20 17:03	Reinspection Photo	Load JPG	✓
54	01/07/20 17:03	Reinspection Photo	Load JPG	✓
55	01/07/20 17:03	Reinspection Photo	Load JPG	✓
56	01/07/20 17:03	Reinspection Photo	Load JPG	✓
57	01/07/20 17:03	Reinspection Photo	Load JPG	✓
58	01/07/20 17:03	Reinspection Photo	Load JPG	✓
59	01/07/20 17:03	Reinspection Photo	Load JPG	✓
60	01/07/20 17:03	Reinspection Photo	Load JPG	✓
61	01/07/20 17:03	Reinspection Photo	Load JPG	✓
62	01/07/20 17:03	Reinspection Photo	Load JPG	✓
63	01/07/20 17:03	Reinspection Photo	Load JPG	✓
64	06/07/20 17:50	After Repair Photo	Load JPG	✓
65	06/07/20 17:50	After Repair Photo	Load JPG	✓
66	06/07/20 17:50	After Repair Photo	Load JPG	✓
67	06/07/20 17:50	After Repair Photo	Load JPG	✓
68	06/07/20 17:50	After Repair Photo	Load JPG	✓
69	06/07/20 17:50	After Repair Photo	Load JPG	✓
70	06/07/20 17:50	After Repair Photo	Load JPG	✓
71	06/07/20 17:50	After Repair Photo	Load JPG	✓
Documentation			1 per page	✓
No	Finalized On	AIG Asia Pacific Insurance Pte. Ltd. (SG)	Thumbnail	Print
1	01/07/20 17:41	OI GIA REPORT	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

Reset Save Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/AIG20006810/UTF3S2**Date:** 17/07/2020REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900005647
Claimant Vehicle No :	SKE1450X	Insured Vehicle No :	SMH4668B
Date of Loss:	26/06/2020	Nature of Claim:	TP
		Claim No:	0104952037SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKE1450X	Engine No:	27186130326358
Make & Model:	MERCEDES-BENZ SLK200, 1.8 (A)	Chassis No:	WDD1724482F021040
Reg. Date:	10/02/2012 (Man. Year: 2011)	Odometer:	81382 km
Colour:	Grey		
Engine Capacity:	1796 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	225/40ZR18	Rear Tyre Size:	245/40ZR18
Front Left Side:	Achilles 6 mm	Rear Left Side:	Achilles 6 mm
Front Right Side:	Achilles 6 mm	Rear Right Side:	Achilles 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	30/06/2020	Bluwel Automotive Service Pte Ltd (HQ)
Date Inspected:	01/07/2020 Inspected At:	1 Kaki Bukit Avenue 6, #01-28/37/53/55/56
		Autobay@Kaki Bukit
		Singapore 417883
Estimated Period of Repair:	5.0 days	

Adjuster: MARCUS CHUA**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Torn	0.00 F	*- F
2	1		*FRONT BUMPER LOGO	Necessary	0.00 F	*- F
3	1		*FRONT BUMPER FOG LAMP COVER N/S	Torn	0.00 F	*- F
4	1		*FRONT BUMPER CENTRE GRILLE	Not Necessary	0.00 F	*- F
5	1		*FRONT BUMPER SPONGE	Torn	0.00 F	*- F
6	1		*FRONT BUMPER PDC SENSOR	Shorted	0.00 F	*- F
7	1		*FRONT BUMPER LOWER COVER	Cracked	0.00 F	*- F
8	1		*FRONT BUMPER REINFORCEMENT	Bent	0.00 F	*- F
9	1		*FRONT GRILLE	Cracked	0.00 F	*- F
10	1		*FRONT GRILLE LOGO	Scratched	0.00 F	*- F
11	1		*FRONT LICENCE PLATE GARNISH	Deformed	0.00 F	*- F
12	2		*HEADLAMPS	Cracked	0.00 F	*- F
13	1		*FRONT SUPPORT TOP RETAINER	Cracked	0.00 F	*- F
14	1		*BONNET	Repair	0.00 F	*- F
15	1		*FRONT LICENCE PLATE	Bent	0.00 F	*- F
16	1		*FRONT GRILLE CHROME MOULDING	Scratched	0.00 F	*- F

F=Franchise part.

Total Parts (S\$)	0.00	0.00
-------------------	------	------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >