



TeamWork Garage Pte Ltd
53 Ubi Avenue 1 #01-23/24 Spore 408934
Paya Ubi Industrial Park
Tel : 6844 2475 Fax : 6844 2474
E-mail : claims@teamworkgarage.com
GST registered number : 201015366H

PROFOMA INVOICE - PI-2146

UNI-TAT ICE & MARKETING PTE LTD
C/O 53 Ubi Avenue 1 #01-24
Paya Ubi Industrial Park
Singapore 408934

Date : 01-Apr-20
Vehicle number : YP4367K
Make Model : HINO XZU700R
Accident date : 16-Feb-20
Reference number : 2002-43

Description		Amount SGD\$
Inclusive of supplying parts, labour, panel beating and spray painting		
Lump sum repair	:	7100.00
7% GST	:	497.00
Grand total	:	7597.00
Singdollars: SEVEN THOUSAND FIVE HUNDRED AND NINETY-SEVEN DOLLARS ONLY		





24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

INVOICE

Uni-Tat Ice & Marketing Pte Ltd
C/o: Teamwork Garage Pte Ltd
53 Ubi Avenue 1 #01-24
Paya Ubi Industrial Park, Singapore 408934

Invoice No: CL/200208
Ref No: TWG/03/2004/TP
Date: 12 March 2020

DESCRIPTION	AMOUNT
OUR SERVICE FEE CHARGES:	
- SURVEY INSPECTION FOR VEHICLE NO. <u>YP 4367 K</u> - RESURVEY INSPECTION - DIGITAL PHOTOGRAPHS SERVICES (INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS) - TRANSPORTATION	
GRAND TOTAL	S\$ 590.00

E & O. E

All cheque payment should be "Crossed" and made payable to "CL APPRAISER PTE LTD"

We shall be grateful if you could forward our payment at your early convenience.



CL Appraiser Pte Ltd

CL APPRAISER PTE LTD

24 Penshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Uni-Tat Ice & Marketing Pte Ltd
C/o: Teamwork Garage Pte Ltd
53 Ubi Avenue 1 #01-24
Paya Ubi Industrial Park, Singapore 408934

Date : 12 March 2020
Our ref : TWG/03/2004/TP

Accident Date : 16 February 2020
Inspection Date : 03 March 2020
Repairer Name : Teamwork Garage Pte Ltd
53 Ubi Avenue 1 #01-24
Paya Ubi Industrial Park, Singapore 408934

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No : YP 4367 K
Make / Model : Hino XZU700R
Chassis No : JHHTCS3H70K003142
Engine No : N04CUS28549

Year / Capacity : 2016 / 4009 cc
Colour : White
Mileage : 197264

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front Nearside	Casumina	7.00 -16	5 mm	Normal
Front Offside	Casumina	7.00 -16	5 mm	Normal
Rear Nearside	Kenda	7.00 -16	5.00 / 5.00 mm	Normal
Rear Offside	Kenda	7.00 -16	5.00 / 5.00 mm	Normal

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the o/s front portion.
(Details refer to the photographs attached)

Enclosed number of photographs: **45** copies

REMARKS

This inspection was conducted entirely on a "**WITHOUT PREJUDICE**" basis
and we have not given authorization and instruction to the repairer to proceed with the repair

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle
and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$ 7,100.00** on a contractual basis.

Under normal circumstances, the repair period would be about 7 (Seven) working days.

Vehicle Registration No: YP 4367 K

Our Ref No: TWG/03/2004/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Front o/s headlamp	Damage	\$ 950.53	\$ 950.53 816 ✓
1	Front grille	Intact	\$ 682.65	
1	Front bumper	Damage	\$ 1,487.26	\$ 1,487.26 980 ✓
1	Front bumper o/s bracket	Damage	\$ 426.50	\$ 426.50 X SVC
1	Front bumper o/s fog lamp	Damage	\$ 320.00	\$ 320.00 X SVC
1	Front o/s door	Damage	\$ 2,632.86	\$ 2,632.86 1605 ✓
1	Front o/s door rubber	Necessary	\$ 125.30	\$ 125.30 X SVC
1	Front o/s door signal lamp	Damage	\$ 86.95	\$ 86.95 ✓
1	O/s wheel arch panel garnish	Damage	\$ 289.62	\$ 289.62 ✓
1	O/s step panel garnish	Damage	\$ 425.00	\$ 425.00 ✓
			\$ 7,426.67	\$ 6,744.02
			<i>Less 10%</i>	<i>\$ 742.67 \$ 674.40</i>
Total Cost - List Items			\$ 6,684.00	\$ 6,069.62

4202.57

-10%

3782.31

SPECIAL NETT ITEMS

1	Front o/s door company sticker	Necessary	\$ 450.00	\$ 450.00 200 ✓
1	Front o/s wheel rim	Damage	\$ 500.00	\$ 500.00 X SVC
1	Front o/s tyre (Depreciation)	Damage	\$ 400.00	\$ 200.00 X SVC
Total Cost - Special Nett items			\$ 1,350.00	\$ 1,150.00

200

Total cost of parts

\$ 8,034.00 \$ 7,219.62

Vehicle Registration No: YP 4367 K

Our Ref No: TWG/03/2004/TP

S/No	Description	Repairer's Estimate	Revised Amount
Total cost of parts c/f		\$ 8,034.00	\$ 7,219.62

LABOUR

1	To check wiring , lighting and resetting headlamps focussing.	\$ 80.00	\$ 50.00	30 ✓
2	To remove and refit doors complete fittings and replace damaged parts, transfer all fittings to new door.	\$ 150.00	\$ 150.00	50 ✓
3	To apply undercoating on repaired and replaced panel.	\$ 100.00	\$ 60.00	30 ✓
4	To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident.	\$ 1,080.00	\$ 750.00	400 ✓
5	To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident.	\$ 1,000.00	\$ 660.00	400 ✓

910

GRAND TOTAL

\$ 10,444.00	\$ 8,889.62
---------------------	--------------------

P - 3782.31

N - 200

L - 910

= 4892.31

L/S - 3913.84

= 3900

4 repair day

C L APPRAISER PTE LTD

Vehicle Registration No: YP 4367 K

Our Ref No: TWG/03/2004/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 7,100.00**

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deem to be vaild.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

C L APPRAISER PTE LTD



Cheong K. H
Automotive Appraiser























